# GRAHAM + SIBBALD

# Home Report

**Inner** Persie

Bridge of Cally PH10 7LQ

Date of Valuation: 01/04/2024 AIMS Ref: PER-2024\03\0095

# single survey

# survey report on:

Property address	Inner Persie
	Bridge of Cally PH10 7LQ
	·
Customer	Mr + Mrs Smith

Prepared by	Graham + Sibbald LLP

# 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise a detached bungalow and self contained two-
	bedroom annexe situated within generous private grounds.

Accommodation	Main - Entrance Vestibule, Lounge, Dining Room, Kitchen, Utility Room,
	Four Bedrooms, Two Bathrooms and WC.
	Annexe - Open Plan Living/Kitchen, Two Bedrooms and Shower Room.

Gross internal floor area (m <sup>2</sup> )	212

Neighbourhood and location	The subjects are located within a semi-rural location with open views
	to the surrounding agricultural fields. There is limited provision for
	everyday amenities within the immediate area, the usual day to day
	facilities being accessible within Blairgowrie, 6 miles to the south. A
	wider range of facilities and essential services are provided within
	Perth or Dundee, both of which are considered to be commutable by
	car.

Age (year built)	1975 - extended 2015
------------------	----------------------

Weather	It was dry and overcast at the time of our inspection.

Chimney stacks	Visually inspected with the aid of binoculars where appropriate.
	The chimney stacks are brick built with the flashings beneath dressed with lead.

Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate.
	Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.
	The roof is of pitched timber frame construction, overlaid with concrete interlocking tiles incorporating metal lined valley gutters and plastic dry verges.
	The main roof void was accessed via a ceiling hatch and standing ladder. The loft space is insulated in full, and partially floored. Full and safe passage was not possible in the absence of flooring or crawl boards. Insulation was not lifted or disturbed.
	A further ceiling hatch within the utility room allowed for a `head and shoulders` inspection of the roof void over the annexe. Insulation restricted our inspection.

Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.
	The rainwater fittings are of PVC manufacture comprising of half- round gutters and rounded downpipes.

Main walls	Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected.
	The walls are consistent with a load bearing timber frame, cavity and outer skin of brick externally finished with dry dash render.

Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	There are part-glazed uPVC external doors, with a set of uPVC double doors within both the annexe and main reception room, each providing access to the garden.
	The windows are of uPVC sealed unit double glazed installations.
	There are low maintenance PVC soffit, fascia and barge boards around the roof perimeter.

External decorations	Visually inspected.

Conservatories / porches	There are no structures of this type pertaining to the subjects.

Communal areas	There are no communal areas.

Garages and permanent	Visually inspected.
outbuildings	<u>-</u> , , , , , , , , , , , , , , , , , , ,
	There is a detached double garage and workshop, accessed via an
	electric roller vehicular door. The walls are of rendered brick,
	beneath a pitched timber frame roof which is overlaid with concrete
	interlocking tiles. Stored contents restricted our inspection.

Outside areas and boundaries	Visually inspected.
	The subjects are situated within generous grounds comprising both formal garden and an adjoining paddock, enclosed where inspected, by timber post and wire fence. The grounds are moderately sloping and mainly laid to grass.
	The subjects are approached in the first instance via a communal private road, over which it is presumed a right of access is held, and thereafter via a private road which serves the subjects property alone.

Ceilings	Visually inspected from floor level.
	The ceilings are consistent with plasterboard.

Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	The walls are consistent with plasterboard.

Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.
	Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.
	The floors are consistent with suspended timber construction.
	Fitted floor coverings restricted our inspection and no hatch was located which allowed for an inspection of the sub-floor chamber.

Internal joinery and kitchen	Built-in cupboards were looked into but no stored items were moved.
fittings	Kitchen units were visually inspected excluding appliances.
	The internal doors, skirting boards and architraves are of timber design.
	There is a modern fitted kitchen both within the main dwelling and annexe, each with base/wall cabinets and a range of integrated kitchen appliances.

Chimney breasts and fireplaces	Visually inspected. No testing of the flues or fittings was carried out.
	There is a wood burning stove within the main reception room and annexe.

Internal decorations	Visually inspected.

Cellars	There are no cellars pertaining to the subjects.

Electricity	Accessible parts of the wiring were visually inspected without
	removing fittings. No tests whatsoever were carried out to the system
	or appliances. Visual inspection does not assess any services to make
	sure they work properly and efficiently and meet modern standards. If
	any services are turned off, the surveyor will state that in the report
	and will not turn them on.
	Mains connection.
	The meter and distribution boards are located within a hall cupboard.

Gas	Accessible parts of the system were visually inspected without
	removing fittings. No tests whatsoever were carried out to the system
	or appliances. Visual inspection does not assess any services to make
	sure they work properly and efficiently and meet modern standards. If
	any services are turned off, the surveyor will state that in the report
	and will not turn them on.
	There is no mains gas supplied.

Inner Persie . Bridge of Cally PH10 7LQ Perth PER-2024\03\0095 Inspection Date:- 01/04/2024 First Inspection Date (if applicable):-

Water, plumbing, bathroom	Accessible parts of the system were visually inspected without		
fittings	removing fittings. No tests whatsoever were carried out to the system		
	or appliances. Visual inspection does not assess any services to make		
	sure they work properly and efficiently and meet modern standards. If		
	any services are turned off, the surveyor will state that in the report		
	and will not turn them on.		
	It should be appreciated that concealed areas beneath and around		
	baths and shower trays could not be inspected. Water spillage in		
	these areas can result in dampness/decay and no comment can be		
	made on inaccessible areas. Waterproof seals in sanitary areas should		
	be checked and maintained on a regular basis.		
	3		
	A private communal (hillside) water supply supplied the subjects and		
	two neighbours. The filtration equipment is located within a kitchen		
	cupboard.		

Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances.
	There is an oil-fired central heating and hot water system. The boiler is floor mounted within the kitchen, with heat distributed to the main apartments via water filled radiators.
	The central heating system provides hot water, in conjunction with a foam insulated cylinder which is fitted with an electric immersion and thermostat.

Drainage	Drainage covers etc were not lifted.
	Neither drains nor drainage systems were tested.
	Private sewage treatment system.

Fire, smoke and burglar alarms	Visually inspected. No tests whatsoever were carried out to the system
	or appliances.
	Next we shall be a standard and the interval in the state of in Castley die Estername
	New smoke alarm standards were introduced in Scotland in February
	2022. In instances where alarms are in place, no tests whatsoever
	have been carried out and we cannot confirm if the system complies
	with the most recent regulations. Any potential purchaser should
	satisfy themselves as to whether the current system meets with
	regulations or otherwise.

Additional limits to inspection	The subjects were occupied and furnished at the time of our inspection.
	The services were not tested.
	A restricted `head and shoulders` inspection only was possible within both the main and annexe roof void. Insulation present was not lifted nor disturbed.
	No tests were carried out of the private water supply and the private sewage treatment system was not inspected.
	The full extent of the grounds were not inspected, the extent of the grounds and position of the boundaries will require to be confirmed through reference to the title plan.
	It is not within the scope of this inspection to determine whether or not asbestos based products are present within the property. Asbestos was widely used in the building industry until around 1999, when it became a banned substance. If you have any concerns you should engage the services of a qualified asbestos surveyor.
	No inspection for Japanese Knotweed was carried out and unless otherwise stated for the purpose of this report, it is assumed that there is no Japanese Knotweed within the boundaries of the property or neighbouring properties.
	It should be appreciated that the Home Report inspection is a non- disruptive visual inspection of the property as at the date of inspection and that we are unable to inspect parts of the property which are concealed or covered by floor coverings or contents in place at that time. Once vacant, defects may be apparent that could not be detected during our survey. Changing weather conditions can also affect aspects of the property which would not be apparent at the time of inspection.



# Sectional Diagram showing elements of a typical house

Chimney pots 1 2 Coping stone 3 Chimney head Flashing 4 Ridge ventilation 5 Ridge board 6 7 Slates/tiles 8 Valley guttering 9 Dormer projection Dormer flashing 10 Dormer cheeks 11 12 Sarking Roof felt 13 Trusses 14 15 Collar 16 Insulation 17 Parapet gutter Eaves guttering 18 Rainwater downpipe 19 20 Verge boards / skews 21 Soffit boards 22 Partition wall Lath / plaster 23 24 Chimney breast 25 Window pointing Window sills 26 Rendering 27 Brickwork / pointing 28 Bay window 29 30 Lintels 31 Cavity walls / wall ties Subfloor ventilator 32 33 Damp proof course 34 Base course 35 Foundations Solum 36 37 Floor joists Floorboards 38 Water tank 39 40 Hot water tank parts of the property. This diagram may assist you in locating and understanding

Inner Persie . Bridge of Cally PH10 7LQ Perth PER-2024\03\0095 Inspection Date:- 01/04/2024 First Inspection Date (if applicable):-

these items.

# 2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with	Repairs or replacement	No immediate action or repair
them may cause problems to other parts of the property or cause	requiring future attention,	is needed.
a safety hazard. Estimates for repairs or replacement are needed	but estimates are still	
now.	advised.	

S	ructural movement
Repair category	1
Notes	At the time of our inspection there was no evidence noted of recent or significant structural movement.
	ampness, rot and infestation
Repair category	2
Notes	Damp stained plaster was noted to the ceiling within the front and rear, south most bedrooms. Further investigation required.
	Elevated moisture readings were recorded to some lower walls, skirting boards and timber floors (where accessible), in particular with the south most, front and rear bedrooms. Black mould was noted in some areas consistent with condensation. No access was obtained to the sub-floor chamber and no comment is made as to the underlying conditions within concealed areas.
	In light of these findings it is recommended that the property is inspected by a reputable timber and damp specialist contractor.
	nimney stacks
Repair category	2
Notes	There is deterioration to the brick on the east most stack.

	1		
1	2		

# Roofing including roof space

Repair category	2		
Notes	The roof appeared in a condition consistent with age and type, with wear and tear noted to the tiles and other components. The main roof is assumed original, and is of an age which will require repair/attention during a programme of normal routine maintenance. Damp stained timbers were noted beneath the valley gutters consistent with prior spillage/leakage. We are informed by the vendor that the valley gutters have been checked and repaired where appropriate. Stained timber tested dry at the time of our inspection.		
Rainw	ater fittings		
Repair category	1		
Notes	There was no indication of staining which would suggest significant or prolonged spillage/leakage. Normal routine maintenance will be required. The prevailing weather conditions at the time of our inspection should be noted.		
Main v	valls		
Repair category	1		
Notes	The render wall finishes are typically weathered, with hairline cracks and previous patch repairs noted. Further repairs of this nature will be required. There is deterioration to the render around several windows.		
	Salt stained brickwork was noted to the base course.		

 Windows, external doors and joinery

 Repair category
 1

Notes	The windows are understood to have been installed circa 2015 and enquiries should be made to ascertain if any guarantees are held. The windows appeared in a condition consistent with age and use, periodic attention to the sealed units and hinges/mechanisms should be allowed for as part of a normal programme of routine maintenance. Nesting materials were noted around the roof perimeter.			
Externa	I decorations			
Repair category	1			
Notes	Normal decorative maintenance required.			
Conservatories / porches				
Repair category	-			
Notes	Not applicable.			
Commu	nal areas			
Repair category	-			
Notes	Not applicable.			
Garages	s and permanent outbuildings			
Repair category	1			

Within the limitations of our inspection, the garage appeared in a condition consistent with age and use with no significant items of repair outstanding. There is white mould to the timbers on the underside of the roof consistent with condensation. Typical wear and tear was noted to the roof tiles, with areas of stained render to the external walls.         There is high ground level to the rear, it is presumed that the internal face of the rear wall was obstructed by the presence of stored contents, the limitation to our inspection should be noted and our report read in this context.         Repair category       1         Notes       Ceilings         Repair category       1         Notes       See section headed 'Dampness, rot and infestation'. Cracking and blemishes were noted, and repairs should be expected as part of a programme of normal decorative maintenance.         Repair category       1         Notes       Cracking and blemishes were noted, and repairs should be expected as part of a programme of normal decorative maintenance.         Repair category       1         Notes       Cracking and blemishes were noted, and repairs should be expected as part of a programme of normal decorative maintenance.         Repair category       1         Notes       Cracking and blemishes were noted, and repairs should be expected as part of a programme of normal decorative maintenance.         Repair category       1         Notes       Cracking and blemishes were noted, and repairs should be expected as part of a programme of normal decorative m	Notes		Stored contents restricted our internal inspection.			
the rear wall was tanked (damp proofed) at the time of construction. The internal face of the rear wall was obstructed by the presence of stored contents, the limitation to our inspection should be noted and our report read in this context.         Image: Category Image: Provide the presence of stored contents, the limitation to our inspection should be noted and our report read in this context.         Repair category Image: Provide the presence of stored contents, the limitation to our inspection should be noted and our report read in this context.         Repair category Image: Provide the presence of stored contents, the limitation to our inspection should be noted and our report read in this context.         Repair category Image: Provide the presence of stored contents, the limitation to our inspection should be expected as part of a programme of normal decorative maintenance.         Repair category Image: Provide the presence of stored contents and blemishes were noted, and repairs should be expected as part of a programme of normal decorative maintenance.         Repair category Image: Provide the presence of a programme of normal decorative maintenance.         Repair category Image: Provide the presence of a programme of normal decorative maintenance.         Repair category Image: Provide the presence of a programme of normal decorative maintenance.         Repair category Image: Provide the presence of a programme of normal decorative maintenance.         Repair category Image: Provide the presence of a programme of normal decorative maintenance.         Repair category Image: Provide the presence of a programme of normal decorative maintenance.			consistent with age and use with no significant items of repair outstanding. There is white mould to the timbers on the underside of the roof consistent with condensation. Typical wear and tear was noted to the roof tiles, with			
Repair category       1         Notes       The post and wire fences will require normal joinery and decorative maintenance.         Image: Ceilings       Ceilings         Repair category       1         Notes       See section headed 'Dampness, rot and infestation'.         Cracking and blemishes were noted, and repairs should be expected as part of a programme of normal decorative maintenance.         Internal walls         Repair category       1         Notes       Cracking and blemishes were noted, and repairs should be expected as part of a programme of normal decorative maintenance.         Image: Cracking and blemishes were noted, and repairs should be expected as part of a programme of normal decorative maintenance.         Repair category       1         Notes       Cracking and blemishes were noted, and repairs should be expected as part of a programme of normal decorative maintenance.         Floors including sub-floors       Floors including sub-floors			the rear wall was tanked (damp proofed) at the time of construction. The internal face of the rear wall was obstructed by the presence of stored contents, the limitation to our inspection should be noted and our report read			
Notes       The post and wire fences will require normal joinery and decorative maintenance.         Image: Ceilings       Ceilings         Repair category       1         Notes       See section headed 'Dampness, rot and infestation'. Cracking and blemishes were noted, and repairs should be expected as part of a programme of normal decorative maintenance.         Internal walls       Internal of normal decorative maintenance.         Repair category       1         Notes       Cracking and blemishes were noted, and repairs should be expected as part of a programme of normal decorative maintenance.         Repair category       1         Notes       Cracking and blemishes were noted, and repairs should be expected as part of a programme of normal decorative maintenance.         Repair category       1         Notes       Floors including sub-floors	Pullim	Outside	areas and boundaries			
maintenance.         Ceilings         Repair category       1         Notes       See section headed `Dampness, rot and infestation`. Cracking and blemishes were noted, and repairs should be expected as part of a programme of normal decorative maintenance.         Internal walls       Internal walls         Repair category       1         Notes       Cracking and blemishes were noted, and repairs should be expected as part of a programme of normal decorative maintenance.         Notes       Internal walls         Repair category       1         Notes       Cracking and blemishes were noted, and repairs should be expected as part of a programme of normal decorative maintenance.         Floors including sub-floors	Repair catego	bry	1			
Repair category       1         Notes       See section headed `Dampness, rot and infestation`.         Cracking and blemishes were noted, and repairs should be expected as part of a programme of normal decorative maintenance.         Internal walls         Repair category       1         Notes       Cracking and blemishes were noted, and repairs should be expected as part of a programme of normal decorative maintenance.         Notes       Internal walls         Repair category       1         Notes       Cracking and blemishes were noted, and repairs should be expected as part of a programme of normal decorative maintenance.         Internal walls       Floors including sub-floors	Notes					
Notes       See section headed `Dampness, rot and infestation`.         Cracking and blemishes were noted, and repairs should be expected as part of a programme of normal decorative maintenance.         Internal walls         Repair category       1         Notes       Cracking and blemishes were noted, and repairs should be expected as part of a programme of normal decorative maintenance.         Notes       Cracking and blemishes were noted, and repairs should be expected as part of a programme of normal decorative maintenance.         Floors including sub-floors		Ceilings				
Cracking and blemishes were noted, and repairs should be expected as part of a programme of normal decorative maintenance.         Internal walls         Repair category       1         Notes       Cracking and blemishes were noted, and repairs should be expected as part of a programme of normal decorative maintenance.         Provide the strength of the strengt of the strengt of the strength of the strength of the st	Repair catego	bry	1			
a programme of normal decorative maintenance.         Internal walls         Repair category       1         Notes       Cracking and blemishes were noted, and repairs should be expected as part of a programme of normal decorative maintenance.         Floors including sub-floors	Notes		See section headed `Dampness, rot and infestation`.			
Repair category       1         Notes       Cracking and blemishes were noted, and repairs should be expected as part of a programme of normal decorative maintenance.         Floors including sub-floors						
Notes       Cracking and blemishes were noted, and repairs should be expected as part of a programme of normal decorative maintenance.         Floors including sub-floors	Internal		walls			
of a programme of normal decorative maintenance.  Floors including sub-floors	Repair category		1			
	Notes					
Repair category     1		Floors in	ncluding sub-floors			
	Repair catego	bry	1			

Notes	Fitted floor coverings restricted our inspection and no access was obtained to the sub-floor chamber. Within the limitations of our inspection there was no evidence noted of significant defect. Normal routine maintenance will be required.			
Internal	joinery and kitchen fittings			
Repair category	1			
Notes	The internal joinery and fitted kitchens appeared in a condition consistent with age and use, with some typical items of wear and tear noted.			
	There are no kite marks to the glazed internal doors and no checks were performed to establish if the glazing meets with the relevant safety standards			
Chimne	y breasts and fireplaces			
Repair category	1			
Notes	It is presumed that the stoves have been installed in accordance with the manufacturer's recommendations. The appliance has not been tested and is presumed to be in full and safe working order. Recent service records should be exhibited.			
	All flue linings should be checked, repaired if necessary and swept prior to the stoves being reused.			
Internal	decorations			
Repair category	1			
Notes	The property is in reasonable decorative order.			
Cellars				
Repair category	-			
Notes	Not applicable.			

Electrici					
Repair category	2				
Notes	The electrical system appears to have been upgraded although it is unclear the extent of the work which may have been carried out to the concealed/non-surface components. Any information in respect of past electrical work completed should be exhibited. Further upgrading may be required to comply in full with current electrical regulations and additional advice can be obtained from a reputable electrical contractor. The Institution of Engineering and Technology recommends that inspections and testing are undertaken at least every ten years and on a change of occupancy. It should be appreciated that only the most recently constructed or re-wired properties will have installations which fully comply with IET regulations.				
Gas					
Repair category	-				
Notes	Not applicable.				
Water,	olumbing and bathroom fittings				
Repair category	2				

Notes	Drainage is we understand to a private sewage treatment system. This was not checked or tested and it should be ensured that the appropriate registration documents are held.				
Repair category	1				
Drainage	e				
Notes	It is presumed that the central heating and hot water system has been annually serviced and that recent records are held.				
Repair category	1				
Heating	and hot water				
	The property is understood to have a private hillside communal water supply which serves the subject and two neighbours. This source is assumed to be reliable. Neither the reliability nor purity of the supply have been tested and any purchaser should satisfy themselves in these respects prior to purchase.				
	There is condensation and black mould to the underside of the toilet cisterns.				
	It should be appreciated that concealed areas beneath and around baths and shower trays could not be inspected. Water spillage in these areas can result in dampness/decay and no comment can be made on inaccessible areas. The waterproof seals in sanitary areas will require continued and careful attention as part of a programme of normal routine maintenance.				
Notes	There is damp to the floor, and water damaged skirting to the base of the shower enclosure (bathroom) consistent with spillage/leakage. This will require to be further investigated and repaired where required.				

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1	Cat
Dampness, rot and infestation	2	Urge
Chimney stacks	2	— repl Failu
Roofing including roof space	2	caus of t
Rainwater fittings	1	of t
Main walls	1	repa
Windows, external doors and joinery	1	
External decorations	1	
Conservatories / porches	-	Cate
Communal areas	-	Rep
Garages and permanent outbuildings	1	
Outside areas and boundaries	1	are
Ceilings	1	
Internal walls	1	Cat
Floors including sub-floors	1	No i
Internal joinery and kitchen fittings	1	— repa
Chimney breasts and fireplaces	1	
Internal decorations	1	
Cellars	-	
Electricity	2	
Gas	-	_
Water, plumbing and bathroom fittings	2	
Heating and hot water	1	_
Drainage	1	

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

## Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

## Category 1

No immediate action or repair is needed.

## Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

## Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability,

value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

# 3. Accessibility information

## Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1.	Which floor (s) is the living accommodation on?		Gro	und	
2.	Are there three steps or fewer to a main entrance to a property?	Yes		No	Х
3.	Is there a lift to the main entrance door of the property?	Yes		No	Х
4.	Are all door openings greater than 750mm?	Yes		No	Х
5.	Is there a toilet on the same level as the living room and kitchen?	Yes	Х	No	
6.	Is there a toilet on the same level as a bedroom?	Yes	Х	No	
7.	Are all rooms on the same level with no internal steps or stairs?	Yes	Х	No	
8.	Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes	Х	No	

# 4. Valuation and conveyance issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated cost for insurance purposes.

# Matters for a solicitor or licensed conveyancer

There is a communal private (hillside) water supply serving the property. It is assumed that the flow has been continuous for at least 10 years and the water is fit for human consumption. It would be prudent to carry out checks.

Drainage is we understand to a private sewage treatment system. This was not checked or tested and it should be ensured that the appropriate registration documents are held.

The valuation is made on the assumption that any alterations that may have been carried out to the property satisfy all relevant legislation and have full certification where appropriate. While not necessarily an exhaustive list, alterations noted at the time of our inspection include the addition of a self-contained two bedroom annexe with associated internal alterations.

The subjects are approached in the first instance via a communal private road, over which it is presumed a right of access is held, and thereafter via a private road which serves the subjects property alone. Burden with respect to upkeep and repair of the road is presumed to be apportioned on a fair and equitable basis. The purchasing solicitor will require to confirm that the legal arrangements are adequate.

We are unaware of any adverse planning proposals affecting the subjects although this should be confirmed by obtaining a Property Enquiry Certificate.

Absolute Ownership assumed. We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.

It is recommended that where repairs, defects or maintenance items have been identified, particularly categorised as a 2 or 3, interested parties make appropriate enquiries in order to satisfy themselves of potential costs and the extent of the works required prior to submitting a legal offer to purchase.

## Estimated reinstatement cost for insurance purposes

## £625,000

It is assumed that insurance cover is obtainable on normal terms. The guidance figure is the estimate of costs for reinstating the subjects as at the date of inspection based on information provided by the Building Cost Information Service (BCIS). It is recommended that this figure is kept under regular review to ensure that you have adequate insurance cover. We are of the opinion that the subjects should be insured for buildings reinstatement purposes for a sum of not less than £625,000 (Six Hundred and Twenty-Five Thousand Pounds Sterling).

# Valuation and market comments

## £450,000

We are of the opinion that the market value of the subjects all as previously described and on a vacant possession basis would be fairly stated in the region of £450,000 (Four Hundred and Fifty Thousand Pounds Sterling).

Report author         Andrew Hitchen
--------------------------------------

Address	3 Charlotte Street, Perth. PH1 5LW.

Signed	A. Hirchen.
	Andrew Hitchen, BSc MRICS For and on behalf of Graham + Sibbald LLP

Date of report	1/4/2024
----------------	----------

# TERMS AND CONDITIONS OF SINGLE SURVEY

GENERAL

## 1.1 The Surveyors

The Seller has engaged the Surveyors to provide the Report and a Generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited energy company.

The Surveyors are authorised to provide a transcript or retype of the Generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by brokers and lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the Generic Mortgage Valuation Report and the Report. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the Generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and Generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors are required to amend the valuation in consequence of such information, they will issue an amended Report and Generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and Generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon residential property. \*

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's agent or relative to the Property, they will be obliged to indicate this in the adjacent box. Yes

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

\* Which shall be in accordance with the current RICS Appraisal and Valuation Standards (The Red Book) and RICS Rules of Conduct.

## 1.2 The Report

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to the 1st of December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Report is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Report may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective Purchasers and the Purchaser and their respective professional advisors without the prior written consent of the Surveyors.

## 1.3 Liability

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and is prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would be (or, as the case might be, would have been) disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisors of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

Graham + Sibbald's total liability to the Client (and any third party relying upon this report) under this Agreement (including liability in contract, tort (including negligence), breach of statutory duty, or otherwise) shall be limited to the lower of the following : a) 25% of the valuation or b) £250,000.

## 1.4 Generic Mortgage Valuation Report

The Surveyors undertake to the Seller that they will prepare a Generic Mortgage Valuation Report, which will be issued along with the Report. It is the responsibility of the Seller to ensure that the Generic Mortgage Valuation Report is provided to every potential Purchaser.

## 1.5 Transcript Mortgage Valuation for Lending Purposes

The Surveyors undertake that on being asked to do so by a prospective Purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. \*\* The Transcript Mortgage Valuation Report for Lending Purposes will be prepared from information contained in the Report and the Generic Mortgage Valuation Report.

\*\* Which shall be in accordance with the current RICS Appraisal and Valuation Standards (The Red Book) and RICS Rules of Conduct.

### 1.6 Intellectual Property

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

### 1.7 Payment

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports, including replacement home reports.

### 1.8 Cancellation

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the Property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the Property, the Surveyor concludes that the Property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the following paragraph of this section.

In the case of cancellation by the Seller, for whatsoever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

If our account details change, we will notify these to you by letter or face to face and never by email.

### 1.9 Precedence

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

### 1.10 Definitions

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a Surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is the estimated amount for which the Property should exchange, on the date of valuation, between a willing seller and a willing buyer in an arms length transaction after proper marketing where the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in Part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property;
- the "Surveyors" are Graham + Slbbald LLP, a limited liability partnership incorporated in Scotland (Registered Number SO307130) and having its registered office address at Seabraes House, 18 Greenmarket, Dundee, DD1 4QB, of which the Surveyor is an employee, director or member (unless the Surveyor is not an employee, director or member, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report; and

Inner Persie . Bridge of Cally PH10 7LQ Perth PER-2024\03\0095 Inspection Date:- 01/04/2024 First Inspection Date (if applicable):-

- the "Energy Report" is the advice given by the accredited energy company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.
- "Data Protection Legislation" means the UK Data Protection Legislation and any other European Union legislation relating to personal data and all other legislation and regulatory requirements in force from time to time which apply to a party relating to the use of personal data (including, without limitation, the privacy of electronic communications).
- "UK Data Protection Legislation" means all applicable data protection and privacy legislation in force from time to time in the UK including the UK GDPR; the Data Protection Act 2018; the Privacy and Electronic Communications Directive 2002/58/EC (as updated by Directive 2009/136/EC) and the Privacy and Electronic Communications Regulations 2003 (SI 2003/2426) as amended.
- "UK GDPR" has the meaning given to it in section 3(10) (as supplemented by section 205(4)) of the Data Protection Act 2018.

#### DESCRIPTION OF THE REPORT

### 2.1 The Service

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by statute and this is in the format of the accredited energy company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### 2.2 The Inspection

The inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the Property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the Property.

The inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the Report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Report of Property that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a register of asbestos and effective management plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

#### 2.3 The Report

The Report will be prepared by the Surveyor who carried out the Property inspection and will describe various aspects of the Property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the Property will be concise and will be restricted to matters that could have a materialaffect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the Property is free of any other minor defects.

Throughout the Report the following repair categories will be used to give an overall opinion of the state of repair and condition of the Property:

### 2.3.1 Category 3:

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the Property or cause a safety hazard. Estimates for repairs or replacement are needed now.

### 2.3.2 Category 2:

Repairs or replacement requiring future attention, but estimates are still advised.

## 2.3.3 Category 1:

No immediate action or repair is needed.

## WARNING:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the Property. This is particularly true during slow market conditions when the effect can be considerable. Parts of the Property which cannot be seen or accessed will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

## 2.4 Services

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

### 2.5 Accessibility

A section is included to help identify the basic information interested parties need to know to decide whether to view a Property.

## 2.6 Energy Report

A section is included that makes provision for an Energy Report, relative to the Property. The Surveyor will collect physical data from the Property and provide such data in a format required by an accredited Eeergy company. The Surveyor cannot of course accept liability for any advice given by the energy company.

## 2.7 Valuation & Conveyancer Issues

The last section of the Report contains matters considered relevant to the conveyancer (solicitor). It also contains the Surveyor's opinion both of the market value of the Property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation within a willing buyer and willing seller in an arms-length transaction after proper marketing wherein the parties have each acted knowledgably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of uninspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions.
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees). Sellers or prospective Purchasers may consider it prudent to instruct a re-inspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

It is assumed that any relevant Local Authority consents, warrants and completion certificates have been obtained where construction or alteration works have been undertaken.

This agreement and any dispute or claim arising out of or in connection with its subject matter shall be governed by and construed in accordance with the laws of Scotland, and the Scottish Courts will have exclusive jurisdiction to hear such claims.

### DATA PROTECTION

Graham + Sibbald and the Client each undertake that:

- (a) they shall comply with all applicable requirements of the Data Protection Legislation, including without limitation any obligations relating to the rights of a data subject and the reporting of personal data breaches (all as defined in the UK GDPR); and
- (b) not do or omit to do anything which puts any other party to the Agreement in breach of the Data Protection Legislation.

Without prejudice to the generality of this clause, you shall ensure that you have all necessary appropriate consents and notices in place to enable lawful transfer of the personal data to Graham + Sibbald for the duration and purposes of this Agreement. You shall have liability for and shall indemnify Graham + Sibbald for any loss, liability, costs (including legal costs), damages, or expenses resulting from any breach by you of the Data Protection Legislation. For further information regarding how Graham + Sibbald processes personal data in relation to this Agreement, please see Graham + Sibbald's privacy notice on our website.

	Mortgage Va	aluation Repo	ort for Home	Report		HAM BALD
Source: G+S Home Report		Seller Name	Mr + Mrs Smith	l	Reference PER-	2024\03\0095
1) Property Details	House Name In Number / Ext Street . Area Town Bri	ner Persie	Postcode	PH10 7LQ		
2) Description of property	1			1		
Property Type Bu Year Built 1975 - extended	ungalow		Detached Construction? N general commer	0	nber of subject prop No. of floors in l No. of flats in l	block
3) Accommodation - give n Receptions 2 Bedr Other Utility, Annexe	rooms 4	Kitchens 1 Double	Bathrooms Outbuildings	2 Total Inside	Garden Gener	of floors 1 rous garden addock.
<b>4) Tenure</b> Absolute Owne Any known or reported pro			d, years unexpire round rent or ser	1		
Owner occupied x 1	Tenanted	Vacant				
If part tenanted, please give details						
5) Subsidence, Settlement Does the property show s subject to landslip, heave	signs of, or is the			No		
If yes, please clarify						
6) Condition of Property						
	essential interna	l repairs require	d?		Yes	No x
Are	essential externa	l repairs require	d?		Yes	No x
Should the repairs be e	effected before the	e advance is mad	e?		Yes	No
	a mortgage retent				Yes	No x
If the answer to any of the	e above questions	s is res, piease pr	ovide further det	a i i î		
			Page 1 of 3			Regulated by RICS Chartered Surveyors A Quality Assured Firm

7) Services Mains water Mains drainage Electricity x Gas Central heati	ng Oil
<b>8) Insurance Reinstatement Value</b> Total area of all floors measured internally (m²)	212
Cost of rebuilding inc. demolition, site clearance, professional fees, local authority requireme and main building (inc all other structures within the site boundaries unless specifically exclu	+ 5 / 5 (1010
9) Market Valuation for Mortgage Purposes (Assuming Vacant Possession) Comment on mortgageability	
In our opinion the property forms suitable security for loan purposes subject to specific lender	r`s criteria which may vary.
Valuation in present condition:	£450,000
Valuation on completion of any works required under Question 6:	
<b>10) General Comments</b> Please advise of any special features of the property and/or the location, which affects the pro	operty.
In addition to the main accommodation listed above there is a self-contained two bedroom an room/kitchen and shower room.	
There is a communal private (hillside) water supply serving the property. It is assumed that that the at least 10 years and the water is fit for human consumption. It would be prudent to carry out the service of the	
Drainage is we understand to a private sewage treatment system. This was not checked or tes that the appropriate registration documents are held.	ted and it should be ensured
The valuation is made on the assumption that any alterations that may have been carried out relevant legislation and have full certification where appropriate. While not necessarily an estat the time of our inspection include the addition of a self-contained two bedroom annexe with alterations.	xhaustive list, alterations noted
The subjects are approached in the first instance via a communal private road, over which it is held, and thereafter via a private road which serves the subjects property alone. Burden with the road is presumed to be apportioned on a fair and equitable basis. The purchasing solicite the legal arrangements are adequate.	respect to upkeep and repair of
The property was found to be in a condition consistent with age and type, with no significant i which would materially affect our valuation reported. There are a number of items of wear an use which will require attention during a programme of normal routine maintenance.	
Damp stained plaster was noted to the ceiling within the front and rear, south most bedrooms	. Further investigation required.
Elevated moisture readings were recorded to some lower walls, skirting boards and timber flo particular with the south most, front and rear bedrooms. Black mould was noted in some area No access was obtained to the sub-floor chamber and no comment is made as to the underlyir areas. In light of these findings it is recommended that the property is inspected by a reputab contractor.	s consistent with condensation. ng conditions within concealed
IMPORTANT - THIS IS A CONFIDENTIAL REPORT PREPARED FOR MORTGAGE PURPOSES.	
Certificate: I have personally inspected the property described herein and confirm adequate public.	rofessional indemnity cover is
Company / Firm Name	
Signature A. Hindhen Office Addr1	
Office Addr1	3 Charlotte Street
Valuer name and Andrew Hitchen, BSc MRICS Area	
gualification For and on behalf of Graham + Sibbald LLP	Perth
Date of inspection 01/04/2024 Postcode	PH1 5LW
Date of report 01/04/2024	01738 445733
Page 2 of 3	

## **MORTGAGE VALUATION - CONDITIONS OF ENGAGEMENT**



In these Terms and Conditions of Engagement, the following expressions shall have the following meanings:

"Agreement" means these Terms and Conditions of Engagement, the Instructions and the confirmation letter issued by Graham + Sibbald.

"Client"/"you"/"your" means the person, firm, company, organisation or other entity engaging Graham + Sibbald to provide the inspection services.

"Data Protection Legislation" means the UK Data Protection Legislation and any other European Union legislation relating to personal data and all other legislation and regulatory requirements in force from time to time which apply to a party relating to the use of personal data (including, without limitation, the privacy of electronic communications).

"Graham + Sibbald"/"we"/"us"/"our" means Graham + Sibbald LLP, a limited liability partnership incorporated in Scotland (Registered Number SO307130) and having its registered office address at Seabraes House, 18 Greenmarket, Dundee, DD1 4QB.

"Instructions" means the written or verbal instructions by the Client to Graham + Sibbald, which appoint Graham + Sibbald to provide the inspection services.

"Property" means the property identified and described in the Instructions.

"UK Data Protection Legislation" means all applicable data protection and privacy legislation in force from time to time in the UK including the UK GDPR; the Data Protection Act 2018; the Privacy and Electronic Communications Directive 2002/58/EC (as updated by Directive 2009/136/EC) and the Privacy and Electronic Communications Regulations 2003 (SI 2003/2426) as amended.

"UK GDPR" has the meaning given to it in section 3(10) (as supplemented by section 205(4)) of the Data Protection Act 2018.

A valuation for mortgage is a limited inspection and report produced for building societies, banks and other lenders to enable them to make a lending decision. IT IS NOT A SURVEY. Unless otherwise stated the date of valuation will be the date of inspection.

This report is used to guide the lender on the market value of the Property for mortgage purposes and is carried out for this purpose alone. Although the inspection will be carried out by a valuer who will usually be a qualified surveyor it is not a detailed inspection of the Property, and only major visible defects will be noted. Subject to reasonable accessibility, the roof space is inspected only to the extent visible from the access hatch without entering it. The surveyor will not inspect under floor areas, communal roof space or other parts not readily accessible. The exterior and roof of the Property will be inspected from ground level only from within the boundaries of the site and adjacent/communal public areas. The area of the Property will be taken into account, and the rooms individually inspected, but floor coverings and furniture will not advise as to whether these comply with regulations in respect of these services.

The surveyor may recommend that a part of the mortgage be retained by the lenders until such time as particular repair works are carried out. Similarly, the report may suggest that the borrower should undertake to carry out certain repairs or commission more extensive investigation where hidden defects are suspected since these may have a material effect on the value of the Property. If a retention is recommended then the figure should not be regarded as an estimate of repair costs. Its purpose is to protect the interests of the lending institution. It is recommended that detailed estimates be obtained before proceeding with the purchase. Attention is drawn to the fact that if a subsequent transcription of this report is prepared on a lenders form, then in order to comply with the lenders specific requirements, the wording or phraseology may differ. Many people rely on the mortgage valuation certificate in the mistaken belief that it is a detailed survey. The report is often made available to house buyers by lenders, but this does not mean that it should be relied upon as a report on the condition of the building.

The definition of 'market value' is the estimated amount for which a Property should exchange on the date of valuation, between a willing buyer and a willing seller in an arms-length transaction after proper marketing wherein the parties had acted knowledgeably, prudently and without compulsion. For the purpose of this market value the surveyor has assumed that vacant possession will be provided. Unless otherwise stated the surveyor has valued the interest on a comparable basis.

The inspection that has been undertaken should not be regarded as a survey. The surveyor did not inspect parts of the Property which were covered, unexposed or inaccessible and are therefore unable to report that any such part of the Property is free from defect. Defects which are not considered materially to affect the value of the Property or other matters which would be attended to during maintenance, may not have been mentioned. If defects have been mentioned in this report, they should be regarded as indicative and not exhaustive. For the purposes of this valuation the surveyor assumes that all uninspected areas are free from defect which would have a material effect on value.

In accordance with our normal practice, we must state that this report is for the use only of the party to whom it is addressed or their named client and no responsibility is accepted to any third party for the whole or any part of its content.

In addition, we would bring to your attention that neither the whole nor any part of this report, nor any reference thereto, may be included in any document, circular or statement without prior written approval of the form and context in which it will appear.

The surveyor shall, unless otherwise expressly agreed, rely upon information provided by the Client and/or the Client's legal or other professional advisers relating to tenure, leases and all other relevant matters.

For the purposes of this valuation the surveyor has assumed that all ground burdens are nominal or have been redeemed and that there are no unusual outgoings or onerous restrictions contained within the titles of which we have no knowledge. The surveyor has further assumed that the subjects are unaffected by any adverse planning proposals.

Unless otherwise stated, it is assumed that all the required valid planning permissions and statutory approvals for the building and for their use, including any recent or significant extensions or alterations, have been obtained and complied with. It has been further assumed that no deleterious or hazardous materials or techniques have been used in the construction of the subject and that there is no contamination in or from the ground or from the immediate surrounds.

The surveyor will not carry out an asbestos inspection and will not be acting as an asbestos inspector in completing a valuation inspection of Property that may fall within the Control of Asbestos Regulations 2012. No enquiry of the duty holder, as defined in the Control of Asbestos Regulations 2012, of the existence of an asbestos register, or of any plan for the management of asbestos will be made. Your legal adviser/conveyancer should confirm the duty holder under these regulations, the availability of an asbestos register and the existence and management of any asbestos containing materials. For the purposes of this valuation, the surveyor has assumed that there is a duty holder, as defined in the Control of Asbestos Regulations 2006, and that a register of asbestos and effective management plan is in place which does not require any immediate expenditure or pose a significant risk to health or breach the HSE Regulations.

The surveyor confirms that this mortgage valuation is prepared in accordance with the RICS Valuation - Global Standards 2017 and incorporating IVSC International Valuation Standards and, unless other stated, we are External Valuares a defined therein. Further information may also be obtained from the Royal Institution of Chartered Surveyors in Scotland, 10 Charlotte Square, Edinburgh EH2 40R.

As part of this remit, the surveyor may, where he/she feels qualified and experienced to do so, provide general comment on standard appropriate supplementary documentation, presented to us by the Client's lender and conveyancer. In the event of a significant amount of documentation being provided to us, an additional fee may be incurred. Any additional fees will be agreed with you in advance.

We confirm that Graham + Sibbald operates formal procedures to deal with complaints from clients in accordance with By-law 19, Regulation 2.7 of the Royal Institution of Chartered Surveyors Rules of Conduct and Disciplinary Procedures. A copy of this procedure is available on request.

Graham + Sibbald's total liability to the Client (and any third party relying upon this report) under this Agreement (including liability in contract, tort (including negligence), breach of statutory duty, or otherwise) shall be limited to the lower of the following: a) 25% of the valuation or b) £250,000.

This agreement and any dispute or claim arising out of or in connection with its subject matter shall be governed by and construed in accordance with the laws of Scotland, and the Scottish courts will have exclusive jurisdiction to hear such claims.

Graham + Sibbald and the Client each undertake that: (a) they shall comply with all applicable requirements of the Data Protection Legislation, including without limitation any obligations relating to the rights of a data subject and the reporting of personal data breaches (all as defined in the UK GDPR); and (b) not do or omit to do anything which puts any other party to the Agreement in breach of the Data Protection Legislation.

Without prejudice to the generality of this clause, you shall ensure that you have all necessary appropriate consents and notices in place to enable lawful transfer of the personal data to Graham + Sibbald for the duration and purposes of this Agreement. You shall have liability for and shall indemnify Graham + Sibbald for any loss, liability, costs (including legal costs), damages, or expenses resulting from any breach by you of the Data Protection Legislation. For further information regarding how Graham + Sibbald's privacy notice available via our website.

# **Energy Performance Certificate (EPC)**

# Scotland

Dwellings

## **INNER PERSIE, BRIDGE OF CALLY, BLAIRGOWRIE, PH10 7LQ**

Dwelling type:	Detached bungalow
Date of assessment:	04 April 2024
Date of certificate:	04 April 2024
Total floor area:	212 m <sup>2</sup>
Primary Energy Indicator:	195 kWh/m²/year

**Reference number:** Type of assessment: Approved Organisation: Main heating and fuel:


0849-1016-6204-3104-9204 RdSAP, existing dwelling Elmhurst Boiler and radiators, oil

## You can use this document to:


- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

Estimated energy costs for your home for 3 years*	£7,854	See your recommendations
Over 3 years you could save*	£1,572	report for more information

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

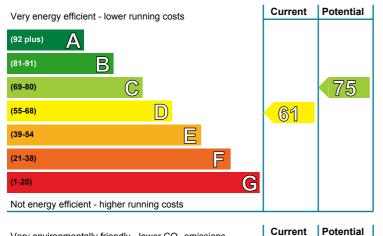

Very environmentally friendly - lower CO<sub>2</sub> emissions

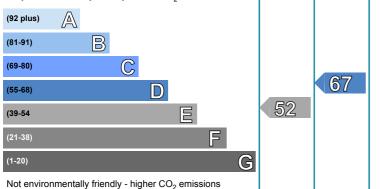

## **Energy Efficiency Rating**

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is band D (61). The average rating for EPCs in Scotland is band D (61).

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

## Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide  $(CO_2)$ emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (52)**. The average rating for EPCs in Scotland is band D (59).

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

## Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Floor insulation (suspended floor)	£800 - £1,200	£948.00
2 Condensing boiler	£2,200 - £3,000	£435.00
3 Solar water heating	£4,000 - £6,000	£189.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE **DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE** 

# INNER PERSIE, BRIDGE OF CALLY, BLAIRGOWRIE, PH10 7LQ 04 April 2024 RRN: 0849-1016-6204-3104-9204

## Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Timber frame, as built, partial insulation (assumed)	★★★☆☆	★★★☆☆
	Timber frame, as built, insulated (assumed)	****	$\star\star\star\star\star$
Roof	Pitched, 270 mm loft insulation	★★★★☆	★★★★☆
Floor	Suspended, no insulation (assumed) Suspended, insulated (assumed)		
Windows	Fully double glazed	<b>★★★</b> ☆☆	<b>★★★</b> ☆☆
Main heating	Boiler and radiators, oil	<b>★★★</b> ☆☆	★★★☆☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	None	—	_
Hot water	From main system	★★★☆☆	★★★☆☆
Lighting	Low energy lighting in all fixed outlets	****	****

## The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.

## The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 52 kg  $CO_2/m^2/yr$ .

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 11 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 3.2 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home			
	Current energy costs	Potential energy costs	Potential future savings
Heating	£6,576 over 3 years	£5,295 over 3 years	
Hot water	£690 over 3 years	£399 over 3 years	You could
Lighting	£588 over 3 years	£588 over 3 years	save £1,572
Totals	£7,854	£6,282	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

## **Recommendations for improvement**

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

De		Indicative cost	Typical saving		Rating after improvement	
Re	commended measures	indicative cost	per year	Energy	Environment	
1	Floor insulation (suspended floor)	£800 - £1,200	£316	D 66	D 58	
2	Replace boiler with new condensing boiler	£2,200 - £3,000	£145	D 68	D 61	
3	Solar water heating	£4,000 - £6,000	£63	C 69	D 63	
4	Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£488	C 75	D 67	

# Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

saving

## About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

## 1 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

## 2 Condensing boiler

A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat this property. This improvement is most appropriate when the existing central heating boiler needs repair or replacement, however there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

## 3 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

## 4 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

## Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

## Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	27,320	N/A	N/A	N/A
Water heating (kWh per year)	2,807			

## About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Assessor membership number: Company name/trading name:	Mr. Andrew Hitchen EES/012860 Graham & Sibbald
Address:	3 Charlotte Street Perth PH1 5LW
Phone number:	01738 445733
Email address:	perth@g-s.co.uk No related party
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

## Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

# Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.





Property address	Inner Persie
	Bridge of Cally
	Blairgowrie
	Perthshire
	PH10 7LQ

Seller(s)	Paul Smith
	Linda Smith

Completion date of property questionnaire	28/03/2024
---	------------

# GRAHAM - SIBBALD

# Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

# Information to be given to prospective buyer(s)

1.	Length of ownership
	How long have you owned the property? 8 years
2.	Council tax
	Which Council Tax band is your property in? F
3.	Parking
	What are the arrangements for parking at your property?         (Please tick all that apply)         • Garage       Yes         • Allocated parking space         • Driveway       Yes         • Shared parking         • On street         • Resident permit         • Metered parking         • Other (please specify):
4.	Conservation area
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	No
6.	Alterations/additions/extensions	
а.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	Yes
	If you have answered yes, please describe below the changes which you have made:	
	Self contained 2 bedroom annex	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	Yes
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property?	Yes
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	Yes
	(ii) Did this work involve any changes to the window or door openings?	Νο
	(iii) Please describe the changes made to the windows dates when the work was completed):	doors, or patio doors (with approximate
	Swapped wooden frames for upvc frames. Rough	-
	Please give any guarantees which you received for this	work to your solicitor or estate agent.

7.	Central heating	
а.	Is there a central heating system in your property?	
	(Note: a partial central heating system is one which does not heat all the main rooms of the property —	Yes
	the main living room, the bedroom(s), the hall and the bathroom).	
	If you have answered yes or partial – what kind of central heating is there?	
	(Examples: gas-fired, solid fuel, electric storage heating, gas warm air).	
	Oil fired central heating	
	If you have answered yes, please answer the three questions below:	
	(i) When was your central heating system or partial cent	ral heating system installed?
	Don't know	
	(ii) Do you have a maintenance contract for the central heating system?	No
	If you have answered yes, please give details of the company with which you have a maintenance contract:	
	(iii) When was your maintenance agreement last renewed year).	I? (Please provide the month and
	Serviced yearly	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Νο
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	Νο
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	
b.	Are you aware of the existence of asbestos in your property?	Νο
	If you have answered yes, please give details:	

## 10.

## Services

**a.** Please tick which services are connected to your property and give details of the supplier:

Services	Connected	Supplier
Gas or liquid petroleum gas		
Water mains or private water supply	Yes	Private water supply
Electricity	Yes	Octopus
Mains drainage		
Telephone	Yes	ВТ
Cable TV or satellite	Yes	Sky
Broadband	Yes	4 G mobile
		Broadband

b.	Is there a septic tank system at your property? <u>If you have answered yes</u> , please answer the two questions below:	Νο
	(iv) Do you have appropriate consents for the discharge from your septic tank?	Yes
	(v) Do you have a maintenance contract for your septic tank?	
	If you have answered yes, please give details of the company with which you have a maintenance contract:	
	An aerobic digester installed and maintained by R Smith	

11.	Responsibilities for shared or common areas	
а.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?	Yes
	If you have answered yes, please give details:	
	Driveway and water supply	
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?	Not Applicable
	If you have answered yes, please give details:	
с.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	No
d.	Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details:	Yes
	Shared access driveway, also access to hill where water supply is.	
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?	No
	If you have answered yes, please give details:	
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)	No
	If you have answered yes, please give details:	
12.	Charges associated with your property	
а.	Is there a factor or property manager for your property?	No
	If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	

b.	Is there a common buildings insurance policy?	No
	If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	
C.	Please give details of any other charges you have to of common areas or repair works, for example to a or stair fund. None	
13.	Specialist works	
а.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	No
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	No
	If you have answered yes, please give details:	
с.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work? If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself <u>please write</u> <u>below who has these documents</u> and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	

14.	Guarantees		
a.	Are there any guarantees or warranties for	or any of the following:	
(i)	Electrical work		No
(ii)	Roofing		No
(iii)	Central heating		No
(iv)	National House Building Council (NHBC)		No
(v)	Damp course		No
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)		No
b.	If you have answered 'yes' or 'with title d to which the guarantee(s) relate(s):	eeds', please give details	of the work or installations
с.	Are there any outstanding claims under a listed above?	ny of the guarantees	No
	If you have answered yes, please give de	tails:	
15.	Boundaries		
	So far as you are aware, has any bounda moved in the last 10 years?	ry of your property been	No
	If you have answered yes, please give de	tails:	

16.	Notices that affect your property	
	In the past three years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	No
b.	that affects your property in some other way?	No
с.	that requires you to do any maintenance, repairs or improvements to your property?	No
	If you have answered yes to any of a-c above, please g estate agent, including any notices which arrive at any purchaser of your property.	

## Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

і ассерт 🗹
------------

Name: Linda Smith

Date: 28/03/2024