

Longmorn House,
Longmorn,
Elgin IV30 8SH

Home Report



DM HALL

Longmorn House,
Longmorn,
Elgin IV30 8SH

Single Survey



DM HALL

Survey Report on:

Property Address	Longmorn House, Longmorn, Elgin IV30 8SH
Reference	1528682
Customer Name	Margaret Bloor
Date of Inspection	14th April 2026
Surveyor's name, qualifications and office	Michael McDonald BLE, MRICS DM Hall LLP Chartered Surveyors 27 High Street Elgin IV30 1EE Tel: 01343 548501 email: elginresidential@dmhall.co.uk
Prepared By	DM Hall LLP

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party, they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report, it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and

- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional adviser or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily.

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which an asset or liability should exchange on the valuation date, between a willing buyer and a willing seller in an arm's length transaction, after proper marketing and where the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;

- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2- DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the

property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 Category 3:** Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 Category 2:** Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 Category 1:** No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, they may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the reinstatement cost, as defined below.

“Market value” The estimated amount for which an asset or liability should exchange on the valuation date, between a willing buyer and a willing seller in an arm’s length transaction,

after proper marketing and where the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Reinstatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form* unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The property comprises a substantial, detached, traditional single storey house.
Accommodation	Ground Floor: Entrance Vestibule, Reception Hall/Billiard Room with Morning Room Off, Drawing Room, Dining Room, Two Living Rooms, Conservatory, Main Bedroom with Ensuite Shower Room, Four Further Bedrooms, Bathroom, Shower Room, Rear Hall, Kitchen with Utility Area, WC, Sun Porch, Rear Porch.
Gross Internal Floor Area (m2)	430
Neighbourhood and Location	The property is located within secluded grounds in a rural area, a short distance from the town of Elgin. The property has an open outlook over surrounding countryside. There are some other residential properties within the vicinity. There is a distillery complex nearby. A wide range of facilities can be obtained within the town of Elgin nearby.
Age	Built 1891.
Weather	It was sunny and dry, following generally mixed weather conditions.
Chimney Stacks	Visually inspected with the aid of binoculars where appropriate. Chimney stacks are of stone construction with pointed finishes. Where visible, flashings at the bases of the chimneys are formed in lead. The chimney stacks

incorporate intricate stone designs. Many of the chimney stacks were not fully visible and could not be fully inspected.

Roofing including Roof Space

Sloping roofs were visually inspected with the aid of binoculars where appropriate.

Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.

Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.

If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.

The roof is large and complex. It is mainly made up of various pitched sections finished in natural slate. Ridges are generally formed in tile. Valleys are formed in various metals such as copper and lead. There are lead verges along roof edges. There is a flat roof section which would appear to be finished in lead. There is an area of polycarbonate sheeting over the veranda. There are pitched and clay tile sections over bay windows. There is a flat roof over the kitchen which would appear to be finished in fibreglass.

Access to two roof spaces was available via ceiling hatches in the main bathroom and main bedroom ensuite shower room. The hatch in the main bathroom gives access to a small section of roof space above two of the bedrooms. The hatch in the ensuite shower room gives access to the roof space above the main bedroom and adjoining morning room. The majority of the timbers/roof spaces were not accessible. My inspection of these roof spaces was restricted due to the limited size of the space and insulation material.

Inspection of these hatches revealed the roof is of timber construction with traditional timber sarking boards. There is no under slate felt. Insulation materials have been laid between the ceiling joists in these spaces.

Rainwater Fittings

Visually inspected with the aid of binoculars where appropriate.

The gutters are partly of an ogee design with box downpipes and partly of a half round design with round

	<p>downpipes. The rainwater fittings are formed in cast iron and PVC materials.</p>
Main Walls	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Foundations and concealed parts were not exposed or inspected.</p> <p>The walls are mainly of solid stone construction, externally pointed. There is a section formed in brick with rendered finish. There is provision for subfloor ventilation via air vents at ground level.</p>
Windows, External Doors and Joinery	<p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p> <p>Windows are mainly of a single glazed, sash and casement type. There are some double glazed, UPVC replacement windows. Some of the windows have stained, leaded glazed features.</p> <p>The front and rear doors are of a traditional timber frame and panel type. The rear kitchen door is of a double glazed, UPVC type with similar side panels. There are single glazed doors leading to the conservatory and sun porch. There are a number of skylights with inner secondary glazing panes. These are formed in an obscured glass meaning the skylights were not visible.</p> <p>Soffits, fascias and rafter tails are formed in timber.</p>
External Decorations	<p>Visually inspected.</p> <p>The external timbers are painted.</p> <p>The rainwater fittings are partly painted.</p>
Conservatories and Porches	<p>Visually inspected.</p> <p>There is a conservatory with double glazed, UPVC window units under a polycarbonate sheet roof.</p> <p>There is a sunroom of timber construction with polycarbonate sheet roof.</p>
Communal Areas	<p>There are no communal areas.</p>

<p>Garages and Permanent Outbuildings</p>	<p>Visually inspected.</p> <p>There is a large attached tandem double garage of stone and slate construction. This has an electric roller door and pedestrian door linking to the house.</p> <p>There is an additional detached timber double garage with felt tile roof. This also has electric doors.</p>
<p>Outside Areas and Boundaries</p>	<p>Visually inspected.</p> <p>There are extensive areas of garden to the front, sides and rear of the main house. There is a large stone retaining wall along the front and also around a sunken garden at the side. Boundaries are generally defined by post and wire fencing. There is an open boundary at present between the subjects and adjoining property which is currently under the same ownership. The owner has given me a visual indication of where the boundaries will lie.</p> <p>Garden areas include a long drive and substantial parking area. There are areas of lawn and formal planting as well as a wilder wooded area at the rear.</p>
<p>Ceilings</p>	<p>Visually inspected from floor level.</p> <p>Ceilings are formed in lath and plaster. There is a vaulted ceiling over the reception hall/billiard room. There is extensive ornate plaster detailing and cornicing in various rooms.</p> <p>Some ceilings have been replaced in plasterboard.</p>
<p>Internal Walls</p>	<p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p> <p>The internal walls are a mixture of lath and plaster construction and masonry construction plastered on the hard. Some walls have been replaced in plasterboard.</p>
<p>Floors including Sub-floors</p>	<p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p> <p>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</p>

	<p>Physical access to the sub-floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</p> <p>The floors are of suspended timber construction overlaid with timber tongue and groove boarding. At the time of my inspection, all floors were covered. No access was available to any subfloor areas.</p> <p>There are some areas of solid concrete flooring.</p>
<p>Internal Joinery and Kitchen Fittings</p>	<p>Built-in cupboards were looked into, but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p> <p>Internal doors are generally of a traditional timber frame and panel type. There are a number of timber frame, panel and glazed doors. There is traditional timber panelling around a number of doors and windows. There are traditional timber deep skirting boards and architraves. There is a fitted metal gun cupboard in the hall cupboard. The kitchen contains a range of fitted floor and wall mounted units with a stainless steel sink unit and drainer.</p>
<p>Chimney Breasts and Fireplaces</p>	<p>Visually inspected.</p> <p>No testing of the flues or fittings was carried out.</p> <p>There are open fires in the morning room, dining room and one of the sitting rooms. There is an oil stove fitted in the kitchen. There are woodburning stoves fitted in the reception hall/billiard room and two of the living rooms.</p> <p>There are a number of other blocked off fireplaces.</p>
<p>Internal Decorations</p>	<p>Visually inspected.</p> <p>Internal walls are papered and painted. Ceilings are also partly papered but mostly painted. Joinery finishes are painted or varnished.</p>
<p>Cellars</p>	<p>There are no cellars.</p>
<p>Electricity</p>	<p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual</p>

	<p>inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Mains supply installed.</p> <p>The electricity consumer units are located in the hall cupboard.</p> <p>The electricity meter is located the garage.</p> <p>A range of 13amp sockets are distributed throughout the property.</p>
Gas	<p>There is no gas supply.</p>
Water, Plumbing and Bathroom Fittings	<p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Water is connected to the mains supply.</p> <p>The bathroom is fitted with a WC, wash hand basin, bidet and bath with mixer shower.</p> <p>The shower room is fitted with a WC, wash hand basin and shower cubicle with mixer shower.</p> <p>The en-suite shower room is fitted with a WC, wash hand basin and shower cubicle with mixer shower.</p> <p>There is a toilet fitted with a WC and wash hand basin.</p> <p>There are wash hand basins fitted in three bedrooms.</p>
Heating and Hot Water	<p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>There is an oil fired, Worcester Greenstar Utility Regular central heating boiler located within the sun porch.</p> <p>This supplies a system of traditional and modern panel radiators throughout the property.</p>

	<p>The Owner has advised that the oil stove in the kitchen supplies domestic hot water. There is a hot water tank located in the utility room cupboard with an immersion heater as an additional means of providing hot water.</p> <p>The central heating system is controlled by a programmer and thermostatic valves on radiators.</p> <p>There are a number of open fires and wood stoves as an additional means of providing heat. There is an oil stove in the kitchen.</p>
Drainage	<p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p> <p>The owner has advised that drainage is to a private septic tank located within the garden. This has not been inspected or tested.</p>
Fire, Smoke and Burglar Alarms	<p>Visually inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>There are some smoke detectors fitted within the property.</p> <p>Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.</p>
Any Additional Limits to Inspection	<p>Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.</p> <p>We have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation we have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.</p> <p>The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If</p>

the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns, you should engage a qualified asbestos surveyor.

Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.

Concealed areas beneath and around sanitary fittings were not visible. Due to the presence of water, there is an inherent risk of leakage and resultant damage to concealed areas which may only become apparent when the building fabric is opened up for examination.

The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.

Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is outwith the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.

The property was occupied, fully furnished and all floors were covered. Consequently, the inspection of the flooring and other elements was restricted.

In accordance with Health and Safety Guidelines, we have not disturbed insulation or furniture and floor coverings have not been moved. Where present, personal effects within cupboards and wardrobes have not been moved, therefore limiting the inspection.

We were unable to inspect the sub floor area as no suitable access hatch was available.

Access was obtained to two loft hatches. The majority of roof timbers were not accessible. My inspection of the accessible roof spaces was limited due to the size of the spaces and insulation material.

The roof is large and complex. Much of the roof, chimneys and skylights were not visible from ground level and these have not been inspected.

Sectional Diagram showing elements of a typical house



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural Movement	
Repair Category	1
Notes	The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

Dampness, Rot and Infestation	
Repair Category	3
Notes	There is evidence of dampness to lower walls in places and around a rear door. Any concealed timbers in contact with dampness are at a risk of rot related defects. A timber/damp contractor should carry an inspection with a view to providing estimates and carrying out the necessary remedial repairs under cover of a long term guarantee. Best practice recommends an inspection of the whole property is carried out.

Chimney Stacks	
Repair Category	2
Notes	Chimney stacks in a building of this age generally require higher levels of maintenance and upkeep. Ongoing repair should be expected and a competent roofer can advise further.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Roofing including Roof Space	
Repair Category	3
Notes	<p>The roof exhibits a number of defects including some cracked, broken and missing slates, missing roof mortar work and deterioration to ridge tiles. There is vegetation growth on the roof and in valleys which should be removed. There are broken tiles on the bay windows. As previously stated the roof is large and complex. Many parts of the roof structure were not visible from ground level. These areas could not be inspected. There are also a number of skylights which were not visible, internally or externally. A roofing contractor can be asked to inspect the entire roof with a view to implementing all necessary repairs to make the roof covering fully wind and watertight. Inspection at close quarters may reveal more extensive deterioration, especially where materials are original. Regular and ongoing maintenance should be anticipated with large older complex roofs of this nature.</p> <p>There is some damp staining to timbers within the roof space. These generally appeared historic. There is also a small area of deterioration to sarking which also appears historic. There is evidence of wood boring insect infestation. Please see comments under Dampness, Rot & Infestation.</p> <p>There are wasp bykes within the roof space.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Rainwater Fittings	
Repair Category	2
Notes	<p>There is vegetation growth in rainwater fittings which should be removed. There is general corrosion to older rainwater fittings. These require regular and ongoing maintenance. A missing end stop was noted from a section of guttering. A roofing contractor can carry out repairs to guttering.</p> <p>The effectiveness of the rainwater fittings cannot be fully commented on as it was not raining. There are however some stains to external walls which may be as a result of leaking rainwater fittings.</p>

Main Walls	
Repair Category	2
Notes	<p>There are some areas of loose and missing mortar. Ongoing maintenance will be required to older stone walls of this type.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Windows, External Doors and Joinery

Repair Category	2
Notes	<p>Doors and random windows are opened but not all and inspections can be restricted by window blinds, curtains, ornaments etc. Handles, locks and opening mechanisms can deteriorate through usage and repair or replacement can be anticipated on an ad hoc basis. No assurances can be provided that all window fittings are functional.</p> <p>A number of the original window units are painted shut. There are a number of cracked panes. There is additional age related wear and tear. There is some missing mortar around windows. Some patchwork repairs have been carried out. It should be appreciated sash and casement windows typically require regular and ongoing repair and maintenance, particularly to the frames and opening mechanisms. Repair and maintenance of leaded, glazed windows can prove costly.</p> <p>Seals on some of the double glazed window units have failed resulting in condensation buildup between the panes.</p> <p>There is some deterioration to external joinery finishes.</p> <p>A joiner can inspect and undertake the necessary repairs.</p>

External Decorations

Repair Category	2
Notes	<p>There is corrosion and peeling paintwork to rainwater fittings. Repainting will be required once repairs have been undertaken.</p> <p>Outside paintwork has deteriorated and redecoration is now required. Regular re-painting of external joinery finishes will prolong their lifespan.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Conservatories and Porches	
Repair Category	2
Notes	<p>Seals on the double glazed window units of the conservatory have failed resulting in condensation buildup between the panes of glass. There is a previous damp stain and the flashing appears to have been patched.</p> <p>The timber sun porch is of basic construction with some signs of ingress. Regular and ongoing maintenance should be anticipated.</p>

Communal Areas	
Repair Category	N/A
Notes	Not applicable.

Garages and Permanent Outbuildings	
Repair Category	2
Notes	There is some evidence of dampness within the main garage.

Outside Areas and Boundaries	
Repair Category	2
Notes	There are extensive areas of missing pointing to the stone retaining walls. General and ongoing maintenance will be required to older stone retaining walls.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Ceilings	
Repair Category	2
Notes	<p>There is typical plaster cracking in various areas. When plaster starts to pull loose from the lath the cracking often becomes widespread. Small cracks in this type of ceiling can develop into a larger repair.</p> <p>Repair of ornate plaster ceilings can prove expensive, should the need arise.</p> <p>There are some damp stains to ceilings in a living room and in the vestibule. These areas were dry when tested indicating leakage is historic or intermittent.</p> <p>There is damp staining to the vaulted ceiling in the reception hall/ billiard room which is dry. This may be as a result of a previous leakage around the cupola. The owner has advised that this has been replaced three years ago. This could also be as a result of condensation staining.</p>

Internal Walls	
Repair Category	1
Notes	There is hairline cracking to plaster in places.

Floors including Sub-floors	
Repair Category	2
Notes	<p>It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.</p> <p>There are sections of loose and uneven flooring in places.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Internal Joinery and Kitchen Fittings

Repair Category	2
Notes	Kitchen fittings may be nearing the end of their useful lifespan. Glazed inserts to interior doors and fixed panels may not be of appropriate toughened glass or meet the recognised safety standards.

Chimney Breasts and Fireplaces

Repair Category	2
Notes	<p>It is assumed that the solid fuel stoves have been installed in accordance with good practice by an appropriately accredited contractor, and complied with building regulations current at the time. A copy of relevant verifying documentation in this regard should be obtained.</p> <p>All flues should ideally be swept and tested on an annual basis. The owner has advised that this has been done on a regular basis.</p> <p>If disused fireplaces are to be reopened further advice should be sought to ensure that the chimney flue is intact and suitable for use.</p> <p>Where fireplaces have been removed there is limited provision for ventilation. Unventilated chimney breasts can result in condensation.</p>

Internal Decorations

Repair Category	2
Notes	Decorative finishes are dated and an incoming occupier can redecorate to their own personal taste.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Cellars	
Repair Category	N/A
Notes	Not applicable.

Electricity	
Repair Category	2
Notes	<p>It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.</p> <p>The electrical installation is dated including older cabling, sockets, switches and consumer units. An NICEIC/SELECT registered electrician can be engaged to examine the system and implement all necessary upgrading works.</p>

Gas	
Repair Category	N/A
Notes	Not applicable.

Water, Plumbing and Bathroom Fittings	
Repair Category	2
Notes	Seals around the bath areas are worn. Failure to seals can result in dampness and decay within hidden areas of the property. There is some damage to the bath panel.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Heating and Hot Water	
Repair Category	1
Notes	<p>It is assumed that the heating and hot water systems have been installed in accordance with all relevant regulations and thereafter maintained on a regular basis. A copy of any relevant documentation in this regard should be obtained.</p> <p>It is common practice for purchasers to have systems checked by an engineer immediately upon taking ownership, as stated in most offers to purchase used by conveyancers.</p> <p>Boilers and central heating systems should be tested and serviced by a Oftec oil registered engineer on an annual basis to ensure their safe and efficient operation.</p>

Drainage	
Repair Category	1
Notes	No significant surface defects evident.

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural Movement	1
Dampness, Rot and Infestation	3
Chimney Stacks	2
Roofing including Roof Space	3
Rainwater Fittings	2
Main Walls	2
Windows, External Doors and Joinery	2
External Decorations	2
Conservatories and Porches	2
Communal Areas	N/A
Garages and Permanent Outbuildings	2
Outside Areas and Boundaries	2
Ceilings	2
Internal Walls	1
Floors including Sub-floors	2
Internal Joinery and Kitchen Fittings	2
Chimney Breasts and Fireplaces	2
Internal Decorations	2
Cellars	N/A
Electricity	2
Gas	N/A
Water, Plumbing and Bathroom Fittings	2
Heating and Hot Water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair.

The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin operated machines.

1. Which floor(s) is the living accommodation on?	Ground floor.
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a Solicitor or Licensed Conveyancer

The owner gave me a visual indication of where the boundaries lie at the time of inspection. The conveyancer can confirm the extent of ground ownership.

The access road appears to be shared. The completing conveyancer should verify rights of access and liability in respect of future maintenance.

Drainage is to a septic tank. The Owner has advised that the tank is registered with SEPA. The position regarding age, location, condition and maintenance history should be clarified.

Alterations noted include the additions of the conservatory, the installation of ensuite shower rooms and the kitchen potentially being an extension.

Within the limitations of our inspection these works appear to be historic, having taken place in excess of twenty years ago.

Estimated Reinstatement Cost (£) for Insurance Purposes

Three Million, One Hundred Thousand Pounds:
£3,100,000

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

Due to the type and age of construction, the property is outside of standard BCIS calculations, and the insurance figure should be treated as a guide only.


Valuation (£) and Market Comments

Seven Hundred Thousand Pounds:
£700,000

The stated market valuation reflects prevailing market conditions and recent sales evidence.

Report author:	Michael McDonald BLE, MRICS
Company name:	DM Hall LLP
Address:	DM Hall LLP Chartered Surveyors 27 High Street Elgin IV30 1EE Tel: 01343 548501

Single Survey

	email: elginresidential@dmhall.co.uk
Signed:	
Date of report:	14th April 2026

Longmorn House, Longmorn,
Elgin IV30 8SH

Mortgage Valuation Report



DM HALL

Mortgage Valuation Report

Property Address: Longmorn House, Longmorn, Elgin IV30 8SH

Date of Inspection: 14th April 2026

Reference: 1528682

Location & Description

1. Location:

The property is located within secluded grounds in a rural area, a short distance from the town of Elgin. The property has an open outlook over surrounding countryside. There are some other residential properties within the vicinity. There is a distillery complex nearby. A wide range of facilities can be obtained within the town of Elgin nearby.

2. Description:

The property comprises a substantial, detached, traditional single storey house.

3. Age:

Built 1891.

4. Main Construction:

Walls: Solid stone.

Roof: Pitched and slated.

5. Accommodation:

Ground Floor: Entrance Vestibule, Reception Hall/Billiard Room with Morning Room Off, Drawing Room, Dining Room, Two Living Rooms, Conservatory, Main Bedroom with Ensuite Shower Room, Four Further Bedrooms, Bathroom, Shower Room, Rear Hall, Kitchen with Utility Area, WC, Sun Porch, Rear Porch.

6. Floor Area - excluding garages and outbuildings:

Gross internal floor area: 430

Gross external floor area: 525

7. Garage and Outbuildings:

Double attached garage. Additional double garage.

Mortgage Valuation Report

Services / Roads

8 Main Service:

Water:	Yes:	<input checked="" type="checkbox"/>	No:	<input type="checkbox"/>
Electricity:	Yes:	<input checked="" type="checkbox"/>	No:	<input type="checkbox"/>
Gas:	Yes:	<input type="checkbox"/>	No:	<input checked="" type="checkbox"/>
Drainage:	Yes:	<input type="checkbox"/>	No:	<input checked="" type="checkbox"/>

For comments on non-mains services, see section 15.

8a. Heating:

Oil fired boiler.

9. Roads - assumed adopted (If no see section 15. General Remarks)

Yes: No:

General Condition

10. Essential Repairs - comments confined to defects which would materially affect the property and/or value/suitably for mortgage purposes.

There is evidence of some dampness. There is some wood boring insect infestation. It is recommended that the entire property be inspected by a timber and damp specialist. All remedial works recommended should be carried out using guaranteed methods

Retention: Yes: No:

Retention amount:

11. Subsidence, Settlement and Landslip:

The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

12. General Condition:

Works of repair and maintenance are required and a degree of modernisation would be beneficial.

Legal & Other Matters

13. Alterations: Has the property been extended/converted/alterd? (If yes, see section 15)

Yes: No:

Mortgage Valuation Report

14. Tenure - assumed ownership with marketable title (If no, see section 15)

Yes:

No:

15. General Remarks:

The owner gave me a visual indication of where the boundaries lie at the time of inspection. The conveyancer can confirm the extent of ground ownership.

The access road appears to be shared. The completing conveyancer should verify rights of access and liability in respect of future maintenance.

Drainage is to a septic tank. The Owner has advised that the tank is registered with SEPA. The position regarding age, location, condition and maintenance history should be clarified.

Alterations noted include the additions of the conservatory, the installation of ensuite shower rooms and the kitchen potentially being an extension.

Within the limitations of our inspection these works appear to be historic, having taken place in excess of twenty years ago.

16. Comments on Mortgageability:

The property is considered suitable for mortgage purposes subject, as always, to the policy of the individual lender.

Valuation & Insurance

17.1 Valuation in present condition (words and figures):

Seven Hundred Thousand Pounds: £700,000

17.2 Valuation upon completion of any works required under section 9 (words and figures):

17.3 Insurance reinstatement: Approximate current reinstatement cost including site clearance and professional fees, excluding VAT except on fees. (words and figures):

Three Million, One Hundred Thousand Pounds: £3,100,000

18. Declaration:

Signed:



Valuer's name and Qualifications: Michael McDonald BLE, MRICS 1172200

Date: 30th April 2026

Mortgage Valuation Report

Office Address: DM Hall LLP Chartered Surveyors
27 High Street
Elgin
IV30 1EE

Tel: 01343 548501

email: elginresidential@dmhall.co.uk

DM Hall LLP, a Limited Liability Partnership registered in Scotland with Registration number SO301144

A full list of members can be obtained from the head office, 17 Corstorphine Road, Edinburgh EH12 6DD. 0131 477 6000

DM Hall has a network of offices across Scotland and offices in Carlisle, Kendal and Cornwall


Regulated by RICS



RICS[®]

Registered
valuer

Property Questionnaire

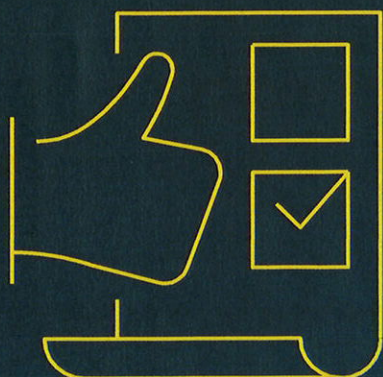

DM HALL

Property Questionnaire

Property Address:

LONGMORN HOUSE
LONGMORN
BY ELGIN IV30 8SH

Seller(s):

MARGARET SUSAN BLOOR

Completion Date of Property Questionnaire

18 April 2026

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the Date of Entry for the sale of your house, tell your solicitor or estate agent immediately.

Property Questionnaire

1. Length of ownership

How long have you owned the property?

25 YEARS

2. Council Tax

Which Council Tax band is your property in?

A B C D E F G H

3. Parking

What are the arrangements for parking at your property? (Please indicate all that apply)

Garage Allocated parking space Driveway
Shared parking Resident permit
Metered parking Other (please specify): > 10 CARS

4. Conservation Area

Is your property in a designated Conservation Area (i.e. an area of special architectural or historic interest, the character or appearance of which it is desirable to preserve or enhance)?

NO

5. Listed Buildings

Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?

NO

6. Alterations/additions/extensions

A. (i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet or bedroom)?

If you have answered yes, please describe the changes which you have made:

CONVERSION OF CUPBOARD TO SHOWER ROOM

(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?

NO

If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.

If you do not have the documents yourself, please note below who has these documents and your solicitor

or estate agent can

[Empty box for document holder information]

arrange to obtain them.

B. Have you had replacement windows, doors, patio doors or double glazing installed in your property?

YES

If you have answered yes, please answer the three questions below:

- (i) Were the replacements the same shape and type as the ones you replaced?
(ii) Did this work involve any changes to the window or door openings?
(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):

i SAME SHAPE, ROTTEN WOOD REPLACED BY MODERN MATERIALS AND DOUBLE GLAZING
iii WORK ONGOING SINCE MOVING IN

Please give any guarantees which you received for this work to your solicitor or estate agent.

7. Central Heating

A. Is there a central heating system in your property?

(Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).

YES

If you have answered yes/partial - what kind of central heating is there?

(Examples: gas-fired, solid fuel, electric storage heating, gas warm air)

OIL FIRED

If you have answered yes, please answer the 3 questions below:

b. When was your central heating system or partial central heating system installed?

REPLACED BOILER

2022

c. Do you have a maintenance contract for the central heating system?

NO

If you have answered yes, please give details of the company with which you have a maintenance agreement:

SIMPSON PLUMBERS SEE ANNUALLY

d. When was your maintenance agreement last renewed? (Please provide the month and year).

/

8. Energy Performance Certificate

Does your property have an Energy Performance Certificate which is less than 10 years old?

NO

9. Issues that may have affected your property

- a. Has there been any storm, flood, fire or other structural damage to your property while you have owned it?

If you have answered yes, is the damage the subject of any outstanding insurance claim?

NO

- b. Are you aware of the existence of asbestos in your property?

If you have answered yes, please give details:

NO

10. Services

- a. Please tick which services are connected to your property and give details of the supplier:

Services	Connected	Supplier
Gas/liquid petroleum gas		
Water mains/private water supply	✓	
Electricity	✓	ECTOPUS
Mains Drainage	✓	
Telephone	✓	LW
Cable TV/Satellite		
Broadband	✓	LW

- b. Is there a septic tank system at your property?

YES

If you have answered yes, please answer the two questions below:

- c. Do you have appropriate consents for the discharge from your septic tank?

DON'T KNOW

- d. Do you have a maintenance contract for your septic tank?

NO

If you have answered yes, please give details of the company with which you have a maintenance Contract:

11. Responsibilities for a Shared or Common Areas

- a. Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?

If you have answered yes, please give details:

PRIVATE ROAD

- b. Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?

If you have answered yes, please give details:

NO

- c. Has there been any major repair or replacement of any part of the roof during the time you have owned the property?

YES FLAT KITCHEN ROOF REPLACED

- d. Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?

If you have answered yes, please give details:

DONT KNOW

- e. As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?

If you have answered yes, please give details:

DONT KNOW

Property Questionnaire

- f. As far as you are aware, is there a Public Right of Way across any part of your property?
(A Public Right of Way is a way over which the public has a right to pass, whether or not the land is privately-owned.)

NO

If you have answered yes, please give details:

12. Charges associated with your property

- a. Is there a factor or property manager for your property?

NO

If you have answered yes, please provide the name and address and give details of any deposit held and approximate charges:

- b. Is there a common buildings insurance policy?

NO

If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?

- c. Please give details of any other charges you must pay on a regular basis for the upkeep of common areas or repair works, e.g. to a Residents' Association, or maintenance or stair fund.

13. Specialist Works

- a. As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? DONT KNOW*

If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.

RENTA KILL, WOODWORM
PROTECTION? SOME DOCUMENTATION
25 YEARS AGO

- b. As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? DONT KNOW*

If you have answered yes, please give details.

NOT IN OUR TIME

- c. If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?

If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.

Guarantees are held by:

14. Guarantees

a. Are there any guarantees or warranties for any of the following:						
(i)	Electrical work	<u>No</u>	Yes	Don't Know	With title deeds	Lost
(ii)	Roofing	<u>No</u>	Yes	Don't Know	With title deeds	Lost
(iii)	Central heating	<u>No</u>	Yes	Don't know	With title deeds	Lost
(iv)	NHBC	<u>No</u>	Yes	Don't know	With title deeds	Lost
(v)	Damp course	<u>No</u>	Yes	Don't know	With title deeds	Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	<u>No</u>	Yes	Don't know	With title deeds	Lost

B. If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):

C. **Are there any outstanding claims under any of the guarantees listed above?** If you have answered yes, please give details: NO

15. Boundaries

So far as you are aware, has any boundary of your property been moved in the last 10 years?

NO

If you have answered yes, please give details:

16. Notices that affect your property

In the past 3 years have you ever received a notice:

- a. Advising that the owner of a neighbouring property has made a planning application? *
- b. That affects your property in some other way?
- c. That requires you to do any maintenance, repairs or improvements to your property?

If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchase of your property.

* I AM SPLITTING THE CURRENT SITE
TO BUILD ACCESSIBLE, SUSTAINABLE
HOME FOR MYSELF
PLANNING & BUILDING NOTICES
AVAILABLE

Energy Performance Certificate



DM HALL

Energy Performance Certificate (EPC)

Scotland

Dwellings

LONGMORN HOUSE, LONGMORN, ELGIN, IV30 8SH

Dwelling type: Detached bungalow
Date of assessment: 14 April 2026
Date of certificate: 06 May 2026
Total floor area: 413 m²
Primary Energy Indicator: 282 kWh/m²/year


Reference number: 0160-2864-7140-2496-6931
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, oil

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£21,594	See your recommendations report for more information
Over 3 years you could save*	£6,957	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

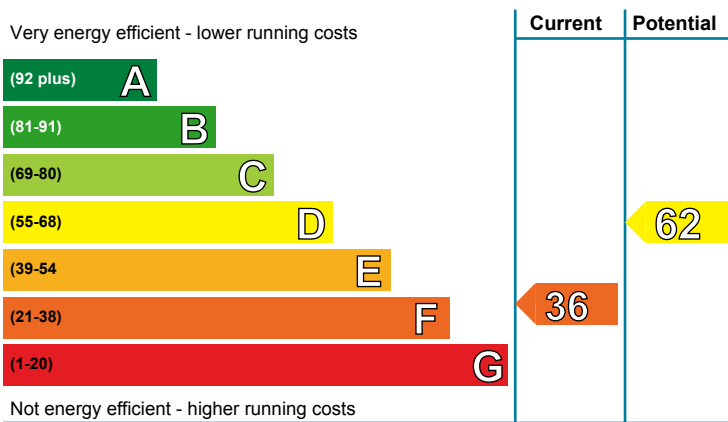


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band F (36)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

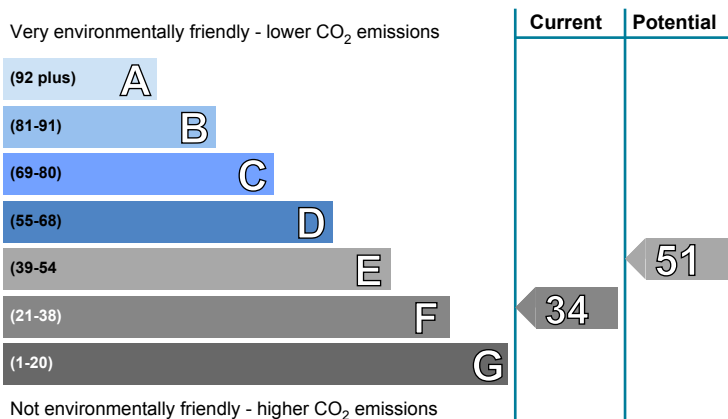

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band F (34)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Flat roof or sloping ceiling insulation	£900 - £1,200	£1599.00
2 Internal wall insulation	£7,500 - £11,000	£2487.00
3 Floor insulation (suspended floor)	£5,000 - £10,000	£930.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction. See the addendum section on the last page of this report for further information relating to items in the table.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Pitched, 200 mm loft insulation	★★★★☆	★★★★☆
	Pitched, no insulation	★☆☆☆☆	★☆☆☆☆
	Pitched, insulated (assumed)	★★★★☆	★★★★☆
Floor	Suspended, no insulation (assumed)	—	—
Windows	Partial multiple glazing	★☆☆☆☆	★☆☆☆☆
Main heating	Boiler and radiators, oil	★★★★☆	★★★★☆
Main heating controls	Programmer, TRVs and bypass	★★★★☆	★★★★☆
Secondary heating	Room heaters, dual fuel (mineral and wood)	—	—
Hot water	From main system, no cylinder thermostat	★★☆☆☆	★★☆☆☆
Lighting	Below average lighting efficiency	★★☆☆☆	★★☆☆☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 65 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 27 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 9 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£19,920 over 3 years	£12,960 over 3 years	
Hot water	£1,035 over 3 years	£1,038 over 3 years	
Lighting	£639 over 3 years	£639 over 3 years	
Totals	£21,594	£14,637	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Flat roof or sloping ceiling insulation	£900 - £1,200	£533	E 40	F 37
2 Internal wall insulation	£7,500 - £11,000	£829	E 47	E 43
3 Floor insulation (suspended floor)	£5,000 - £10,000	£310	E 50	E 45
4 Draughtproofing	£150 - £250	£253	E 52	E 47
5 Replace single glazed windows with low-E double glazed windows	£4,500 - £6,000	£394	D 56	E 50
6 Solar photovoltaic panels, 2.5 kWp	£8,000 - £10,000	£266	D 57	E 50
7 Wind turbine	£5,000 - £20,000	£693	D 62	E 51

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Flat roof or sloping ceiling insulation

Insulating a flat roof or sloping ceiling will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation can be placed on top of the roof under the waterproof membrane and should particularly be considered when the waterproofing needs to be replaced. Further information about roof insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

2 Internal wall insulation

Internal wall insulation involves adding a layer of insulation to the inside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

3 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

4 Draughtproofing

Fitting draughtproofing, strips of insulation around windows and doors, will improve the comfort in the home. A contractor can be employed but draughtproofing can be installed by a competent DIY enthusiast.

5 Double glazed windows

Double glazing is the term given to a system where two panes of glass are made up into a sealed unit. Replacing existing single-glazed windows with double-glazed windows will improve comfort in the home by reducing draughts and cold spots near windows. Double-glazed windows may also reduce noise, improve security and combat problems with condensation. Building regulations apply to this work and planning permission may also be required, so it is best to check with your local authority on what standards need to be met. A building warrant is not required if the windows comply with the current requirements.

6 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

7 Wind turbine

A wind turbine provides electricity from wind energy. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Wind turbines are not suitable for all properties. The system's effectiveness depends on local wind speeds and the presence of nearby obstructions, and a site survey should be undertaken by an accredited installer. Planning permission might be required and building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for a wind turbine, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	75,056.02	N/A	N/A	N/A
Water heating (kWh per year)	4,073.97			

Addendum

When considering the PV installation consider installing PV battery and a PV diverter for water heating

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Michael McDonald
Assessor membership number:	EES/009379
Company name/trading name:	D M Hall Chartered Surveyors LLP
Address:	27 High Street Toryglen Elgin IV30 1EE
Phone number:	01343 548501
Email address:	michael.mcdonald@dmhall.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



DM Hall LLP, a Limited Liability Partnership registered
in Scotland with Registration number SO301144

A full list of members can be obtained from the head office,
17 Corstorphine Road, Edinburgh EH12 6DD. 0131 477 6000

DM Hall has a network of offices across Scotland,
Cumbria and the Southwest of England.

DM HALL