



Home Report

shepherd.co.uk



SHEPHERD

CHARTERED SURVEYORS

All Angles Covered

Residential | Commercial | Property & Construction



Contents

1. Scottish Single Survey
 2. Energy Performance Certificate
 3. Property Questionnaire
-



Scottish Single Survey



Single Survey

survey report on:

Property address	25 Midton Road Ayr KA7 2SF
Customer	Ms F Williams
Customer address	25 Midton Road Ayr KA7 2SF
Prepared by	Shepherd Chartered Surveyors
Date of inspection	17/06/2025



www.shepherd.co.uk

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by marking the adjacent box.

☐

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report².

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;

- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments

being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use

Terms and Conditions

communal grounds, parking areas, and other facilities;

- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form* unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	Detached house of two plus attic storeys.
Accommodation	<p>Ground Floor: Entrance Vestibule, Hallway, Sitting Room, Dining Room, Kitchen, Cloakroom with separate wc, Conservatory, Utility Room and Rear Hall leading to Garden Room.</p> <p>First Floor: Master Bedroom with en suite Bathroom, Three further Bedrooms and Bathroom with wc.</p> <p>Attic Floor: Bedroom with en suite Bathroom, Double Bedroom and Box Room.</p>
Gross internal floor area (m²)	332 sq m or thereby.
Neighbourhood and location	The subjects are located within an established residential area of mixed style private housing, a short distance from Ayr Town Centre and convenient for all main amenities. The property is within a Conservation Area.
Age	We understand the original house dates from 1735 however, records indicate the majority of the structure dates from 1807.
Weather	Dry and overcast.
Chimney stacks	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>There are three main chimneys over side and rear gable elevations. Chimneys are of masonry construction and roughcast.</p>

Roofing including roof space	<p>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</p> <p>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.</p> <p>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</p> <p>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p> <p>The roof is formed with adjoining pitches overlaid in natural slate. There are mixed lead and cement render skew flashings at stone wallhead copings and the roof incorporates dormer projections to the front and rear with mixed slate and felt roofs. The single storey rear projection has a flat roof overlaid in mineral felt.</p> <p>We were able to partially inspect roof void areas at the apex, front eaves and rear eaves/projection. The roof is of timber framed construction overlaid with timber sarking boards. Full access was not available.</p>
Rainwater fittings	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>There is a lead lined wallhead gutter over the front elevation and elsewhere gutters and downpipes are formed in cast iron.</p>
Main walls	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Foundations and concealed parts were not exposed or inspected.</p> <p>Walls are of substantial solid stone/rubble construction, pointed to the frontage and mainly roughcast rendered elsewhere. Additional features include an ornate central pediment at the front upper elevation and a doric column entrance porch around the main front door.</p> <p>The garden room extension appears to be of timber framed construction and timber weatherboard panel clad externally. Part of the garden room is formed against a masonry boundary wall.</p>

Single Survey

Windows, external doors and joinery	<p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p> <p>The majority of windows are of original timber sash and casement 12 pane style, single glazed. External doors are mainly timber panel units and partly glazed. Windows and doors at the single storey extension are of single glazed metal framework.</p>
External decorations	<p>Visually inspected.</p> <p>Painted joinery and cast iron plumbing.</p>
Conservatories / porches	<p>Visually inspected.</p> <p>There is a side conservatory which has brick lower walls, finished in roughcast. Upper elevations and the roof are of timber framed construction and double glazed panelled.</p>
Communal areas	<p>None.</p>
Garages and permanent outbuildings	<p>Visually inspected.</p> <p>There is an adjoining garage to the side which is double sized and constructed of mixed brick and stonework with a pitched and slate clad roof and flat felt front roof. There are two up and over timber vehicular doors and a side pedestrian access door. The garage has cast iron gutters. Side and rear elevations were not inspectable.</p>
Outside areas and boundaries	<p>Visually inspected.</p> <p>The property has a good sized plot with gardens to front, side and rear finished in lawn and paving with a gravel surfaced crescent driveway.</p> <p>Boundaries are mainly of substantial masonry and there are a number of mature trees. There is additional thick vegetation to some areas of garden and adjacent to some areas of external elevation at the house.</p>
Ceilings	<p>Visually inspected from floor level.</p> <p>Lath plaster lined with cornicing and coving in places.</p>

Single Survey

Internal walls	<p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p> <p>Mixed solid hard plaster and lath plaster linings.</p>
Floors including sub floors	<p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p> <p>The ground floor is partly solid and also appears to be partly suspended timber. Upper floors are of suspended timber and there are fitted flooring coverings throughout.</p>
Internal joinery and kitchen fittings	<p>Built-in cupboards were looked into but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p> <p>Skirting and facings are timber, internal doors are mainly timber panel units and there are timber staircases to the upper floors.</p> <p>Kitchen fittings comprise wall and floor mounted units.</p>
Chimney breasts and fireplaces	<p>Visually inspected.</p> <p>No testing of the flues or fittings was carried out.</p> <p>There is a large open fireplace in the main sitting room. One or two other former fireplaces have been blocked and vented.</p>
Internal decorations	<p>Visually inspected.</p> <p>Wallpaper and paint.</p>
Cellars	<p>None.</p>
Electricity	<p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Electricity is from the mains grid with the meter and consumer unit located in the entrance hall. There is additional switch gear located within the utility room.</p>


Single Survey

Gas	<p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>There does not appear to be a mains gas supply to the house. There is a private oil fuel supply with a storage tank located externally behind the rear elevation.</p>
Water, plumbing, bathroom fittings	<p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Cold water is from the public main and, where seen, plumber fittings were of mixed materials including, copper, PVC and some lead.</p> <p>Sanitary arrangements comprise mainly white fittings of mixed styles in each of the bathrooms.</p>
Heating and hot water	<p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>The property has a system of oil-fired heating with a large boiler being located in the utility room. This provides heating to some rooms via ducted warm air.</p> <p>Hot water may also be provided by the boiler and there is a modern hot water storage tank within the utility room and a more dated tank located in an attic bedroom cupboard.</p>
Drainage	<p>Drainage covers etc. were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p> <p>All foul and surface water drainage appears to be to the main public sewer.</p>

Fire, smoke and burglar alarms	Visually inspected. No tests whatsoever were carried out to the system or appliances. All Scottish homes require a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also needs to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon-fuelled appliance such as a boiler, open fire or wood burner, a carbon monoxide detector is also required. We have not assessed or tested any existing equipment and it is the purchasers responsibility to confirm that the property will comply with these standards following a change of ownership.
---------------------------------------	---

Any additional limits to inspection	<p>For flats / maisonettes</p> <p>Only the subject flat and internal communal areas giving access to the flat were inspected.</p> <p>If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.</p> <p>The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.</p> <p>An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor.</p> <p>The property was fully furnished and had fitted floor coverings, therefore no detailed inspection was possible of the floors and accordingly, no comment can be made on their condition. Internal cupboards were generally filled with storage items. No access was available beneath sanitary or kitchen fittings.</p> <p>Windows and external doors were not all fully opened or tested.</p> <p>No access was available to any sub-floor areas.</p> <p>Only limited access was available to roof void areas where our inspection was further restricted by a thick layer of insulation in places.</p> <p>Some areas of wall at the boundaries and main house were obscured by garden vegetation. Flat roof coverings were not fully inspectable.</p>
--	--

Sectional Diagram showing elements of a typical house

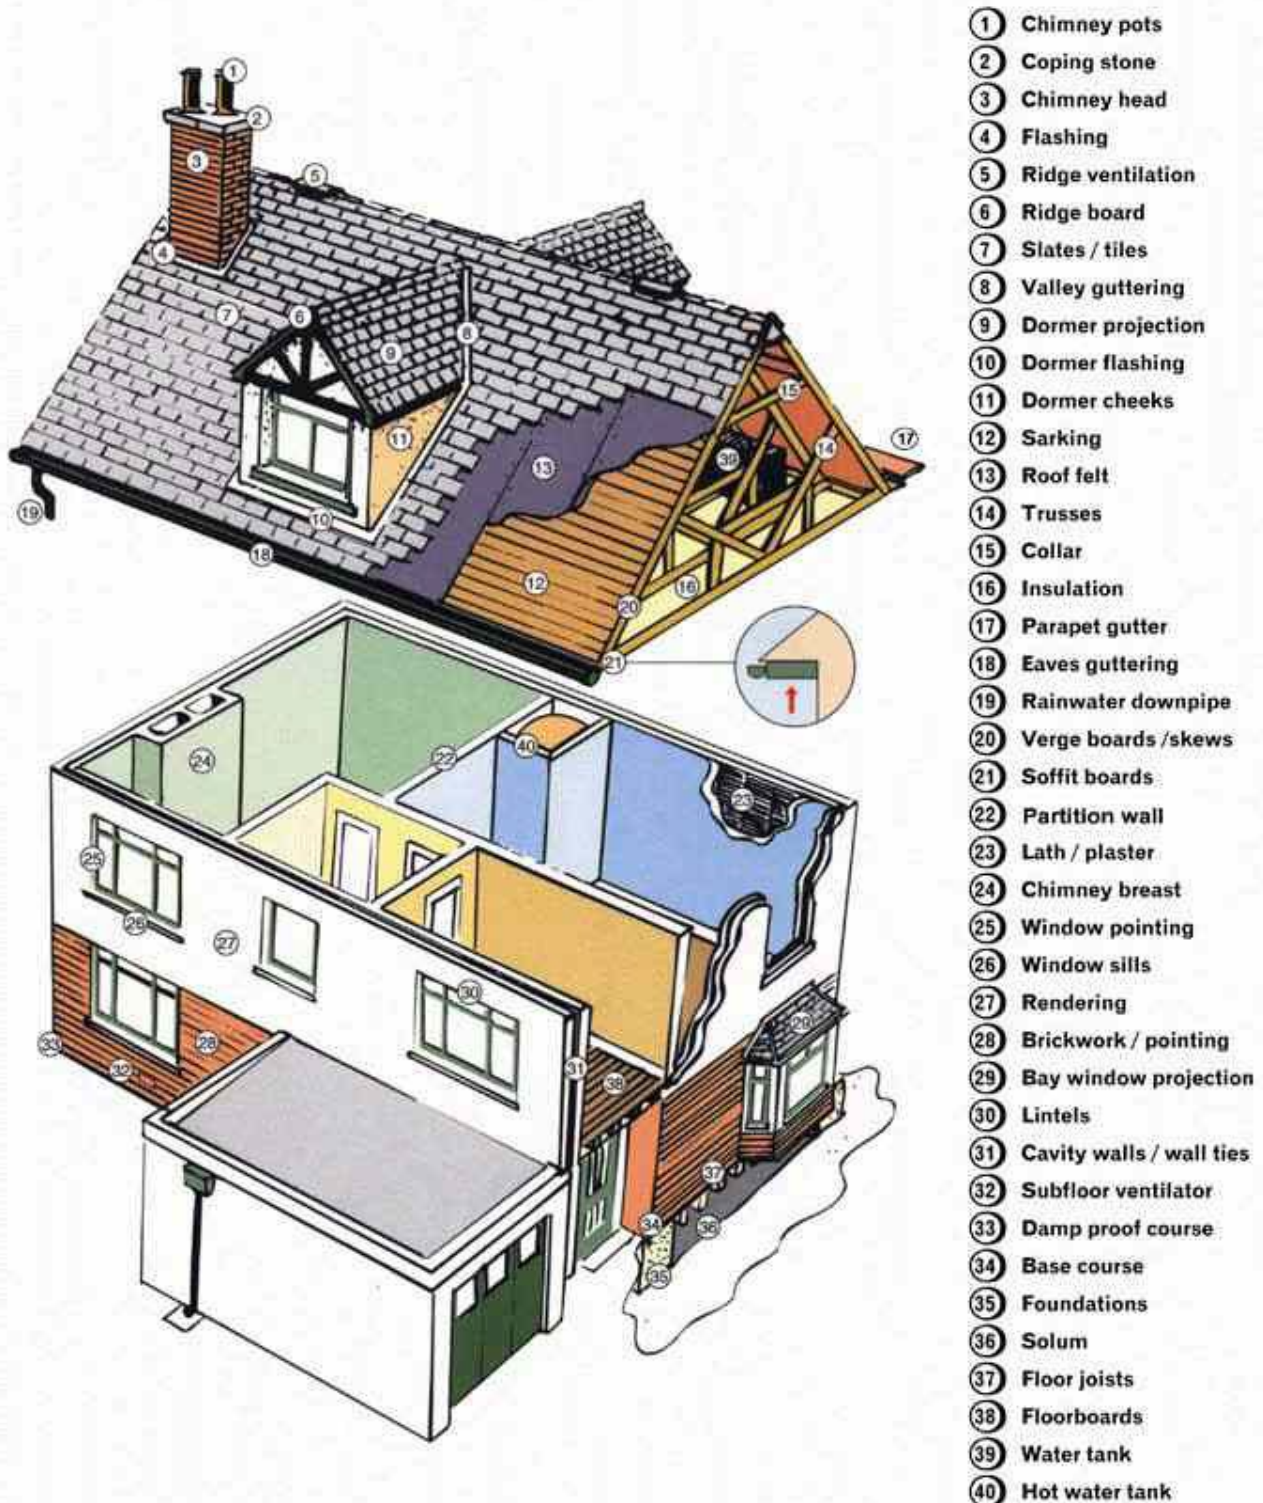


Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.


Single Survey

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

 Structural movement	
Repair category	1
Notes	The building has suffered slight movement in places, noted by uneven building lines and plaster/masonry cracks. This appears to be due to long standing settlement with no evidence of recent or continuing movement.

 Dampness, rot and infestation	
Repair category	3
Notes	<p>A suspected dry rot outbreak was noted at the main stairwell area with timber skirting and door surrounds being affected at both first and attic floor mezzanine levels.</p> <p>Above average damp readings were also found to one or two areas of lower wall lining at ground floor level. Previous water ingress at the left hand gable chimney head has caused staining and damp plaster to the attic bedroom. Stained decor and plaster cracks were visible beneath the wallhead gutter at front upper rooms.</p> <p>Traces of wood bore infestation were noted to some roof and other internal timbers. There may be a shortage of sub floor ventilation to suspended timber ground floors.</p> <p>It is essential that a report from a reputable timber/damp specialist contractor should be obtained prior to purchase to include estimates for all required remedial works. In particular, the extent of the dry rot outbreak should be fully assessed. The remit of the attending timber specialist should include all timbers within the property including the roof void and sub floor areas.</p>

Single Survey



Chimney stacks

Repair category	2
Notes	Previous water ingress was noted to an attic bedroom. Some localised areas of weathered masonry were visible and several areas of chimney were not closely inspectable from ground level.



Roofing including roof space

Repair category	2
Notes	<p>Roof coverings are of an age and style where, at least, a degree of regular ongoing maintenance should be anticipated. On closer examination, roofing contractors may recommend more extensive overhaul or replacement works and estimates are advised.</p> <p>Felt roof coverings were not fully inspectable but may have a limited life span.</p>



Rainwater fittings

Repair category	2
Notes	The wallhead style gutter along the front elevation should be regularly checked for leakage and cleared of debris to prevent damp ingress. Cast iron rainwater goods have suffered corrosion and damage in places and require to be fully overhauled.



Main walls

Repair category	2
Notes	<p>Localised areas of weathered stone and mortar joint were noted at the frontage and, elsewhere there were some localised areas of cracked and weathered roughcast render. Cracking was noted along the line of the flue at the rear most elevation and future repairs will be required.</p> <p>The garden room projection is of generally lightweight construction and will have limited insulation qualities. General upgrading is recommended including a full overhaul of external timbers.</p>



Windows, external doors and joinery

Repair category	2
Notes	Windows have suffered general wear and tear throughout and a full overhaul programme is now required.

Single Survey



External decorations

Repair category	1
Notes	Redecoration required following repairs.



Conservatories/porches

Repair category	2
Notes	Previous water ingress was noted within the conservatory as well as decay and general wear and tear to joinery/glazing. A full overhaul will be required.



Communal areas

Repair category	N/A
Notes	N/A



Garages and permanent outbuildings

Repair category	2
Notes	The garage would benefit from some general overhaul work including routine attention to roof coverings, masonry and joinery. Some stress cracking was noted at the seat of a large steel supporting joist running through the garage and, while there was no indication of serious ongoing movement, this should be monitored. Internally, wood bore infestation was noted to garage roof timbers as well as some damp timbers and older style electrics.



Outside areas and boundaries

Repair category	2
Notes	<p>Some attention is required to masonry at some areas of boundary wall. It was noted that the walls and gate posts are partly listed.</p> <p>There are a number of mature trees on site which will require occasionally professional maintenance.</p>



Ceilings

Repair category	2
Notes	Several areas of plaster damage require repair.

Single Survey



Internal walls

Repair category	2
Notes	Several areas of plaster damage require repair.



Floors including sub-floors

Repair category	2
Notes	Floors may be affected by the suspected dry rot outbreak and we are concerned with an apparent sub floor ventilation at ground floor level. These should be included within the remit of the attending timber specialist.



Internal joinery and kitchen fittings

Repair category	2
Notes	Kitchen and other internal joinery fittings are dated and now due for full upgrading.



Chimney breasts and fireplaces

Repair category	2
Notes	The flue at the main sitting room fireplace was noted to be heavily sooted and should be fully checked and swept prior to use.



Internal decorations

Repair category	2
Notes	Redecoration required throughout.



Cellars

Repair category	N/A
Notes	N/A



Electricity

Repair category	2
Notes	Although some localise modernisation of the electrical installation was evident, the system appears to be largely dated and the property will require to be rewired. Estimates are advised.

Single Survey



Gas

Repair category	2
Notes	There is a private oil fuel supply and there will be a maintenance liability in this respect. The oil storage tank may not be located in accordance with current fuel storage regulations, being close to the subject house and further advice in this respect should be obtained.



Water, plumbing and bathroom fittings

Repair category	2
Notes	Plumbing and sanitary fittings are generally dated and are likely to require full replacement. Estimates are advised.



Heating and hot water

Repair category	3
Notes	<p>The warm air central heating system has not been checked or tested but, in general terms, is of an older style and may require higher than normal future maintenance or replacement to include a modern heating system to all rooms, incorporating hot water provision.</p> <p>There is a hot water storage tank located within an attic bedroom cupboard. This was noted to have an older type of insulation material which we suspect to have an asbestos content. The cupboard should be sealed as a precaution at present and estimates obtained from a licensed asbestos contractor for the testing and safe removal of any asbestos materials.</p>



Drainage

Repair category	1
Notes	All foul and surface water drainage is assumed to be to the main public sewer. The system was not tested.

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	3
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	2
External decorations	1
Conservatories/porches	2
Communal areas	N/A
Garages and permanent outbuildings	2
Outside areas and boundaries	2
Ceilings	2
Internal walls	2
Floors including sub-floors	2
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	2
Internal decorations	2
Cellars	N/A
Electricity	2
Gas	2
Water, plumbing and bathroom fittings	2
Heating and hot water	3
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground, First & Attic			
2. Are there three steps or fewer to a main entrance door of the property?	Yes	<input checked="" type="checkbox"/>	No	<input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes	<input type="checkbox"/>	No	<input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes	<input type="checkbox"/>	No	<input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes	<input checked="" type="checkbox"/>	No	<input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes	<input checked="" type="checkbox"/>	No	<input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes	<input type="checkbox"/>	No	<input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes	<input checked="" type="checkbox"/>	No	<input type="checkbox"/>

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The property is a Category B Listed Building including some areas of boundary and gate peers. The subjects are also located within a Conservation Area.

Previous alterations have been carried out with the formation of a single storey rear extension although this appears to be well in excess of 20 years old and the absence of Local Authority permissions in this respect would not have an adverse affect on our valuation.

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialist's or contractor's advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

Estimated reinstatement cost for insurance purposes

For Reinstatement Cost Assessment purposes, it is recommended that the subjects be insured for a sum of not less than £1,500,000 (One Million, Five Hundred Thousand Pounds).

This figure is the estimate of the cost of rebuilding the premises and bears no direct relationship to current market value.

Valuation and market comments

Having considered matters, taking account of our general observations on site, we are of the opinion that the Market Value of the subjects in their present condition and with the benefit of vacant possession may be fairly stated in the sum of £600,000 (Six Hundred Thousand Pounds).

Signed	<i>Graeme Stewart</i> Electronically signed :- 03/07/2025 15:08
Report author	Graeme Stewart
Company name	J & E Shepherd Chartered Surveyors
Address	22 Miller Road Ayr KA7 2AY

Single Survey

Date of report	17/06/2025
----------------	------------

Mortgage Valuation Report



Property Address

Address 25 Midton Road, Ayr, KA7 2SF
Seller's Name Ms F Williams
Date of Inspection 17/06/2025

Property Details

Property Type ☒ House ☐ Bungalow ☐ Purpose built maisonette ☐ Converted maisonette
☐ Purpose built flat ☐ Converted flat ☐ Tenement flat ☐ Flat over non-residential use
☐ Other (specify in General Remarks)

Property Style ☒ Detached ☐ Semi detached ☐ Mid terrace ☐ End terrace
☐ Back to back ☐ High rise block ☐ Low rise block ☐ Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e. g. local authority, military, police? ☐ Yes ☒ No

Flats/Maisonettes only Floor(s) on which located No. of floors in block Lift provided? ☐ Yes ☐ No
No. of units in block

Approximate Year of Construction

Tenure

☒ Absolute Ownership ☐ Other

Accommodation

Number of Rooms Living room(s) Bedroom(s) Kitchen(s)
 Bathroom(s) WC(s) Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings) m² (Internal) m² (External)
Residential Element (greater than 40%) ☒ Yes ☐ No

Garage / Parking / Outbuildings

☐ Single garage ☒ Double garage ☐ Parking space ☐ No garage / garage space / parking space
Available on site? ☒ Yes ☐ No

Permanent outbuildings:

None.

Mortgage Valuation Report

Construction

Walls ☐ Brick ☒ Stone ☐ Concrete ☐ Timber frame ☐ Other (specify in General Remarks)
Roof ☐ Tile ☒ Slate ☐ Asphalt ☐ Felt ☐ Other (specify in General Remarks)

Special Risks

Has the property suffered structural movement? ☒ Yes ☐ No

If Yes, is this recent or progressive? ☐ Yes ☒ No

Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity? ☐ Yes ☒ No

If Yes to any of the above, provide details in General Remarks.

Service Connections

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks

Drainage ☒ Mains ☐ Private ☐ None Water ☒ Mains ☐ Private ☐ None
Electricity ☒ Mains ☐ Private ☐ None Gas ☐ Mains ☐ Private ☒ None
Central Heating ☒ Yes ☐ Partial ☐ None

Brief description of Central Heating and any non mains services:

Partial oil-fired ducted warm air heating.

Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

☐ Rights of way ☐ Shared drives / access ☐ Garage or other amenities on separate site ☐ Shared service connections
☐ Ill-defined boundaries ☐ Agricultural land included with property ☐ Other (specify in General Remarks)

Location

☒ Residential suburb ☐ Residential within town / city ☐ Mixed residential / commercial ☐ Shared service connections
☐ Commuter village ☐ Remote village ☐ Isolated rural property ☐ Other (specify in General Remarks)

Planning Issues

Has the property been extended / converted / altered? ☐ Yes ☒ No

If Yes provide details in General Remarks.

Roads

☐ Made up road ☐ Unmade road ☐ Partly completed new road ☐ Pedestrian access only ☒ Adopted ☐ Unadopted

Mortgage Valuation Report

General Remarks

The subjects comprise a Listed Building located within an established residential area, a short distance from Ayr Town Centre and convenient for all main amenities. The property is also within a Conservation Area.

At the time of inspection, the property was found to be in need of some general modernisation and upgrading work throughout. In particular, it was noted that all services are now dated and due for upgrading.

A suspected dry rot outbreak was noted as well as other timber/damp defects and a reputable timber specialist should carry out a full and thorough inspection of the property prior to purchase and provide written estimates for all necessary remedial works.

Suspected asbestos materials were also noted at a hot water storage tank and specialist advice is required.

Other Accommodation: Conservatory, Utility Room and Box Room.

Essential Repairs

Estimates in respect of timber/damp specialist works and asbestos removal should be obtained prior to purchase.

Estimated cost of essential repairs

Retention recommended? ☐ Yes ☒ No

Retention amount

Comment on Mortgageability

The property forms suitable security for mortgage purposes subject to the specific lending criteria of any mortgage provider.

Valuation

Market value in present condition £

Market value on completion of essential repairs £

Insurance reinstatement value £

(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)

Is a reinspection necessary? ☐ Yes ☒ No

Mortgage Valuation Report

Declaration

Signed	<i>Graeme Stewart</i> Electronically signed :- 03/07/2025 15:08
Surveyor's name	Graeme Stewart
Professional qualifications	DipSurv, MRICS
Company name	J & E Shepherd Chartered Surveyors
Address	22 Miller Road, Ayr, KA7 2AY
Telephone	01292 267987
Email Address	ayr@shepherd.co.uk
Date of Inspection	17/06/2025



Energy Performance Certificate



Energy Performance Certificate (EPC)

Scotland

Dwellings

25 MIDTON ROAD, AYR, KA7 2SF

Dwelling type: Detached house
Date of assessment: 17 June 2025
Date of certificate: 17 June 2025
Total floor area: 322 m²
Primary Energy Indicator: 419 kWh/m²/year

Reference number: 0180-2963-6060-2495-6651
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Warm air, oil


You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£28,620	See your recommendations report for more information
Over 3 years you could save*	£16,911	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Very energy efficient - lower running costs

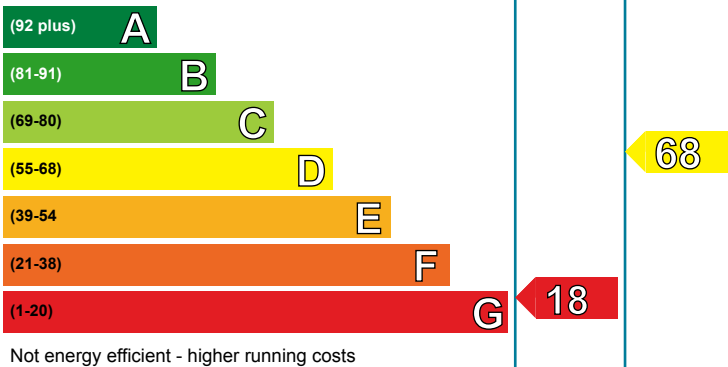


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band G (18)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Very environmentally friendly - lower CO₂ emissions

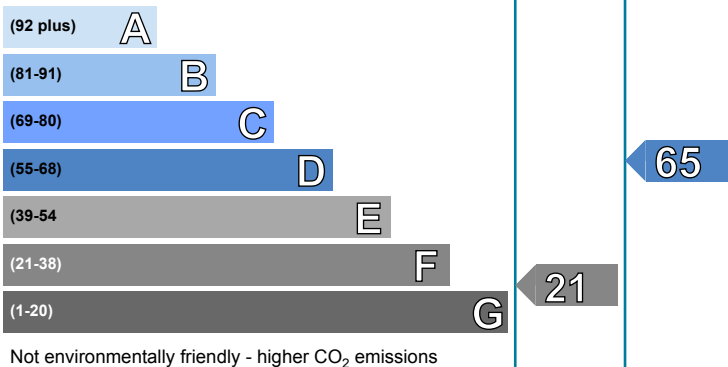

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band F (21)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Flat roof or sloping ceiling insulation	£900 - £1,200	£546.00
2 Internal or external wall insulation	£7,500 - £11,000	£3654.00
3 Floor insulation (suspended floor)	£5,000 - £10,000	£1356.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Timber frame, as built, partial insulation (assumed)	★★★☆☆	★★★☆☆
Roof	Pitched, 100 mm loft insulation	★★★★☆☆	★★★★☆☆
	Flat, limited insulation	★☆☆☆☆	★☆☆☆☆
	Roof room(s), no insulation (assumed)	★☆☆☆☆	★☆☆☆☆
Floor	Suspended, no insulation (assumed)	—	—
	Solid, no insulation (assumed)	—	—
Windows	Single glazed	★☆☆☆☆	★☆☆☆☆
Main heating	Warm air, oil	★★☆☆☆	★★★☆☆
Main heating controls	No time or thermostatic control of room temperature	★☆☆☆☆	★☆☆☆☆
Secondary heating	Room heaters, dual fuel (mineral and wood)	—	—
Hot water	From main system, no cylinder thermostat	★☆☆☆☆	★★☆☆☆
Lighting	Below average lighting efficiency	★★☆☆☆	★★☆☆☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 93 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 30 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 19 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.















Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£26,613 over 3 years	£10,446 over 3 years	
Hot water	£1,350 over 3 years	£594 over 3 years	
Lighting	£657 over 3 years	£669 over 3 years	
Totals	£28,620	£11,709	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Flat roof or sloping ceiling insulation	£900 - £1,200	£182		
2 Internal or external wall insulation	£7,500 - £11,000	£1218		
3 Floor insulation (suspended floor)	£5,000 - £10,000	£452		
4 Draughtproofing	£150 - £250	£478		
5 Change heating to gas condensing boiler	£3,500 - £10,000	£2964		
6 Replace single glazed windows with low-E double glazed windows	£4,500 - £6,000	£343		
7 Solar photovoltaic panels, 2.5 kWp	£8,000 - £10,000	£252		

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Biomass boiler (Exempted Appliance if in Smoke Control Area)

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Flat roof or sloping ceiling insulation

Insulating a flat roof or sloping ceiling will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation can be placed on top of the roof under the waterproof membrane and should particularly be considered when the waterproofing needs to be replaced. Further information about roof insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

2 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

3 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

4 Draughtproofing

Fitting draughtproofing, strips of insulation around windows and doors, will improve the comfort in the home. A contractor can be employed but draughtproofing can be installed by a competent DIY enthusiast.

5 Gas condensing boiler

Changing the heating to use a mains gas boiler that provides both space and water heating will save money, as mains gas is currently cheaper than the fuel being used at present. A condensing boiler is capable of higher efficiencies than other types of boiler, meaning it will burn less fuel to heat the property, but there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). This improvement is most appropriate when the existing heating system needs repair or replacement. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

6 Double glazed windows

Double glazing is the term given to a system where two panes of glass are made up into a sealed unit. Replacing existing single-glazed windows with double-glazed windows will improve comfort in the home by reducing draughts and cold spots near windows. Double-glazed windows may also reduce noise, improve security and combat problems with condensation. Building regulations apply to this work and planning permission may also be required, so it is best to check with your local authority on what standards need to be met. A building warrant is not required if the windows comply with the current requirements.

7 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	68,297.75	N/A	N/A	N/A
Water heating (kWh per year)	3,950.74			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Graeme Stewart
Assessor membership number:	EES/012602
Company name/trading name:	J & E Shepherd
Address:	13 Albert Square Dundee DD1 1XA
Phone number:	01382 200454
Email address:	dundee@shepherd.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT





Property Questionnaire



property questionnaire

Property address	25 Midton Road Ayr KA7 2SF
Seller(s)	Ms F Williams
Completion date of property questionnaire	08/07/2025

property questionnaire

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership	
	How long have you owned the property?	Since 1960
2.	Council tax	
	Which Council Tax band is your property in?	G
3.	Parking	
	<p>What are the arrangements for parking at your property? (Please tick all that apply)</p> <ul style="list-style-type: none">• Garage <input type="text" value="Yes"/>• Allocated parking space <input type="text" value="No"/>• Driveway <input type="text" value="Yes"/>• Shared parking <input type="text" value="No"/>• On street <input type="text" value="Yes"/>• Resident permit <input type="text" value="No"/>• Metered Parking <input type="text" value="No"/>• Other (please specify): <input type="text"/>	
4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	Yes

property questionnaire

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	Yes
6.	Alterations/additions/extensions	
a.	<p>(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?</p> <p><u>If you have answered yes</u>, please describe below the changes which you have made:</p> <p>1964 Single storey flat roofed extension to the rear of the house, including an integrated extension to the garage. Replacement of the conservatory. (2013)</p>	Yes
	<p>(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?</p> <p><u>If you have answered yes</u>, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</p> <p>If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:</p>	Yes
b.	<p>Have you had replacement windows, doors, patio doors or double glazing installed in your property?</p> <p><u>If you have answered yes</u>, please answer the three questions below:</p>	Yes
	(i) Were the replacements the same shape and type as the ones you replaced?	Yes
	(ii) Did this work involve any changes to the window or door openings?	No
	<p>(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):</p> <p>Please give any guarantees which you received for this work to your solicitor or estate agent.</p> <p>Five front sash windows were replaced with 12pane sash windows to restore them to the original Georguan style windows in keeping with the style of other windows in the house. Done in the mid 1960s. No documentation available.</p>	
7.	Central heating	
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the	Yes

property questionnaire

	<p>main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).</p> <p><u>If you have answered yes or partial</u> – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</p> <p>Oil fired boiler with hot air via ducts</p> <p><u>If you have answered yes</u>, please answer the three questions below:</p>		
	<p>i) When was your central heating system or partial central heating system installed?</p> <p>1960. Furnace replaced in 2012 approximately</p>		
	<p>(ii) Do you have a maintenance contract for the central heating system?</p> <p><u>If you have answered yes</u>, please give details of the company with which you have a maintenance contract:</p>		No
	<p>(iii) When was your maintenance agreement last renewed? (Please provide the month and year).</p>		
8.	Energy Performance Certificate		
	<p>Does your property have an Energy Performance Certificate which is less than 10 years old?</p>		Yes
9.	Issues that may have affected your property		
a.	<p>Has there been any storm, flood, fire or other structural damage to the property while you have owned it?</p> <p><u>If you have answered yes</u>, is the damage the subject of any outstanding insurance claim?</p>		No
b.	<p>Are you aware of the existence of asbestos in your property?</p> <p><u>If you have answered yes</u>, please give details:</p> <p>Home report states a hot water storage tank has an older type insulation material which has suspected asbestos content. We are making arrangements for this to be tested by a qualified company.</p>		Yes
10.	Services		
a.	Please tick which services are connected to your property and give details of the supplier:		
	Services	Connected	Supplier
	Gas or liquid petroleum gas	No	

property questionnaire

	Water mains or private water supply	Yes	Local Authority
	Electricity	Yes	Scottish Power
	Mains drainage	Yes	Local Authority
	Telephone	Yes	BT
	Cable TV or satellite	No	
	Broadband	Yes	Talk Talk
b.	Is there a septic tank system at your property?		No
	<u>If you have answered yes</u> , please answer the two questions below:		
	(i) Do you have appropriate consents for the discharge from your septic tank?		
	(ii) Do you have a maintenance contract for your septic tank?		
	<u>If have answered yes</u> , details of the company with which you have a maintenance contract:		
11.	Responsibilities for shared or common areas		
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?		No
	<u>If you have answered yes</u> , please give details:		
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?		No
	<u>If you have answered yes</u> , please give details:		
c.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?		No
d.	Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?		No
	<u>If you have answered yes</u> , please give details:		
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?		No

property questionnaire

	<u>If you have answered yes</u>, please give details:	
f.	<p>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)</p> <p><u>If you have answered yes</u>, please give details:</p>	No
12.	Charges associated with the property	
a.	<p>Is there a factor or property manager for your property?</p> <p><u>If you have answered yes</u>, please provide the name and address, and give details of any deposit held and approximate charges:</p>	No
b.	<p>Is there a common buildings insurance policy?</p> <p><u>If you have answered yes</u>, is the cost of the insurance included in monthly/annual factor's charges?</p>	No
c.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
13.	Specialist work	
a.	<p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p> <p><u>If you have answered yes</u>, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.</p>	No
b.	<p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p> <p><u>If you have answered yes</u>, please give details:</p>	No
c.	<p><u>If you have answered yes</u> to 13(a) or (b), do you have any guarantees relating to this work?</p> <p><u>If you have answered yes</u>, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself <u>please write below who has these documents</u> and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p>	

property questionnaire

14.	Guarantees	
a.	Are there any guarantees or warranties for any of the following?	
	(i) Electrical work	No
	(ii) Roofing	No
	(iii) Central heating	No
	(iv) National House Building Council (NHBC)	No
	(v) Damp course	No
	(vi) Any other work installations? (for example, cavity wall installation, underpinning, indemnity policy)	No
b.	<u>If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):</u>	
c.	Are there any outstanding claims under any of the guarantees listed above? <u>If you have answered yes</u> , please give details:	No
15.	Boundaries	
	So far as you are aware, has any boundary of your property been moved in the last 10 years?	No
	<u>If you have answered yes</u> , please give details:	
16.	Notices that affect your property	
	In the past three years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	No
b.	that affects your property in some other way?	No
c.	that requires you to do any maintenance, repairs or improvements to your property?	No
	<u>If you have answered yes to any of a–c above</u> , please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief

Name(s): Ms F Williams

Date: 08/07/2025



Home Report
Valuation Report
Executory Valuation
Tax Valuations
Separation Valuation
Private Sale Valuation
New Build & Plot Valuation
Insurance Reinstatement Valuation
Portfolio Valuation
Rental Valuation
Drive By & Desktop Valuation
Energy Performance Certificate (EPC)
Level Two Survey & Valuation Report
Level Two Condition Report
Expert Witness Report



Commercial Valuation
Commercial Agency
Acquisitions Consultancy
Commercial Lease Advisory
Rent Reviews
Asset Management
Development Appraisals & Consultancy
Auctions
Property Management
Professional Services
Licensed Trade & Leisure
Expert Witness Report
Rating
Property Investment
Public Sector



Quantity Surveying
Building Surveying
Project Management
Dispute Resolution Support Services
Principal Designer
Clerk of Works
Commercial EPC
Health & Safety Management
Employer's Agent
Energy Consultancy
Housing Partnerships
Housing Consultancy
Development Monitoring
Mediation Services

Aberdeen

△△△ 01224 202800

Ayr

△△ 01292 267987

Bearsden

△△ 0141 611 1500

Belfast

△ 02890 912975

Birmingham

△ 0121 270 2266

Coatbridge

△△ 01236 436561

Cumbernauld

△△ 01236 780000

Dalkeith

△△ 0131 663 2780

Dumbarton

△△ 01389 731682

Dumfries

△△△ 01387 264333

Dundee

△△ 01382 200454
△ 01382 220699

Dunfermline

△△ 01383 722337
△ 01383 731841

East Kilbride

△△ 01355 229317

Edinburgh

△△ 0131 2251234
△ 0131 557 9300

Elgin

△△ 01343 553939

Falkirk

△△ 01324 635 999

Fraserburgh

△△ 01346 517456

Galashiels

△△ 01896 750150

Glasgow

△△△ 0141 331 2807

Glasgow South

△△ 0141 649 8020

Glasgow West End

△△ 0141 353 2080

Greenock

△△ 01475 730717

Hamilton

△△ 01698 891400

Inverness

△△△ 01463 712239

Kilmarnock

△△ 01563 520318

Kirkcaldy

△△ 01592 205442

Lanark

△△ 01555 663058

Leeds

△ 0113 322 5069

Livingston

△△ 01506 416777

London

△△ 02033 761 236

Montrose

△△ 01674 676768

Musselburgh

△△ 0131 653 3456

Oban

△△ 01631 707 800

Paisley

△△ 0141 889 8334

Perth

△△ 01738 638188
△ 01738 631631

Peterhead

△△ 01779 470766

St Andrews

△△ 01334 477773
△ 01334 476469

Saltcoats

△△ 01294 464228

Stirling

△△ 01786 450438
△ 01786 474476



**Independent Surveyors for Fungal Decay, Woodworm
Dampness and Basement Waterproofing**

30 John Finnie Street
Kilmarnock
KA1 1DD

Tel 01563 529716
info@rowallansurveys.co.uk
www.rowallansurveys.co.uk

SURVEY REPORT

Customer: Fenella Williams

Property: 25 Midton Road
Ayr
KA7 2SF

Surveyor: Michael Caldow

Survey Date: 09/07/2025

Ref No: 11498

Report Date: 09/07/2025

Property Description: Detached House

May we take this opportunity to thank you for choosing Rowallan Timber and Damp Surveys to carry out this inspection. We confirm you have asked us to inspect the accessible timbers for fungal decay, infestation by wood boring insect and accessible areas for dampness.

Our objective in preparing this report for you is to ensure that you have full transparency of the problems identified, are aware of the costs involved and to provide you with the solutions to rectify these problems with the minimum of disruption.

So that you can be confident in our diagnosis, our surveyors are fully qualified to CSRT/ CSSW level.

Our inspection was restricted to the areas designated below and was of a non-disruptive nature. Should there be any other areas of concern to you that we have not commented on or if you would like a more detailed examination involving exposure works, we would be pleased to undertake this for you on receipt of further instruction (written permission will require to be obtained from the property owner). Parts of the property which cannot be accessed will not be reported upon and this will be stated in the report, however, should the surveyor suspect that a defect may exist, he may recommend that a further inspection is required.

All directions given in our report were taken from the outside of the property facing the front elevation wall.

The property requires a substantial scheme of general refurbishment and external remedial works to address moisture ingress.

Roof Voids

OBSERVATIONS

Inspection was severely restricted due to method of construction (ie, attic rooms and dormers). Limited inspection was possible adjacent to hatches at front and rear eaves and apex and was further restricted by insulation materials, dust and debris.

Some of the timbers are water stained. Moisture penetration via roof coverings, flashings, etc can result in the moisture content of timbers being excessive, in that, it would permit the germination of spores of wood destroying fungi. We therefore recommend that you arrange for the roof coverings to be inspected and repaired as required under separate contract. If during the course of this work you require further inspection, please do not hesitate to contact us.

Evidence of infestation by common furniture beetle (*Anobium punctatum*) was noted. Often referred to as woodworm, this is the most common wood-boring insect. It can be found in structural timbers where they lay their eggs on or in the timbers and the larvae feed upon and bore through the wood leaving a network of tunnels, thus damaging and weakening the structure.

The infestation noted during our inspection was slight to moderate and treatment with insecticide will be sufficient to eradicate the problem. It will also be necessary to treat attic floors and joists to ensure eradication from roof structure.

Inspection was generally restricted by furniture, substantial amounts of stored items and floor coverings at attic level.

Moisture penetration was noted to ceiling and wall linings at attic gable and to ceilings and upper walls along the front rooms at first floor level. This may have resulted in fungal decay to concealed timbers. We recommend this area is exposed and a further inspection carried out.

RECOMMENDATIONS

Works by Specialist Contractor:

Form additional access to apex and eaves linings to allow access for treatment/ further inspection. Carefully remove damaged section of ceiling and upper wall linings adjacent to left-hand gable. Make good on completion with plasterboard and plaster.

Carefully remove deafening material and clear debris along front elevation wallhead to allow inspection of roof timbers where moisture ingress is apparent.

Inspect exposed timbers and, if sound, treat with fungicide/preservative. Otherwise arrange to provide supplementary report on condition.

Protect electrical junction boxes and open water tanks as appropriate.

Carefully remove, set aside and re-instate insulation material as the work progresses.

Clean down as deemed necessary all exposed roof timbers.

Apply insecticide to all exposed and accessible surfaces of roof timbers.

Strip out and remove hardboard overlay to floors (no reinstatement).

Lift sufficient floorboards and apply insecticide to all exposed accessible surfaces of floor timbers.

Relay existing floorboards, renewing any damaged sections in pre-treated timber.



First Floor Level

OBSERVATIONS

Inspection was generally restricted by furniture and floor coverings.

Evidence of moisture penetration was noted to upper wall linings along front elevation and we would refer to our previous comments regarding inspecting concealed timbers above.

Moisture penetration was noted to left-hand and rear elevation walls of Rear Projection Bedroom. This may have resulted in fungal decay to concealed timbers. We recommend this area is exposed and a further inspection carried out.

RECOMMENDATIONS

Works by Specialist Contractor:

Carefully remove and set aside skirtings, facings, picture rail, etc and reinstate on completion.

Carefully expose lintels along front elevation.

Carefully strip out and remove wall linings, full height, to left-hand and rear elevation walls and clear all accumulated debris behind.

Whilst every reasonable precaution should be taken, repair to any unavoidable damage caused to decorative cornice is to be the responsibility of others under a separate contract.

Strip out and remove alcove cupboard on rear elevation.

Test bore lintels above windows along front elevation and to left-hand and rear elevations of Rear Projection Bedroom if sound, inject with Boracol preservative. Otherwise, provide supplementary report on condition.

Wall strapping, where applicable, is to be replaced in new treated timbers, fixed by means of mild steel holdfasts or hammer fixings and isolated from masonry by a physical dpm.

Re-instate wall linings disturbed with plasterboard having skim coat finish (finish flush over alcove).

Staircase

OBSERVATIONS

Decay by Dry Rot is evident to door frame at Ground to First-Floor to half-landing leading to rear projection. Decay was also noted to stair stringers leading to Attic.

Dry rot is the most serious wood destroying fungi. It is malignant and will spread even through thick masonry in search of timber to attack. The extent of the outbreak must be fully eradicated and the building fabric sterilised to prevent re-infestation occurring.

It is likely that the Dry Rot outbreak will be extending to affect half-landing timbers, staircase, lintels and surrounding wallfabric.

The extent of the outbreak cannot be determined without further exposure.

RECOMMENDATIONS

Works by Specialist Contractor:

Carefully strip out and remove decayed door facings, skirtings, stair stringers, surrounding wall and ceiling fabric and flooring, etc to determine extent of Dry Rot attack.



Provide temporary support, as required, following strip out.

Provide supplementary report on further necessary remedial works including the extent of structural floor timbers, staircase and lintels that will require replacement and reinstatement of wall and ceiling linings, plasterwork, facings, etc (no allowance for this work has been made in our current Cost Assessment).

Ground Floor Level

OBSERVATIONS

Inspection was generally restricted by furniture and floor coverings.

It would appear that the floor construction may be timber overlay on battens over solid substrate due to the absence of external sub-floor vents, however, this could not be determined as no sub-floor inspection was possible.

Inspection of the floor construction or sub-floor void would only be possible by lifting sections of finished narrow strip hardwood flooring. In doing so it is likely that flooring would be damaged and whilst every reasonable precaution would be taken, agreement would be required as to extent of exposure prior to commencement.

Where inspection was possible, no apparent surface visual evidence of fungal decay or infestation was noted.

A build-up of debris behind wall linings is allowing moisture to bridge from external masonry onto some isolated internal surfaces of lower walls.

Rear Utility Area

OBSERVATIONS

Floors are solid concrete.

Dampness is evident to walls in Utility area, however, we do not consider these significant in relation to the end-use of these areas. Should consideration be given to converting these areas to habitable accommodation, substantial refurbishment would be required and eradication of dampness incorporated into such a scheme. We would be pleased to provide further advice at that time.

Where inspection was possible, no apparent surface visual evidence of fungal decay or infestation was noted.

Flat Roof Extension

OBSERVATIONS

No access was possible beyond the rear corridor.

The extension is of fairly rudimentary construction and appears to be in a poor state of repair. Extensive refurbishment would be required, or alternatively, complete demolition.

We make no allowance for any remedial works to this area at this time.



GENERAL NOTES

We would draw your attention to the need for you to remove all fixtures, fittings, floor coverings, stored articles, etc from the areas designated for treatments, prior to works commencing on site.

Replacement timbers will be to standard stock items, sections and mouldings, unless otherwise specified.

Our cost assessment covers only those items specifically stated in the report to be undertaken by the Specialist Contractor. All other repairs and/or ancillary works are to be the responsibility of others, under separate contract.

No allowance has been made in our cost assessment for the removal and subsequent re-instatement of any electrical, plumbing or other services unless otherwise stated.

At the time of the inspection, it was not possible to ascertain the construction of the masonry or the nature of the mortar joints. Our cost assessment is therefore based on the masonry being level, in sound condition and bonded with mortar. If, during the course of the work specified, extra work is found to be necessary due to the poor condition of the masonry you will be notified.

It will be seen our specification includes for the removal of existing plaster. In removing plaster, it is not unusual for dust to find its way to the remotest parts of the property. Whilst the Specialist Contractor will take precautions to minimise this nuisance wherever practicable within the immediate area of the works, we respectfully suggest that you should also take some precautions to protect furniture and the like elsewhere in the property. No responsibility is likely to be accepted by the Specialist Contractor for cleaning or for any damage that may be caused by dust.

Our inspection is based upon a close, but not intimate, examination of the areas specified. Inevitably, there will be concealed timbers that could not be inspected fully, or at all, without opening up. We have, as far as possible, inspected accessible exposed surfaces available to us. Our recommendations are, therefore, subject to the qualification that further necessary works may be required once the fabric of the building or a particular element is exposed, this applies particularly to dry rot. Should you require a full exploratory examination, we would be pleased to quote. If you proceed on the present basis, we shall advise you of any further infestation or fungal decay discovered during the execution of the works and advise/assess accordingly.

You should be aware that we have reported upon problems evident to us at the time of our visit, we are not commenting in any general sense on the risk of fungal decay or any other defect not evident at this time or that may develop in the future.

Where we have drawn your attention to other defects, these should be regarded as helpful suggestions and not a full complete assessment of any problems that may exist. External weathered timbers (eg, windows, fascias, etc) and outbuildings are not covered by the scope of our survey.

About Rowallan Timber and Damp Surveys

We are a local, independent company providing professional advice and remedial solutions in relation to timber and damp problems in buildings.

Our reliability, professionalism and integrity have been proven by our many repeat customers and referrers. A small selection of our testimonials can be viewed on our website www.rowallansurveys.co.uk.

We would like to thank you once again for choosing us to carry out this survey for you. Our customer's opinions and satisfaction are very important to us and we believe in offering an exceptional service. We will, for that reason, follow up with a brief online survey from a specialist customer research company and would be delighted if you could provide us with your feedback. In the meantime, if you would like to comment on any aspect of our service, please feel free to call our office or drop us an email at info@rowallansurveys.co.uk.



Cost Assessment

We advise that a competitive cost to undertake **Works by Specialist Contractor** as specified in this survey report would be:

	£	16,500
VAT @ 20%	£	3,300
Total	£	19,800

Whilst we do not undertake remedial works directly, we can arrange for the works specified to be undertaken by one of our **Approved Specialist Contractors**. Although any contract will be between the customer and the Approved Specialist Contractor, you can be confident that work will be undertaken in accordance with our specification by skilled and experienced technicians complying with stringent industry standards in terms of workmanship and health and safety. Works will be carried out with the minimum of disruption and within the cost assessed by ourselves (subject to a reasonable period for acceptance and fluctuations in material costs).

Please contact ourselves should you wish work to be undertaken by an Approved Specialist Contractor and we will provide them all the necessary information for them to contact you directly and arrange mutually convenient work dates.

If works are undertaken by one of our **Approved Specialist Contractors**, upon final payment of the contract, a 10 year Guarantee will be issued offering you peace of mind by protecting your property for the future.

The surveyor who has been dealing with this property is Michael Caldow and can be contacted on telephone number 01563 529716 or mobile 07976 251978 or by e:mail at mc@rowallansurveys.co.uk.

M Caldow

Michael Caldow BSc CSRT CSSW

