

YOUR ONESURVEY HOME REPORT

ADDRESS

No 1
Easter Highgate
Beith
KA15 1HZ

PREPARED FOR

A & T Muirhead

INSPECTION CARRIED OUT BY:



SELLING AGENT:

Galbraith

HOME REPORT GENERATED BY:



Document Index

Document	Status	Prepared By	Prepared On
Single Survey	Final	Saltcoats - Allied Surveyors Scotland Ltd	18/07/2025
Mortgage Certificate	Final	Saltcoats - Allied Surveyors Scotland Ltd	21/07/2025
Property Questionnaire	Final	Mr & Mrs. A & T Muirhead	15/07/2025
EPC	FileUploaded	Saltcoats - Allied Surveyors Scotland Ltd	18/07/2025

Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is **essential** that you log onto www.onesurvey.org (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. **Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.**

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

P A R T 1 .

SINGLE SURVEY

A report on the condition of the property, with categories being rated from 1 to 3.



Single Survey

Survey report on:

Surveyor Reference	SA/9608
---------------------------	---------

Customer	Mr & Mrs. A & T Muirhead
-----------------	--------------------------

Selling address	No 1 Easter Highgate Beith KA15 1HZ
------------------------	--

Date of Inspection	18/07/2025
---------------------------	------------

Prepared by	Nick Davis, MSc MRICS Saltcoats - Allied Surveyors Scotland Ltd
--------------------	--

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. 2

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

² Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an

arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- *There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- *There are no particularly troublesome or unusual legal restrictions;
- *There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

“Re-instatement cost” is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The subjects comprise a substantial semi detached two storey and attic character "B" listed house, with accommodation over three levels.
Accommodation	Ground floor: Entrance vestibule, hallway, lounge, dining kitchen, utility area, and shower room with WC. First floor: Landing, three bedrooms (one with en suite shower room) and family bathroom with WC. Second floor (top): Landing, two bedrooms and bathroom with WC.
Gross internal floor area (m2)	189 sq. metres approximately.
Neighbourhood and location	The subjects are situated around 1.5 miles equidistant of Lugton and Burnhouse, set within a rural location, where surrounding properties are of residential and agricultural style. The subjects are set on Lochlibo Road. Amenities and facilities can be found within a short to medium drive.
Age	Originally constructed in 1837, converted and altered/adapted in 2007.
Weather	Overcast with occasional showers and bright spells. Period of mixed weather prior to inspection.
Chimney stacks	Chimney stacks are of a stone design, protected at roof level by synthetic/similar apron flashings. No flue linings were inspected or tested. <i>Visually inspected with the aid of binoculars where required.</i>

Roofing including roof space	The main roof is pitched, assumed to be timber framed and overlaid in replacement slate coverings, incorporating synthetic valley gutter details. There are tiled ridge details and dormer projections, together with velux style windows. No roof structure inspections were available, as no attic hatch exists. Understandably, we cannot comment further on areas covered or inaccessible being free from potential defects. <i>Sloping roofs were visually inspected with the aid of binoculars where required.</i> <i>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. Flat roofs have a limited life and depending on their age and quality of workmanship can fail at any time.</i> <i>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</i> <i>Roofs are prone to water penetration during adverse weather but it is not always possible for surveyors to identify this likelihood in good or dry weather. All roofs should be inspected and repaired by reputable tradesmen on an annual basis and especially after storms.</i>
Rainwater fittings	Rainwater fittings are predominately of a replacement PVC style. <i>Visually inspected with the aid of binoculars where required.</i>
Main walls	The main outer walls appear to be of a stone design, predominately of whinstone/similar, pointed at front, and with smooth render to rear. Some outer walls may be of cavity brick/blockwork design, at rear. Roughcast and exposed stonework noted at gable elevation. The exact specification should be confirmed prior to purchase <i>Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected.</i>
Windows, external doors and joinery	Windows are formed in a combination of replacement double glazed timber framed design, and double glazed PVC framed units. Entrance doors to front are of twin timber storm door design, with PVC framed "French" doors and a PVC clad and glazed rear entrance door. External and roofline joinery is predominately of low maintenance PVC, with some timber components thereafter. <i>Internal and external doors were opened and closed where keys were available.</i> <i>Random windows were opened and closed where possible.</i> <i>Doors and windows were not forced open.</i>

External decorations	Areas of painted external render and joinery items exist. <i>Visually inspected.</i>
Conservatories / porches	No conservatories or porches.
Communal areas	No internal communal circulation areas.
Garages and permanent outbuildings	No garages. Again, parking provisions exist. There is a derelict building/structure adjoining left hand corner of the property , and this is of solid stone design, with no roof. Limited inspections were available. <i>Visually inspected.</i>
Outside areas and boundaries	The property is accessed via a shared entrance driveway/circulation area of courtyard design, bound by areas of stone walling, overlaid in decorative hardstandings and gravel, featuring metal vehicular entrance gates. We understand that the property incorporates three private parking spaces, this should be confirmed. To the rear of the property there are private garden grounds, generally defined by areas of timber fencing, overlaid in lawn, gravel, concrete hardstandings and raised timber decking. The vacant/derelict plot to side incorporates a vehicular entrance gate, with stone boundary walling. Grounds are overlaid in roughcast grass, incorporating a variety of shrubs, trees and bushes. Loose rubble, building material and earth was noted thereafter. There appears to be a water course ditch at left hand side of the plot. Some undefined boundaries exist. Limited inspections were available to garden areas and associated boundaries. <i>Visually inspected.</i>
Ceilings	Ceilings are of plasterboard design throughout. <i>Visually inspected from floor level.</i>
Internal walls	Internal walls are predominately plasterboard lined. Plasterboard linings restricted our inspection. <i>Visually inspected from floor level.</i> <i>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</i>


Floors including sub floors	Flooring at ground level is of both solid and floated/suspended timber design, with assumed suspended timber flooring at upper levels thereafter. All floors were overlaid in fixed coverings and no sub floor inspections were available. Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.
Internal joinery and kitchen fittings	Internal joinery and door surrounds are mainly of a replacement timber design, part glazed. Timber stairs lead from the ground to the upper levels. Kitchen fittings comprise a relatively modern range of wall and base mounted units incorporating a stainless steel sink. The utility area also features wall and base mounted units and a stainless steel sink. No comment can be made that internal glazing panels are of toughened or safety glass. Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances.
Chimney breasts and fireplaces	No functioning chimney breasts or fireplaces.
Internal decorations	Paper, emulsion and tile finishes. Visually inspected.
Cellars	There are no cellars pertaining to the subjects.
Electricity	Mains electricity supply. The electrical installation incorporates circuit breaker fuses and where visible exposed wiring is encased in PVC connected to 13 amp power points. Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.

Gas	There is no mains gas supply serving the property or the immediate location. Bottled gas was noted at rear, serving the cooker within kitchen. Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.
Water, plumbing and bathroom fittings	We are informed that this is mains connected. Where visible pipework is of copper and PVC design. Ground floor shower room incorporates a shower compartment, WC and wash hand basin. First floor family bathroom features a bath, shower, WC and wash hand basin. Top floor bathroom incorporates a bath, WC and wash hand basin. We would highlight that ceiling height to this area is low in part. Master en suite features a shower compartment, WC and wash hand basin. Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances. Concealed areas around baths and shower trays cannot be inspected however water spillage over a period of time can result in unexpected defects to hidden parts of the building fabric.
Heating and hot water	Heating is provided via a wet electric boiler. This serves water filled radiators to the main apartments. We understand electricity is mains connected. Hot water is provided via a large factory insulated cylinder, contained adjacent to the boiler within a utility cupboard. The heating system was not in operation at the time of inspection. Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances.
Drainage	We understand this is to a shared septic tank. The location and style of this arrangement, together with access rights of way should be accurately confirmed by reference to title deeds. Drainage covers etc were not lifted. Neither drains nor drainage systems were tested.

Fire, smoke and burglar alarms	A number of ceiling mounted smoke detectors noted,. <i>Visually inspected.</i> <i>No test whatsoever were carried out to any systems or appliances.</i> <i>There is now a requirement in place for compliant interlinked fire, smoke and heat detectors in residential properties. The new fire smoke and alarm standard came into force in Scotland in February 2022, requiring a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also requires to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon fuelled appliance such as a boiler, open fire or wood burner etc. a carbon monoxide detector is also required.</i> <i>The surveyor will only comment on the presence of a smoke detector etc. but will not test them, ascertain if they are in working order, interlinked and / or fully compliant with the fire and smoke alarm standard that was introduced in 2022.</i> <i>We have for the purposes of the report, assumed the system is fully compliant, if not then the appropriate compliant system will required to be installed prior to sale. This of course should be confirmed by your legal advisor.</i>
---------------------------------------	--

Any additional limits to inspection	No access was gained above ceiling linings or behind fixed timber goods or sanitary ware. We have not tested all window/doors and associated handles to avoid excessive physical contact. We have not tested any elements of the electrical, heating and plumbing system and it would be prudent to do so prior to purchase. No furniture, fixtures/fittings or breakable items were moved during the course of our inspection. It would be prudent to check behind/under prior to purchase. Due to ever changing climate conditions, it would therefore be prudent to conduct appropriate background checks with regard to potential flood risks in and around the area, by reference to SEPA flood map/similar. Potential purchasers should satisfy themselves with regard to Fire Safety regulations and fire escape arrangements pertaining to the subject property, prior to purchase. Limited external building fabric inspections were available, from ground level view point. Limited external boundary and garden area inspections were also available, and our inspections of the derelict structure to side were from safe areas surrounding. <i>An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.</i> <i>Normal maintenance is not treated as a repair for the purposes of the Single Survey. When a category 1 rating is provided this means the property must continue to be maintained in the normal way.</i>
--	---

Sectional Diagram showing elements of a typical house

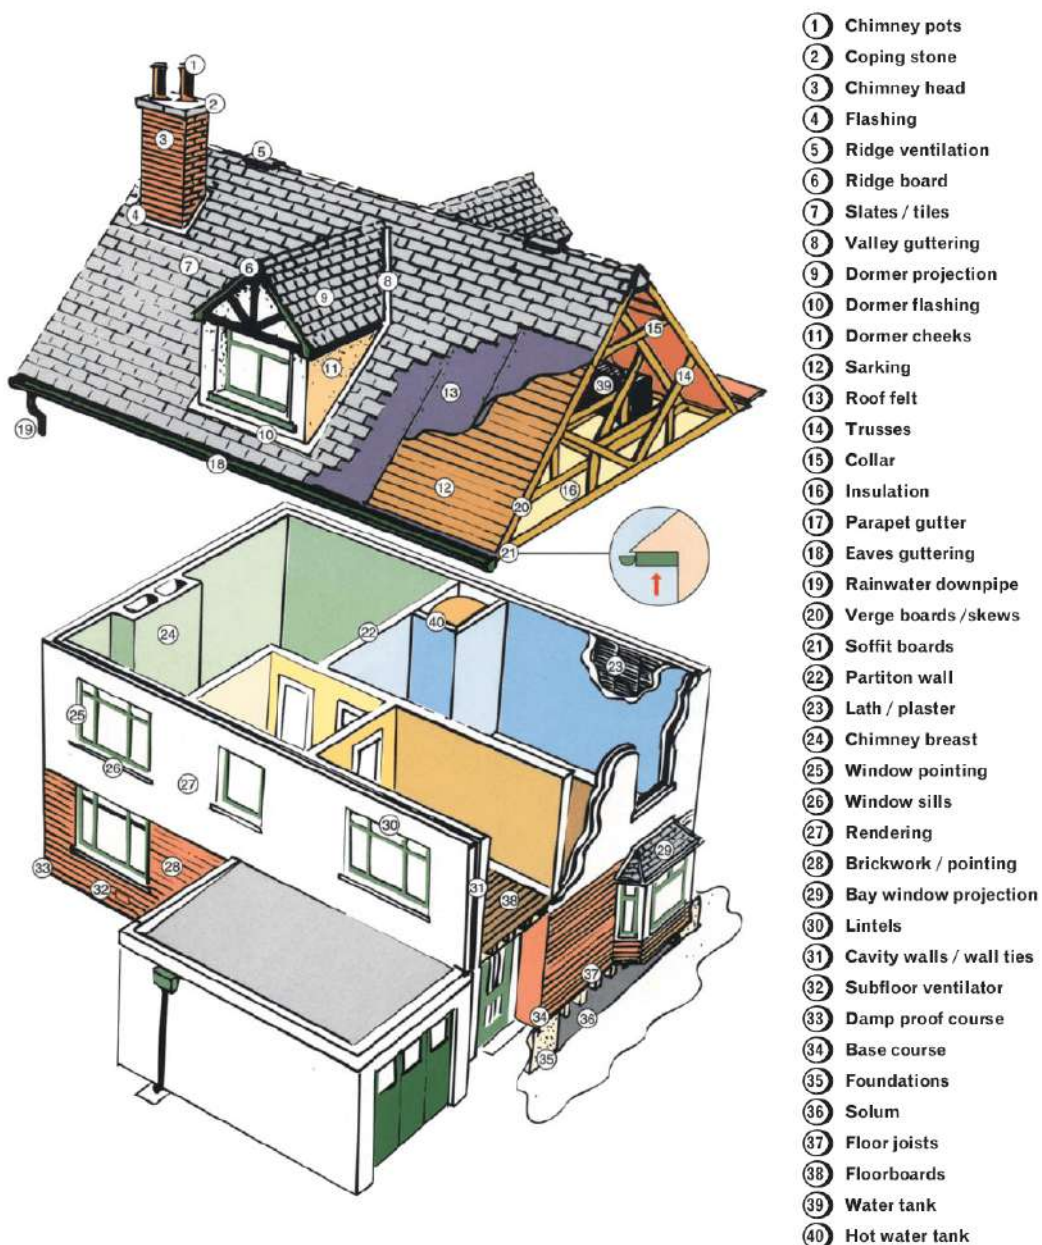

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the above 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category:	1
Notes:	There is evidence of settlement/movement, reflected in the form of some general external masonry distortion, together with localised plaster shrinkage and misalignment. On the basis of a single inspection this would appear to be non-progressive. Please read in conjunction with "Garages and Permanent Outbuildings".

Dampness, rot and infestation	
Repair category:	2
Notes:	Isolated positive moisture readings were obtained within entrance vestibule to lower walls. Investigate and repair as necessary. Understandably, our inspections were restricted due to fixed linings.

Chimney stacks	
Repair category:	2
Notes:	Weathering and wear and tear noted to chimney stacks, stone work and mortar joints. Routine maintenance expenditures should be anticipated, naturally increasing overtime.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Roofing including roof space

Repair category:	2
Notes:	It is appreciated that roof slating has been replaced, however some slightly misaligned and loose slates were noted, together with wear and tear to ridge tiling. Routine maintenance expenditures should be anticipated. An isolated moisture reading was obtained to a ceiling at a second floor bedroom. Monitor and repair if necessary.

Rainwater fittings

Repair category:	1
Notes:	Localised wear and tear noted to joints and junctions, within the limitations of our inspection.

Main walls

Repair category:	2
Notes:	The outer walls to front and rear were found to be neat and tidy. Some worn and cracked/defective render and masonry was noted at gable elevation, which would benefit from maintenance/repair. Thereafter routine maintenance expenditures should be anticipated, increasing overtime. It would be prudent to check lintel over side elevation recess (former window/door), to confirm this is adequately supported.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Windows, external doors and joinery

Repair category:	2
Notes:	Windows are of mixed age and style and display wear and tear to handles, hinges and operating mechanisms. Furthermore, some worn external mastic sealant was noted. Some air gaps exist to window frames. It was noted that a number of window units (particularly at first floor rear bedroom) have been screwed shut. This requires reinstatement/repair. Thereafter, general maintenance and repair is required.

External decorations

Repair category:	1
Notes:	Light weathering and wear and tear noted, however, predominately well presented.

Conservatories / porches

Repair category:	
Notes:	No conservatories or porches.

Communal areas

Repair category:	
Notes:	No internal communal circulation areas.

Garages and permanent outbuildings

Repair category:	3
Notes:	Derelict structure to side, requiring comprehensive refurbishment or redevelopment. It would be prudent to obtain advice via a reputable and qualified builder, to confirm that the structure is safe and supported in present condition.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Outside areas and boundaries

Repair category:	2
Notes:	The courtyard area to front was found to be neat and tidy, well presented. General wear and tear noted to boundaries and hardstandings, which will require maintenance from time to time. Rear garden grounds incorporate areas of damaged decking and localised areas of worn and damaged fencing, which requires repair. Thereafter, some cracked and off level hardstandings were noted. The plot to side incorporates an overgrown vegetation, and rubble on grounds. A degree of clearance and tending is therefore required. It would be prudent to confirm field drainage.

Ceilings

Repair category:	1
Notes:	Localised plaster misalignment and wear and tear noted. Localised plaster wear and tear also noted to kitchen ceiling. Selective re-plastering may be required.

Internal walls

Repair category:	1
Notes:	Localised plaster misalignment and wear and tear noted. Minor damaged noted to plasterwork particularly around en suite first floor light fitting. Selective re-plastering may be required.

Floors including sub-floors

Repair category:	1
Notes:	Weight testing of flooring at various points throughout the property proved it to be generally level.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Internal joinery and kitchen fittings

Repair category:	1
Notes:	Localised evidence of user wear and tear in places.

Chimney breasts and fireplaces

Repair category:	
Notes:	No functioning chimney breasts or fireplaces.

Internal decorations

Repair category:	1
Notes:	The property was found to be in generally good internal decorative order, however, some worn paintwork was noted in places, and therefore a degree of selective redecoration will be required.

Cellars

Repair category:	
Notes:	There are no cellars pertaining to the subjects.

Electricity

Repair category:	1
Notes:	It is recommended that electrical systems are checked and tested every five years to keep up to date with current safety requirements. No evidence is available to confirm recent testing or servicing. Failure to test the service regularly increases safety risks. Ideally a current test certificate should be made available.

Gas

Repair category:	
Notes:	Bottled gas supply only.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Water, plumbing and bathroom fittings

Repair category:	2
Notes:	Localised wear and tear noted to some sanitary fittings and associated boxings. Again, low ceiling height noted to part of second floor bathroom. Furthermore damaged boxing was noted to rear of a first floor bathroom and bath. This requires repair.

Heating and hot water

Repair category:	1
Notes:	The central heating system appears to be mid aged. We are unaware of last service and the system will require annual servicing /maintenance, increasing overtime. Potential purchasers should satisfy themselves with regard to running costs associated with the system.

Drainage

Repair category:	1
Notes:	Again, we are unaware of the exact specification of the drainage system. It should be confirmed that this has been adequately maintained and that appropriate rights of way exist. It is likely that the system will require occasional maintenance and repair. It should be confirmed that necessary SEPA/similar consents exist.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural movement	1
Dampness, rot and infestation	2
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	1
Main walls	2
Windows, external doors and joinery	2
External decorations	1
Conservatories / porches	
Communal areas	
Garages and permanent outbuildings	3
Outside areas and boundaries	2
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	
Internal decorations	1
Cellars	
Electricity	1
Gas	
Water, plumbing and bathroom fittings	2
Heating and hot water	1
Drainage	1

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	Ground, first and second
2. Are there three steps or fewer to a main entrance door of the property?	☒ YES ☐ NO
3. Is there a lift to the main entrance door of the property?	☐ YES ☒ NO
4. Are all door openings greater than 750mm?	☐ YES ☒ NO
5. Is there a toilet on the same level as the living room and kitchen?	☒ YES ☐ NO
6. Is there a toilet on the same level as a bedroom?	☒ YES ☐ NO
7. Are all rooms on the same level with no internal steps or stairs?	☐ YES ☒ NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	☒ YES ☐ NO

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

We understand the building is "B" listed and was converted to residential dwellings around 2007, at which times alterations were carried out. It should be confirmed that all necessary Local Authority permissions, warrants and consents were obtained at the relevant date, and that Historic Scotland/similar consents were also obtained.

We understand that the building is currently on one Title, and will be split prior to purchase. This should be accurately confirmed.

Our valuation incorporates both 1 Easter Highgate and building plot and derelict structure to side, which we understand has lapsed planning consents. Potential purchasers should satisfy themselves with regard to this detail and conduct background checks with the Local Authority.

Appropriate rights of way and the exact extent of garden grounds and parking provisions together with liability and ownership for any maintenance of common services or building fabric repairs should also be accurately confirmed prior to purchase.

Listed designations have restrictions in terms of any future developments and this requires to be done so in consultation with the Local Authority and Historic Scotland.

Our valuation assumes vacant possession will be available.

The property is in an area of known past Coal Mining activity and it would be prudent to obtain a report in this regard prior to purchase.

Field drainage enquires should also be conducted.

Our valuation has been prepared on the basis that the property will remain a semi detached house. Should this be changed, naturally this will have an impact on valuation.

Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.

It should be confirmed whether any services/connections require to be split.

Suitability for lending should be confirmed prior to purchase, as lenders have differing criteria with regard to additional plots, structures and potentially shared services.

Proof of funding should therefore be confirmed prior to purchase.

Estimated re-instatement cost (£) for insurance purposes

925,000 (guide figure for basis reconstruction purposes only). Specialist advice should be obtained prior to purchase to confirm that comprehensive insurance is in place for the main house and plot/structure to side.

Nine hundred and twenty five thousand pounds

Valuation (£) and market comments

450,000. This figure is for both the house and plot to side.

Taking current market conditions into account together with points detailed within our report we are of the opinion that the current market value of the heritable property is fairly stated in the capital sum of FOUR HUNDRED AND FIFTY THOUSAND POUNDS.

Report author:	Nick Davis, MSc MRICS
Company name:	Saltcoats - Allied Surveyors Scotland Ltd
Address:	24 Chapelwell Street Saltcoats KA21 5EA
Signed:	Electronically Signed: 292538-9d81065b-9a87
Date of report:	18/07/2025

P A R T 2 .

MORTGAGE VALUATION REPORT

Includes a market valuation of the property.





Mortgage Valuation Report

Property:	No 1 Easter Highgate Beith KA15 1HZ	Client: Mr & Mrs. A & T Muirhead Tenure: Ownership
Date of Inspection:	18/07/2025	Reference: SA/9608

This report has been prepared as part of the seller's instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising a potential lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation – Global Standards 2017 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of the reports contents. Neither the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor.

1.0 LOCATION

The subjects are situated around 1.5 miles equidistant of Lugton and Burnhouse, set within a rural location, where surrounding properties are of residential and agricultural style.

The subjects are set on Lochlibo Road.

Amenities and facilities can be found within a short to medium drive.

2.0	DESCRIPTION	2.1 Age:	Originally constructed in 1837, converted and altered/adapted in 2007.
-----	-------------	----------	--

The subjects comprise a substantial semi detached two storey and attic character "B" listed house, with accommodation over three levels.

3.0 CONSTRUCTION

The main outer walls appear to be of a stone design, predominately of whinstone/similar, pointed at front, and with smooth render thereafter.

The main roof is pitched, assumed to be timber framed and overlaid in replacement slate coverings, incorporating synthetic valley gutter details, tiled ridge detail and dormer style projections, together with velux style windows.

4.0 ACCOMMODATION

Ground floor: Entrance vestibule, hallway, lounge, dining kitchen, utility area, and shower room with WC.

First floor: Landing, three bedrooms (one with en suite shower room) and family bathroom with WC.

Second floor (top): Landing, two bedrooms and bathroom with WC.

5.0 SERVICES (No tests have been applied to any of the services)

Water:	Mains - confirm	Electricity:	Mains - confirm	Gas:	No connection	Drainage:	Septic tank - confirm details
Central Heating:		Full electric, to steel radiators					
6.0	OUTBUILDINGS						
Garage:		None.					
Others:		Derelict structure/plot to side.					
7.0	GENERAL CONDITION - <i>A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.</i>						
In general terms the subjects have been adequately maintained with regards to age and style. Points noted are considered commensurate with a property of this age and type capable of remedy in the course of routine maintenance. It is appreciated that roof slating has been replaced, however some slightly misaligned and loose slates were noted, together with wear and tear to ridge tiling. Routine maintenance expenditures should be anticipated. General wear and tear noted to external building fabric components thereafter. Repairs and maintenance are required to windows. Some external garden area repairs are required. The building plot and structure requires comprehensive repair/redevelopment or demolition, and it should be confirmed that this structure is safe. Pockets of softening and decay noted to external garden decking.							
8.0	ESSENTIAL REPAIR WORK <i>(as a condition of any mortgage or, to preserve the condition of the property)</i>						
Repair/redevelopment or demolition required to derelict structure.							
8.1 Retention recommended:			Nil				
9.0	ROADS & FOOTPATHS						
Made up and assumed adopted at main public highway, with private access courtyard and roadways thereafter. Confirm rights of way by reference to Title Deeds.							

10.0	BUILDINGS INSURANCE (£):	925,000 (guide figure for basis reconstruction purposes only). Specialist advice should be obtained prior to purchase to confirm that comprehensive insurance is in place for the main house and plot/structure to side.	GROSS EXTERNAL FLOOR AREA	214	Square metres
	<i>This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.</i>				
11.0	GENERAL REMARKS				

We understand the building is "B" listed and was converted to residential dwellings around 2007, at which times alterations were carried out. It should be confirmed that all necessary Local Authority permissions, warrants and consents were obtained at the relevant date, and that Historic Scotland/similar consents were also obtained.

We understand that the building is currently on one Title, and will be split prior to purchase. This should be accurately confirmed.

Our valuation incorporates both 1 Easter Highgate and building plot and derelict structure to side, which we understand has lapsed planning consents. Potential purchasers should satisfy themselves with regard to this detail and conduct background checks with the Local Authority.

Appropriate rights of way and the exact extent of garden grounds and parking provisions together with liability and ownership for any maintenance of common services or building fabric repairs should also be accurately confirmed prior to purchase.

Listed designations have restrictions in terms of any future developments and this requires to be done so in consultation with the Local Authority and Historic Scotland.

Our valuation assumes vacant possession will be available.

The property is in an area of known past Coal Mining activity and it would be prudent to obtain a report in this regard prior to purchase.

Field drainage enquires should also be conducted.

Our valuation has been prepared on the basis that the property will remain a semi detached house. Should this be changed, naturally this will have an impact on valuation.

Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.

It should be confirmed whether any services/connections require to be split.

Suitability for lending should be confirmed prior to purchase, as lenders have differing criteria with regard to additional plots, structures and potentially shared services.

Proof of funding should therefore be confirmed prior to purchase.

12.0	VALUATION <i>On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests.</i>		
12.1	Market Value in present condition (£):	450,000. This figure is for both the house and plot to side.	Four hundred and fifty thousand pounds
12.2	Market Value on completion of essential works (£):	-	
12.3	Suitable security for normal mortgage purposes?	Yes	
12.4	Date of Valuation:	18/07/2025	
Signature:		Electronically Signed: 292538-9d81065b-9a87	

Surveyor:	Nick Davis	MSc MRICS	Date:	21/07/2025
Saltcoats - Allied Surveyors Scotland Ltd				
Office:	24 Chapelwell Street Saltcoats KA21 5EA	Tel: 01294 602 292 Fax: email: saltcoats@alliedsurveyorsscotland.com		

P A R T 3 .

ENERGY REPORT

A report on the energy efficiency of the property.



energy report

energy report on:

Property address	No 1 Easter Highgate Beith KA15 1HZ
-------------------------	--

Customer	Mr & Mrs. A & T Muirhead
-----------------	--------------------------

Customer address	No 1 Easter Highgate Beith KA15 1HZ
-------------------------	--

Prepared by	Nick Davis, MSc MRICS Saltcoats - Allied Surveyors Scotland Ltd
--------------------	--

Energy Performance Certificate (EPC)

Scotland

Dwellings

NO 1 EASTER HIGHGATE, BEITH, KA15 1HZ

Dwelling type: Semi-detached house
Date of assessment: 18 July 2025
Date of certificate: 18 July 2025
Total floor area: 188 m²
Primary Energy Indicator: 158 kWh/m²/year

Reference number: 9388-1046-8233-7595-6220
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, electric


You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£16,209	See your recommendations report for more information
Over 3 years you could save*	£501	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Very energy efficient - lower running costs

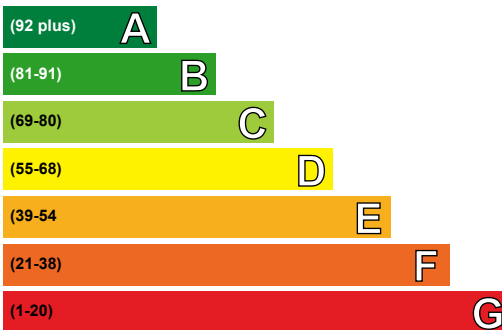

Not energy efficient - higher running costs

Current	Potential
42	56


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band E (42)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Very environmentally friendly - lower CO₂ emissions

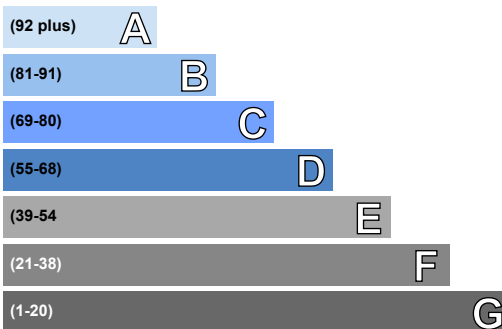

Not environmentally friendly - higher CO₂ emissions

Current	Potential
85	88

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band B (85)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Solar water heating	£4,000 - £7,000	£501.00
2 Solar photovoltaic (PV) panels	£8,000 - £10,000	£930.00
3 Wind turbine	£5,000 - £20,000	£2136.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Granite or whin, as built, insulated (assumed)	★★★★☆	★★★★☆
	Cavity wall, as built, insulated (assumed)	★★★★☆	★★★★☆
Roof	Pitched, insulated (assumed)	★★★★★	★★★★★
Floor	Suspended, insulated (assumed)	—	—
	Solid, insulated (assumed)	—	—
Windows	Fully double glazed	★★★☆☆	★★★☆☆
Main heating	Boiler and radiators, electric	★☆☆☆☆	★★★★★
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	None	—	—
Hot water	From main system	★★☆☆☆	★★★★★
Lighting	Below average lighting efficiency	★★★☆☆	★★★☆☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 15 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 2.9 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.6 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.


Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£13,467 over 3 years	£13,653 over 3 years	
Hot water	£2,412 over 3 years	£1,725 over 3 years	
Lighting	£330 over 3 years	£330 over 3 years	
Totals	£16,209	£15,708	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Solar water heating	£4,000 - £7,000	£167		
2 Solar photovoltaic panels, 2.5 kWp	£8,000 - £10,000	£310		
3 Wind turbine	£5,000 - £20,000	£712		

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

2 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

3 Wind turbine

A wind turbine provides electricity from wind energy. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Wind turbines are not suitable for all properties. The system's effectiveness depends on local wind speeds and the presence of nearby obstructions, and a site survey should be undertaken by an accredited installer. Planning permission might be required and building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for a wind turbine, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	15,673.34	N/A	N/A	N/A
Water heating (kWh per year)	2,829.74			

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Nicholas Davis
Assessor membership number:	EES/022444
Company name/trading name:	Allied Surveyors Scotland Ltd
Address:	91 John Finnie Street Kilmarnock KA1 1BG
Phone number:	01563 572341
Email address:	kilmarnock@alliedsurveyorsscotland.com
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



P A R T 4 .

PROPERTY QUESTIONNAIRE

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.



Property Questionnaire

Property Address

No 1

Easter Highgate

Beith

KA15 1HZ

Seller(s)

A & T Muirhead

Completion date of property questionnaire

15/07/2025

Note for sellers

1.	Length of ownership
	How long have you owned the property? 20 years
2.	Council tax
	Which Council Tax band is your property in? (Please circle) ☐ A ☐ B ☐ C ☐ D ☐ E ☒ F ☐ G ☐ H
3.	Parking
	What are the arrangements for parking at your property? (Please tick all that apply) Garage ☒ Allocated parking space ☐ Driveway ☒ Shared parking ☐ On street ☐ Resident permit ☐ Metered parking ☐ Other (please specify):

4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	☐ YES ☒ NO ☐ Don't know
5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	☒ YES ☐ NO
6.	Alterations/additions/extensions	
a	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	☒ YES ☐ NO
	If you have answered yes, please describe below the changes which you have made: <i>Fully refurbished</i>	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	☒ YES ☐ NO
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them: <i>Ian Briggs</i>	
b	Have you had replacement windows, doors, patio doors or double glazing installed in your property	☒ YES ☐ NO
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	☒ YES ☐ NO
	(ii) Did this work involve any changes to the window or door openings?	☐ YES ☒ NO
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed): Please give any guarantees which you received for this work to your solicitor or estate agent.	
7.	Central heating	

property questionnaire

a	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	☒ YES ☐ NO ☐ Partial
	If you have answered yes or partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). <i>Electric</i>	
	If you have answered yes, please answer the three questions below:	
	(i) When was your central heating system or partial central heating system installed? <i>2006</i>	
	(ii) Do you have a maintenance contract for the central heating system?	☐ YES ☒ NO
	If you have answered yes, please give details of the company with which you have a maintenance contract	
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	☒ YES ☐ NO
9.	Issues that may have affected your property	
a	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	☐ YES ☒ NO
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	☐ YES ☐ NO
b	Are you aware of the existence of asbestos in your property?	☐ YES ☒ NO ☐ Don't know
	If you have answered yes, please give details:	
10.	Services	

property questionnaire

a	Please tick which services are connected to your property and give details of the supplier:		
	Services	Connected	Supplier
	Gas or liquid petroleum gas	N	
	Water mains or private water supply	N	
	Electricity	Y	
	Mains drainage	Y	
	Telephone	Y	
	Cable TV or satellite	Y	
	Broadband	Y	
b	Is there a septic tank system at your property?		☒ YES ☐ NO
	If you have answered yes, please answer the two questions below:		
	(i) Do you have appropriate consents for the discharge from your septic tank?	☒ YES ☐ NO ☐ Don't know	
	(ii) Do you have a maintenance contract for your septic tank?	☐ YES ☒ NO	
	If you have answered yes, please give details of the company with which you have a maintenance contract:		
11.	Responsibilities for shared or common areas		
a	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details:		☐ YES ☒ NO ☐ Don't know
b	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:		☐ YES ☒ NO ☐ N/A
c	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?		☒ YES ☐ NO
d	Do you have the right to walk over any of your neighbours' property- for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details: <i>Shared driveway</i>		☒ YES ☐ NO

e	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:	☐ YES ☒ NO
f	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.) If you have answered yes, please give details:	☐ YES ☒ NO
12. Charges associated with your property		
a	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	☐ YES ☒ NO
b	Is there a common buildings insurance policy?	☐ YES ☒ NO ☐ Don't know
	If you have answered yes, is the cost of the insurance included in your monthly/annual factors charges?	
c	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
13. Specialist works		
a	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	☐ YES ☒ NO
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	
b	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	☐ YES ☒ NO
	If you have answered yes, please give details:	
c	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	☐ YES ☐ NO
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	

14.	Guarantees	
a	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	☒ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
(ii)	Roofing	☒ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
(iii)	Central heating	☒ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
(iv)	National House Building Council(NHBC)	☒ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
(v)	Damp course	☒ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	☒ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
b	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):	
c	Are there any outstanding claims under any of the guarantees listed above?	☐ YES ☒ NO
	If you have answered yes, please give details:	

15.	Boundaries	
	So far as you are aware, has any boundary of your property been moved in the last 10 years?	☐ YES ☒ NO ☐ Don't know
	If you have answered yes, please give details:	
16.	Notices that affect your property	
In the past three years have you ever received a notice:		
a	advising that the owner of a neighbouring property has made a planning application?	☐ YES ☒ NO
b	that affects your property in some other way?	☐ YES ☒ NO
c	that requires you to do any maintenance, repairs or improvements to your property?	☐ YES ☒ NO
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s) I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s):	Alicia Muirhead
Capacity:	[x]Owner []Legally Appointed Agent for Owner
Date:	

YOUR ONESURVEY HOME REPORT

ADDRESS

Easter Highgate
Beith
KA15 1HZ

PREPARED FOR

A & T Muirhead

INSPECTION CARRIED OUT BY:



SELLING AGENT:

Galbraith

HOME REPORT GENERATED BY:



Document Index

Document	Status	Prepared By	Prepared On
Single Survey	Final	Saltcoats - Allied Surveyors Scotland Ltd	18/07/2025
Mortgage Certificate	Final	Saltcoats - Allied Surveyors Scotland Ltd	18/07/2025
Property Questionnaire	Final	Mr & Mrs. A & T Muirhead	18/07/2025
EPC	FileUploaded	Saltcoats - Allied Surveyors Scotland Ltd	21/07/2025

Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is **essential** that you log onto www.onesurvey.org (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. **Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.**

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

P A R T 1 .

SINGLE SURVEY

A report on the condition of the property, with categories
being rated from 1 to 3.



Single Survey

Survey report on:

Surveyor Reference	SA/9604
Customer	Mr & Mrs. A & T Muirhead
Selling address	Easter Highgate Beith KA15 1HZ
Date of Inspection	18/07/2025
Prepared by	Nick Davis, MSc MRICS Saltcoats - Allied Surveyors Scotland Ltd

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. 2

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

² Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an

arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- *There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- *There are no particularly troublesome or unusual legal restrictions;
- *There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

“Re-instatement cost” is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The subjects comprise a substantial semi detached "B" listed character house, with annex, incorporating approximately 5.5 acres of land.
Accommodation	Ground floor - entrance vestibule, hallway, lounge, sitting room/dining room, main kitchen and utility area, rear porch, and cloakroom with WC. Annex - open plan lounge/kitchen (with mezzanine detail above), inner hallway, vestibule, bedroom and bathroom with WC. First floor - landing, three bedrooms (two with en suite shower rooms), and family bathroom with WC. Second floor (top) - landing, two bedrooms, and shower room with WC.
Gross internal floor area (m2)	324 sq. metres approximately (including annex, but without mezzanine area).
Neighbourhood and location	The subjects are situated around 1.5 miles equidistant of Lugton and Burnhouse, set within a rural location, where surrounding properties are of residential and agricultural style. Amenities and facilities can be found within a short to medium drive.
Age	Originally constructed in 1837, converted and altered/adapted in 2007.
Weather	Overcast with occasional showers and bright spells. Period of mixed weather prior to inspection.
Chimney stacks	Chimney stacks are of stone design, protected at roof level, synthetic/similar apron flashings. No flue linings were inspected or tested <i>Visually inspected with the aid of binoculars where required.</i>

Roofing including roof space	The main roof is pitched, assumed to be timber famed and overlaid in replacement slate coverings, incorporating synthetic valley gutter details, tiled ridge detail and dormer style projections, together with velux style windows. No roof structure inspections were available, as no attic hatch exists. Understandably, we cannot comment further on areas covered or inaccessible being free from potential defects. The annex incorporates an older style pitched and slate clad roof, with sloping ceiling internally. <i>Sloping roofs were visually inspected with the aid of binoculars where required.</i> <i>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. Flat roofs have a limited life and depending on their age and quality of workmanship can fail at any time.</i> <i>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</i> <i>Roofs are prone to water penetration during adverse weather but it is not always possible for surveyors to identify this likelihood in good or dry weather. All roofs should be inspected and repaired by reputable tradesmen on an annual basis and especially after storms.</i>
Rainwater fittings	Rainwater fittings are predominately of a replacement PVC style. <i>Visually inspected with the aid of binoculars where required.</i>
Main walls	The main outer walls appear to be of a stone design, predominately of whinstone/similar, pointed at front, and with render thereafter. The exact specification should be confirmed prior to purchase. <i>Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected.</i>

Windows, external doors and joinery	Windows are formed in a combination of replacement double glazed timber framed design, and double glazed PVC framed units. Entrance doors to front are of twin timber storm door design, with PVC framed "French" doors and a timber rear entrance door. External and roofline joinery is predominately of low maintenance PVC, with some timber components thereafter. The annex can be self contained and incorporates a main timber entrance door at side elevation, leading to an inner vestibule. To the rear there are double glazed PVC framed "French" doors. <i>Internal and external doors were opened and closed where keys were available.</i> <i>Random windows were opened and closed where possible.</i> <i>Doors and windows were not forced open.</i>
External decorations	Areas of painted external render and joinery items exist. <i>Visually inspected.</i>
Conservatories / porches	No conservatories or porches.
Communal areas	No internal communal circulation areas.
Garages and permanent outbuildings	There is a substantial detached garage of blockwork construction, roughcast externally, surmounted by a pitched, assumed timber framed and slate lined roof structure, incorporating photovoltaic panels. The garage incorporates a double car vehicular door and PVC pedestrian door, together with window unit. <i>Visually inspected.</i>

Outside areas and boundaries	The subjects incorporate garden grounds to front, with shared access driveway and circulation area, incorporating parking provisions for several vehicles. Boundaries are of a stone design, with grounds overlaid in decorative hard standings and gravel. Some trees exist in and around the feu. There are access roads at each side of the property. Rear garden grounds are generous in size, split level and bound by areas of full height stone walling, with rendered masonry inner walling, and timber fencing thereafter. A number of shrubs and bushes exist. Grounds are overlaid in extensive areas of lawn, together with areas of decorative hard standings, gravel and artificial lawn. Access roads at right and left hand side of the plot are roughly made and of single car/vehicle style. Acreage at rear is presently overlaid in rough grazing land, rolling and flat, incorporating post and wire fencing, timber fencing and areas of hedgerow/similar. We have not inspected the entirety of garden grounds and acreage. <i>Visually inspected.</i>
Ceilings	Ceilings are of plasterboard design throughout, split level. <i>Visually inspected from floor level.</i>
Internal walls	Internal walls are fully plasterboard lined. <i>Visually inspected from floor level.</i> <i>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</i>
Floors including sub floors	Flooring at ground level is of suspended/floated timber design, with solid sections thereafter. Flooring at upper levels is entirely of suspended timber design. All floors were overlaid in fixed coverings, and no sub floor inspections were available. <i>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</i> <i>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</i> <i>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</i>


Internal joinery and kitchen fittings	Internal joinery and door surrounds are of a traditional timber design, part painted and part glazed. Kitchen fittings comprise a mid age traditional range of wall and base mounted units, incorporating a stainless steel sink. A decorative timber stair leads from ground to upper levels. There is a modern kitchen within the annex, incorporating base mounted units and a stainless steel sink. No comment can be made that internal glazing panels are of toughened or safety glass <i>Built-in cupboards were looked into but no stored items were moved.</i> <i>Kitchen units were visually inspected excluding appliances.</i>
Chimney breasts and fireplaces	Decorative electric fires noted at ground level. <i>Visually inspected. No testing of the flues or fittings was carried out.</i>
Internal decorations	Traditional paper, emulsion and tile finishes. <i>Visually inspected.</i>
Cellars	There are no cellars pertaining to the subjects.
Electricity	Mains electricity supply. The electrical installation incorporates circuit breakers arrangements and where visible exposed wiring is encased in PVC connected to 13 amp power points. <i>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.</i> <i>Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</i>
Gas	No mains gas supply exists to the property or in the area. <i>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.</i> <i>Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</i>

Water, plumbing and bathroom fittings	Mains water supply. Plumbing where visible is of copper and PVC style. Ground floor cloakroom incorporates a WC and wash hand basin. En suite shower rooms at first floor level feature shower compartment, WC and wash hand basin. First floor main bathroom incorporates a bath, shower, WC and twin wash hand basins. Bathroom at annex incorporates a relatively modern bath, shower compartment, WC and wash hand basin. Top floor shower room incorporates a shower compartment, WC and wash hand basin. <i>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</i> <i>No tests whatsoever were carried out to the system or appliances.</i> <i>Concealed areas around baths and shower trays cannot be inspected however water spillage over a period of time can result in unexpected defects to hidden parts of the building fabric.</i>
Heating and hot water	Heating is provided via a wet electric boiler. This serves water filled radiators to the main apartments. We understand electricity is mains connected. Hot water is provided via a large factory insulated cylinder, contained adjacent to the boiler within an annex vestibule cupboard. The heating system was not in operation at the time of inspection <i>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</i> <i>No tests whatsoever were carried out to the system or appliances.</i>
Drainage	We understand drainage is to a shared septic tank. The location and style of this arrangement, together with access rights of way should be accurately confirmed by reference to title deeds. <i>Drainage covers etc were not lifted.</i> <i>Neither drains nor drainage systems were tested.</i>

Fire, smoke and burglar alarms	A number of ceiling mounted smoke detectors were noted. <i>Visually inspected.</i> <i>No test whatsoever were carried out to any systems or appliances.</i> <i>There is now a requirement in place for compliant interlinked fire, smoke and heat detectors in residential properties. The new fire smoke and alarm standard came into force in Scotland in February 2022, requiring a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also requires to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon fuelled appliance such as a boiler, open fire or wood burner etc. a carbon monoxide detector is also required.</i> <i>The surveyor will only comment on the presence of a smoke detector etc. but will not test them, ascertain if they are in working order, interlinked and / or fully compliant with the fire and smoke alarm standard that was introduced in 2022.</i> <i>We have for the purposes of the report, assumed the system is fully compliant, if not then the appropriate compliant system will required to be installed prior to sale. This of course should be confirmed by your legal advisor.</i>
---------------------------------------	--

Any additional limits to inspection	No access was gained above ceiling linings or behind fixed timber goods or sanitary ware. We have not tested all window/doors and associated handles to avoid excessive physical contact. We have not tested any elements of the electrical, heating and plumbing system and it would be prudent to do so prior to purchase. Due to ever changing climate conditions, it would therefore be prudent to conduct appropriate background checks with regard to potential flood risks in and around the area, by reference to SEPA flood map/similar. No furniture, fixtures/fittings or breakable items were moved during the course of our inspection. It would be prudent to check behind/under prior to purchase. Potential purchasers should satisfy themselves with regard to Fire Safety regulations and fire escape arrangements pertaining to the subject property, prior to purchase. Limited external building fabric inspections were available, from ground level view point We have not inspected the entirety of grounds, acreage or associated boundaries. <i>An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.</i> <i>Normal maintenance is not treated as a repair for the purposes of the Single Survey. When a category 1 rating is provided this means the property must continue to be maintained in the normal way.</i>
--	--

Sectional Diagram showing elements of a typical house

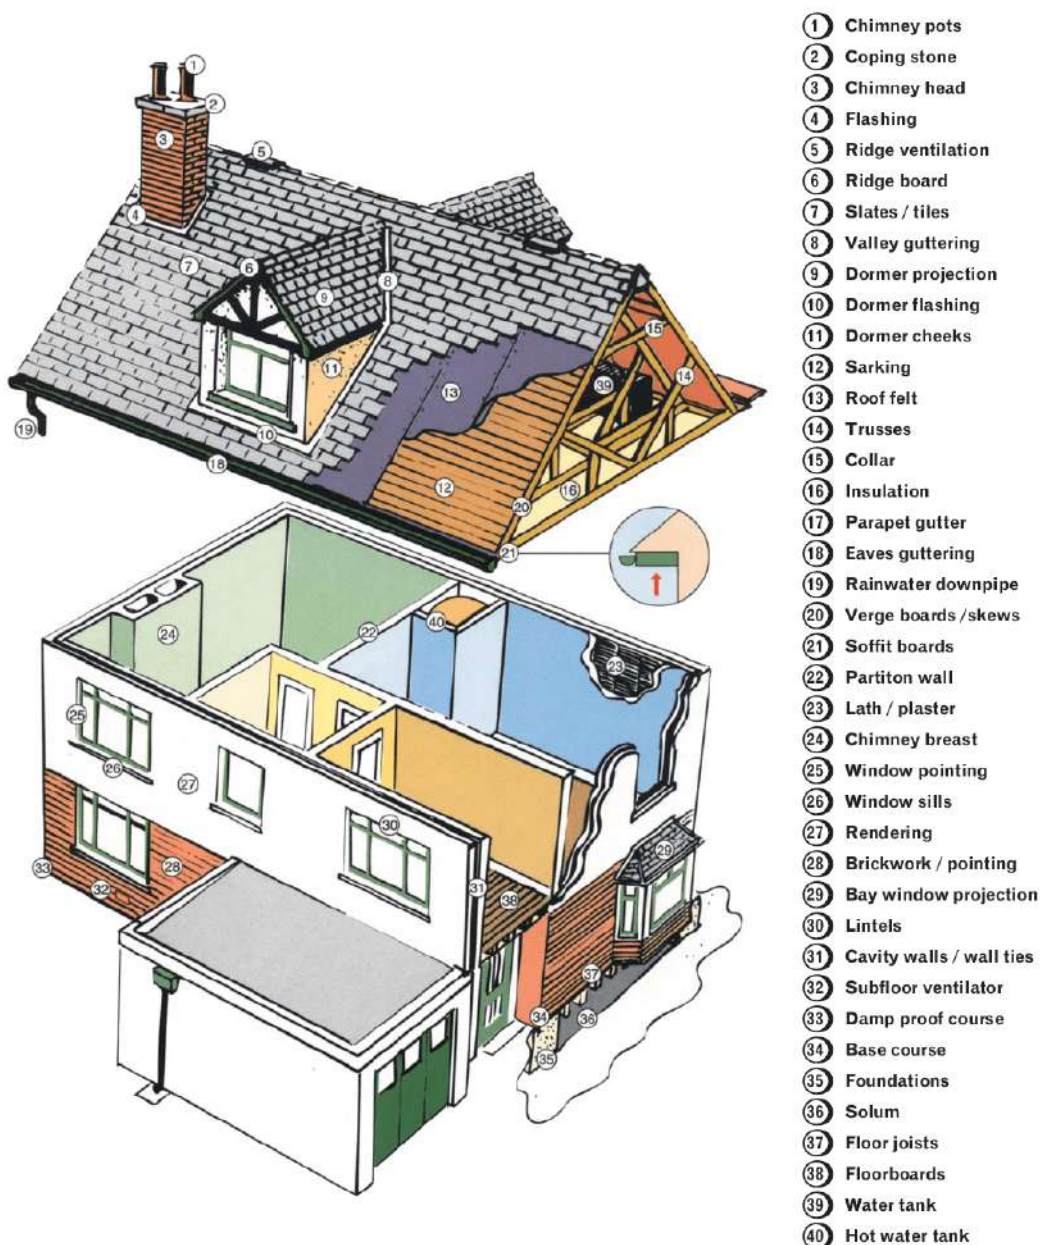

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the above 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category:	1
Notes:	There is evidence of settlement/movement, reflected in the form of some general external masonry distortion, together with localised plaster shrinkage and misalignment. On the basis of a single inspection this would appear to be non-progressive.

Dampness, rot and infestation	
Repair category:	2
Notes:	High positive moisture readings were obtained to lower wall linings within entrance vestibule at annex projection. Investigate and repair as necessary.

Chimney stacks	
Repair category:	2
Notes:	Weathering and wear and tear noted to chimney stacks, stone work and mortar joints. Routine maintenance expenditures should be anticipated, naturally increasing overtime.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Roofing including roof space

Repair category:	2
Notes:	It is appreciated that roof slating has been replaced, however some slightly misaligned and loose slates were noted, together with wear and tear to ridge tiling. Routine maintenance expenditures should be anticipated. General wear and tear noted to external building fabric components thereafter.

Rainwater fittings

Repair category:	1
Notes:	Localised wear and tear noted to joints and junctions, within the limitations of our inspection.

Main walls

Repair category:	2
Notes:	The outer walls to front and rear were found to be neat and tidy. General wear and tear evident to stonework and mortar joints. Routine maintenance expenditures should be anticipated, increasing overtime.

Windows, external doors and joinery

Repair category:	2
Notes:	Windows are of mixed age and style and display wear and tear to handles, hinges and operating mechanisms. Furthermore, some worn external mastic sealant was noted. Some air gaps exist to window frames. Thereafter, general maintenance and repair is required. Timber entrance doors display weathering and wear and tear.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

External decorations	
Repair category:	1
Notes:	The property was found to be in generally good external decorative order.

Conservatories / porches	
Repair category:	
Notes:	No conservatories or porches.

Communal areas	
Repair category:	
Notes:	No internal communal circulation areas.

Garages and permanent outbuildings	
Repair category:	2
Notes:	A small number of loose and cracked roof slates were noted. Missing end cap evident at rainwater guttering. Some misted window and door units were noted. Condensation staining and build-up was evident within. A degree of maintenance is required. It should be confirmed that the photovoltaic roof panels are connected, and owned outright. Specification of these should be confirmed.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Outside areas and boundaries

Repair category:	2
Notes:	Garden grounds were found to be particularly neat and tidy, partly landscaped. Again, there is full height stone walling, which is of an age and style that requires to be checked and maintained on a regular basis. Some frost action was noted to access roadways. Worn timber fencing and border details were noted. Trees, shrubs and bushes will require appropriate treatment/management.

Ceilings

Repair category:	1
Notes:	Localised plaster misalignment and wear and tear noted. Selective re-plastering may be required.

Internal walls

Repair category:	1
Notes:	Localised plaster misalignment and wear and tear noted. Selective re-plastering may be required.

Floors including sub-floors

Repair category:	1
Notes:	Weight testing of flooring at various points throughout the property proved it to be generally level.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Internal joinery and kitchen fittings

Repair category:	1
Notes:	Most joinery items were found to be neat and tidy, however, some main house kitchen fittings display user wear and tear. There is a modern kitchen within the annex, incorporating base mounted units and a stainless steel sink. Light user wear and tear was evident.

Chimney breasts and fireplaces

Repair category:	
Notes:	No functioning chimney breasts or fireplaces.

Internal decorations

Repair category:	1
Notes:	The property was found to be in generally good internal decorative order, however, some faded paintwork was noted in places, and therefore a degree of selective redecoration may be required.

Cellars

Repair category:	
Notes:	There are no cellars pertaining to the subjects.

Electricity

Repair category:	1
Notes:	It is recommended that electrical systems are checked and tested every five years to keep up to date with current safety requirements. No evidence is available to confirm recent testing or servicing. Failure to test the service regularly increases safety risks. Ideally a current test certificate should be made available.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Gas	
Repair category:	
Notes:	N/A

Water, plumbing and bathroom fittings	
Repair category:	2
Notes:	A degree of user wear and tear was noted to sanitary fittings, which are generally of modern design, neat and tidy. Some swollen boxings and minor damage evident on and around some sanitary fittings. Localised upgrade may therefore be required.

Heating and hot water	
Repair category:	1
Notes:	The central heating system appears to be mid aged, however we unaware of last service and the system will require annual servicing /maintenance, increasing overtime. Potential purchasers should satisfy themselves with regard to running costs associated with the system.

Drainage	
Repair category:	1
Notes:	Again, we are unaware of the exact specification of the drainage system. It should be confirmed that this has been adequately maintained and that appropriate rights of way exist. It is likely that the system will require occasional maintenance and repair. It should be confirmed appropriate SEPA/similar consents exist.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural movement	1
Dampness, rot and infestation	2
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	1
Main walls	2
Windows, external doors and joinery	2
External decorations	1
Conservatories / porches	
Communal areas	
Garages and permanent outbuildings	2
Outside areas and boundaries	2
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	
Internal decorations	1
Cellars	
Electricity	1
Gas	
Water, plumbing and bathroom fittings	2
Heating and hot water	1
Drainage	1

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	Ground, first, second and annex.
2. Are there three steps or fewer to a main entrance door of the property?	☒ YES ☐ NO
3. Is there a lift to the main entrance door of the property?	☐ YES ☒ NO
4. Are all door openings greater than 750mm?	☐ YES ☒ NO
5. Is there a toilet on the same level as the living room and kitchen?	☒ YES ☐ NO
6. Is there a toilet on the same level as a bedroom?	☒ YES ☐ NO
7. Are all rooms on the same level with no internal steps or stairs?	☐ YES ☒ NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	☒ YES ☐ NO

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

We understand the building is "B" listed and was converted to residential dwellings around 2007, at which times alterations were carried out. It should be confirmed that all necessary Local Authority permissions, warrants and consents were obtained at the relevant date, and that Historic Scotland/similar consents were also obtained.

We understand that the building is currently on one title, and will be split prior to purchase. This should be accurately confirmed.

Appropriate rights of way and the exact extent of garden grounds and parking provisions together with liability for any maintenance of common services or building fabric repairs should also be accurately confirmed prior to purchase.

Listed designations have restrictions in terms of any future developments and this requires to be done so in consultation with the Local Authority and Historic Scotland.

Again, the subjects incorporate an annex to side.

Confirm exact extent of acreage, garden grounds and boundaries, together with rights of way by reference to Title Deeds.

The property is located within an area of known past coal mining activity, and therefore a mining report should be obtained as standard practice for properties in the general location.

Field drainage enquires should also be conducted.

Suitability for lending should be confirmed prior to purchase, as lenders have differing criteria with regard to additional acreage and annexes.

SEPA/similar drainage consents should be checked.

Our valuation has been prepared on the basis that the property will remain a semi detached house and that services and Titles will be split as necessary.

Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.

Estimated re-instatement cost (£) for insurance purposes

1,400,000 (guide figure for basic reconstruction purposes only. Specialist advice should be obtained to ensure that comprehensive coverage exists).

One million four hundred thousand pounds. Specialist advice should however be obtained prior to purchase.

Valuation (£) and market comments

610,000

Taking current market conditions into account together with points detailed within our report we are of the opinion that the current market value of the heritable property is fairly stated in the capital sum of SIX HUNDRED AND TEN THOUSAND POUNDS.

Report author:	Nick Davis, MSc MRICS
Company name:	Saltcoats - Allied Surveyors Scotland Ltd
Address:	24 Chapelwell Street Saltcoats KA21 5EA
Signed:	Electronically Signed: 292537-9d81065b-9a87
Date of report:	18/07/2025

P A R T 2 .

MORTGAGE VALUATION REPORT

Includes a market valuation of the property.





Mortgage Valuation Report

Property:	Easter Highgate Beith KA15 1HZ	Client: Mr & Mrs. A & T Muirhead Tenure: Ownership.
Date of Inspection:	18/07/2025	Reference: SA/9604

This report has been prepared as part of the seller's instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising a potential lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation – Global Standards 2017 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of the reports contents. Neither the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor.

1.0 LOCATION

The subjects are situated around 1.5 miles equidistant of Lugton and Burnhouse, set within a rural location, where surrounding properties are of residential and agricultural style.

Amenities and facilities can be found within a short to medium drive.

2.0	DESCRIPTION	2.1 Age:	Originally constructed in 1837, converted and altered/adapted in 2007.
-----	-------------	----------	--

The subjects comprise a substantial semi detached "B" listed character house, with annex, incorporating approximately 5.5 acres of land.

3.0 CONSTRUCTION

The main outer walls appear to be of a stone design, predominately of windstone/similar, pointed at front, and with smooth render thereafter.

Some outer walls may be of cavity design, at rear.

The main roof is pitched, assumed to be timber famed and overlaid in replacement slate coverings, incorporating synthetic valley gutter details, tiled ridge detail and dormer style projections, together with velux style windows.

4.0 ACCOMMODATION

Ground floor - entrance vestibule, hallway, lounge, sitting room/dining room, main kitchen and utility area, rear porch, and cloakroom with WC.							
Annex - open plan lounge/kitchen (with mezzanine detail above), inner hallway, vestibule, bedroom and bathroom with WC.							
First floor - landing, three bedrooms (two with en suite shower rooms), and family bathroom with WC.							
Second floor (top) - landing, two bedrooms, and shower room with WC.							
5.0	SERVICES (No tests have been applied to any of the services)						
Water:	Mains - confirm	Electricity:	Mains	Gas:	No connection	Drainage:	Shared septic tank
Central Heating:		Full electric					
6.0	OUTBUILDINGS						
Garage:		Substantial detached garage.					
Others:		None.					
7.0	GENERAL CONDITION - <i>A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.</i>						
In general terms the subjects have been adequately maintained with regard to age and style. Points noted are considered commensurate with a property of this age and type capable of remedy in the course of routine maintenance.							
High positive moisture readings were obtained to lower wall linings within entrance vestibule at annex projection. Investigate and repair as necessary.							
8.0	ESSENTIAL REPAIR WORK (as a condition of any mortgage or, to preserve the condition of the property)						
None.							
8.1 Retention recommended:			Nil.				
9.0	ROADS & FOOTPATHS						
Made up and adopted at public highway, with private access roads thereafter. This should be confirmed.							
10.0	BUILDINGS INSURANCE (£):	1,400,000 (guide figure for basic reconstruction purposes only). Specialist advice should be obtained to ensure that comprehensive coverage exists.	GROSS EXTERNAL FLOOR AREA		366	Square metres	
<i>This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.</i>							
11.0	GENERAL REMARKS						

We understand the building is "B" listed and was converted to residential dwellings around 2007, at which times alterations were carried out. It should be confirmed that all necessary Local Authority permissions, warrants and consents were obtained at the relevant date, and that Historic Scotland/similar consents were also obtained.

We understand that the building is currently on one title, and will be split prior to purchase. This should be accurately confirmed.

Appropriate rights of way and the exact extent of garden grounds and parking provisions together with liability for any maintenance of common services or building fabric repairs should also be accurately confirmed prior to purchase.

Listed designations have restrictions in terms of any future developments and this requires to be done so in consultation with the Local Authority and Historic Scotland.

Again, the subjects incorporate an annex to side.

Confirm exact extent of acreage, garden grounds and boundaries, together with rights of way by reference to Title Deeds.

The property is located within an area of known past coal mining activity, and therefore a mining report should be obtained as standard practice for properties in the general location.

Field drainage enquires should also be conducted.

Suitability for lending should be confirmed prior to purchase, as lenders have differing criteria with regard to additional acreage and annexes.

SEPA/similar drainage consents should be checked.

Our valuation has been prepared on the basis that the property will remain a semi detached house and that services and Titles will be split as necessary.

Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.

12.0	VALUATION <i>On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests.</i>
-------------	--

12.1	Market Value in present condition (£):	610,000	SIX HUNDRED AND TEN THOUSAND POUNDS.
-------------	---	----------------	--------------------------------------

12.2	Market Value on completion of essential works (£):	N/A	
-------------	---	------------	--

12.3	Suitable security for normal mortgage purposes?	Yes	
-------------	--	-----	--

12.4	Date of Valuation:	18/07/2025	
-------------	---------------------------	------------	--

Signature:	Electronically Signed: 292537-9d81065b-9a87
-------------------	---

Surveyor:	Nick Davis	MSc MRICS	Date:	18/07/2025
------------------	------------	-----------	--------------	------------

Saltcoats - Allied Surveyors Scotland Ltd				
--	--	--	--	--

Office:	24 Chapelwell Street Saltcoats KA21 5EA	Tel: 01294 602 292 Fax: email: saltcoats@alliedsurveyorsscotland.com
----------------	--	--

P A R T 3 .

ENERGY REPORT

A report on the energy efficiency of the property.



energy report

energy report on:

Property address	Easter Highgate Beith KA15 1HZ
-------------------------	--------------------------------------

Customer	Mr & Mrs. A & T Muirhead
-----------------	--------------------------

Customer address	Easter Highgate Beith KA15 1HZ
-------------------------	--------------------------------------

Prepared by	Nick Davis, MSc MRICS Saltcoats - Allied Surveyors Scotland Ltd
--------------------	--

Energy Performance Certificate (EPC)

Scotland

Dwellings

NO 2 EASTER HIGHGATE, BEITH, KA15 1HZ

Dwelling type: Semi-detached house
Date of assessment: 18 July 2025
Date of certificate: 21 July 2025
Total floor area: 323 m²
Primary Energy Indicator: 168 kWh/m²/year

Reference number: 9215-8623-7430-2908-6292
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, electric


You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£30,201	See your recommendations report for more information
Over 3 years you could save*	£501	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Very energy efficient - lower running costs

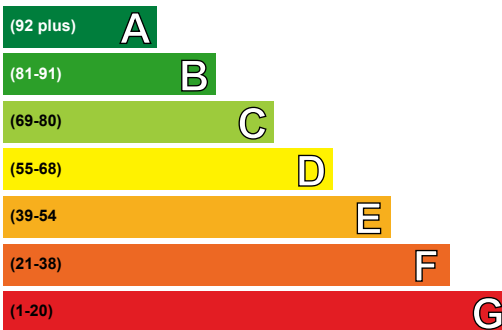

Current	Potential
34	40


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band F (34)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Very environmentally friendly - lower CO₂ emissions

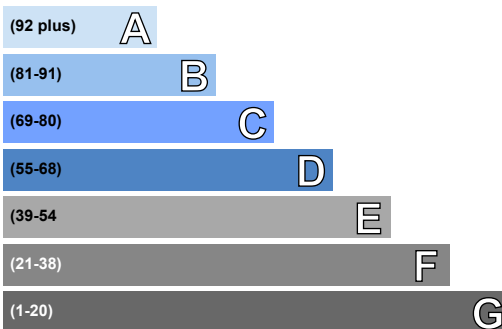

Current	Potential
82	84

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band B (82)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Solar water heating	£4,000 - £7,000	£495.00
2 Wind turbine	£5,000 - £20,000	£2136.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction. See the addendum section on the last page of this report for further information relating to items in the table.

Element	Description	Energy Efficiency	Environmental
Walls	Granite or whin, as built, insulated (assumed)	★★★★☆	★★★★☆
Roof	Pitched, insulated (assumed)	★★★★★	★★★★★
Floor	Suspended, insulated (assumed)	—	—
Windows	Fully double glazed	★★★☆☆	★★★☆☆
Main heating	Boiler and radiators, electric	★☆☆☆☆	★★★★★
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	None	—	—
Hot water	From main system	★☆☆☆☆	★★★★★
Lighting	Below average lighting efficiency	★★☆☆☆	★★☆☆☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 16 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 5.3 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.4 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.


Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£27,105 over 3 years	£27,294 over 3 years	
Hot water	£2,478 over 3 years	£1,788 over 3 years	
Lighting	£618 over 3 years	£618 over 3 years	
Totals	£30,201	£29,700	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Solar water heating	£4,000 - £7,000	£165		
2 Wind turbine	£5,000 - £20,000	£712		

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

2 Wind turbine

A wind turbine provides electricity from wind energy. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Wind turbines are not suitable for all properties. The system's effectiveness depends on local wind speeds and the presence of nearby obstructions, and a site survey should be undertaken by an accredited installer. Planning permission might be required and building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for a wind turbine, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present:

- Solar photovoltaics

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	31,664.8	N/A	N/A	N/A
Water heating (kWh per year)	2,905.72			

Addendum

The assessment does not include any feed-in tariffs that may be applicable to this property.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Nicholas Davis
Assessor membership number:	EES/022444
Company name/trading name:	Allied Surveyors Scotland Ltd
Address:	91 John Finnie Street Kilmarnock KA1 1BG
Phone number:	01563 572341
Email address:	kilmarnock@alliedsurveyorsscotland.com
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



P A R T 4 .

PROPERTY QUESTIONNAIRE

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.



Property Questionnaire

Property Address	Easter Highgate Beith KA15 1HZ
Seller(s)	A & T Muirhead
Completion date of property questionnaire	18/07/2025
Note for sellers	

1.	Length of ownership
	How long have you owned the property? 20 years
2.	Council tax
	Which Council Tax band is your property in? (Please circle) []A []B []C []D []E [x]F []G []H
3.	Parking
	What are the arrangements for parking at your property? (Please tick all that apply) Garage [] Allocated parking space [] Driveway [x] Shared parking [] On street [] Resident permit [] Metered parking [] Other (please specify):

4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	☐ YES ☒ NO ☐ Don't know
5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	☒ YES ☐ NO
6.	Alterations/additions/extensions	
a	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	☒ YES ☐ NO
	If you have answered yes, please describe below the changes which you have made: <i>Full refurbishment</i>	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	☒ YES ☐ NO
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them: <i>Solicitor</i>	
b	Have you had replacement windows, doors, patio doors or double glazing installed in your property	☒ YES ☐ NO
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	☒ YES ☐ NO
	(ii) Did this work involve any changes to the window or door openings?	☐ YES ☒ NO
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed): Please give any guarantees which you received for this work to your solicitor or estate agent.	
7.	Central heating	

property questionnaire

a	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	☒ YES ☐ NO ☐ Partial
	If you have answered yes or partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). <i>Electric wet system</i>	
	If you have answered yes, please answer the three questions below:	
	(i) When was your central heating system or partial central heating system installed? <i>19 years</i>	
	(ii) Do you have a maintenance contract for the central heating system?	☐ YES ☒ NO
	If you have answered yes, please give details of the company with which you have a maintenance contract	
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	☒ YES ☐ NO
9.	Issues that may have affected your property	
a	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	☐ YES ☒ NO
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	☐ YES ☐ NO
b	Are you aware of the existence of asbestos in your property?	☐ YES ☒ NO ☐ Don't know
	If you have answered yes, please give details:	
10.	Services	

property questionnaire

a	Please tick which services are connected to your property and give details of the supplier:		
	Services	Connected	Supplier
	Gas or liquid petroleum gas	N	
	Water mains or private water supply	N	
	Electricity	Y	
	Mains drainage	N	
	Telephone	Y	
	Cable TV or satellite	N	
	Broadband	Y	
b	Is there a septic tank system at your property?		☒ YES ☐ NO
	If you have answered yes, please answer the two questions below:		
	(i) Do you have appropriate consents for the discharge from your septic tank?	☒ YES ☐ NO ☐ Don't know	
	(ii) Do you have a maintenance contract for your septic tank?	☐ YES ☒ NO	
	If you have answered yes, please give details of the company with which you have a maintenance contract:		
11. Responsibilities for shared or common areas			
a	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details:		☐ YES ☒ NO ☐ Don't know
b	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:		☐ YES ☒ NO ☐ N/A
c	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?		☒ YES ☐ NO
d	Do you have the right to walk over any of your neighbours' property- for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details:		☐ YES ☒ NO
e	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:		☐ YES ☒ NO

property questionnaire

f	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.) If you have answered yes, please give details:	[] YES [x] NO
12.	Charges associated with your property	
a	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	[] YES [x] NO
b	Is there a common buildings insurance policy?	[] YES [x] NO [] Don't know
	If you have answered yes, is the cost of the insurance included in your monthly/annual factors charges?	
c	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
13.	Specialist works	
a	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	[] YES [x] NO
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	
b	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	[] YES [] NO
	If you have answered yes, please give details:	
c	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	[] YES [] NO
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	

14.	Guarantees	
a	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	☒ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
(ii)	Roofing	☒ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
(iii)	Central heating	☒ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
(iv)	National House Building Council(NHBC)	☒ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
(v)	Damp course	☒ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	☐ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
b	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):	
c	Are there any outstanding claims under any of the guarantees listed above?	☐ YES ☒ NO
	If you have answered yes, please give details:	

15.	Boundaries	
	So far as you are aware, has any boundary of your property been moved in the last 10 years?	☐ YES ☒ NO ☐ Don't know
	If you have answered yes, please give details:	
16.	Notices that affect your property	
In the past three years have you ever received a notice:		
a	advising that the owner of a neighbouring property has made a planning application?	☐ YES ☒ NO
b	that affects your property in some other way?	☐ YES ☒ NO
c	that requires you to do any maintenance, repairs or improvements to your property?	☐ YES ☒ NO
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s) I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s):	Alicia Muirhead
Capacity:	[x]Owner []Legally Appointed Agent for Owner
Date:	