



Home Report

shepherd.co.uk



SHEPHERD

CHARTERED SURVEYORS

All Angles Covered

Residential | Commercial | Property & Construction



Contents

1. Scottish Single Survey
 2. Energy Performance Certificate
 3. Property Questionnaire
-



Scottish Single Survey



Single Survey

survey report on:

Property address	1 Holding Mainholm Ayr KA6 5HD
Customer	Mr A Peacock
Customer address	1 Holding Mainholm Ayr KA6 5HD
Prepared by	Shepherd Chartered Surveyors
Date of inspection	29/09/2025



www.shepherd.co.uk

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by marking the adjacent box.

☐

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report².

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;

- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments

being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use

Terms and Conditions

communal grounds, parking areas, and other facilities;

- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form* unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	Two storey detached house with outbuildings and additional land.
Accommodation	Ground Floor: Entrance Vestibule, Hallway, Sitting Room, Living Room, Bedroom/Study, Rear Hall, Shower Room with wc, Kitchen and Utility Room. First Floor: Three Bedrooms, Bathroom with wc and Attic Room (by separate staircase).
Gross internal floor area (m²)	212 sq m or thereby.
Neighbourhood and location	The property is situated in a semi rural position just outside the town of Ayr and around one mile from most main amenities. There are several other private residences nearby and otherwise the property is surrounded by countryside/agricultural land.
Age	Construction in approximately 1880.
Weather	Showers.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate. There appear to be two gable chimneys and a third rear stack, each of masonry construction and part rendered although heavily obscured by climbing vegetation.

Single Survey

Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so. The roof is formed with adjoining pitches which are overlaid in natural slate with zinc ridge flashings. We were able to partially inspect the main roof void area via an upper hall ceiling hatch where the roof was seen to be of timber framed construction overlaid with timber sarking boards. There appears to be a mineral felt or similar style under slate membrane suggesting some past overhaul work although possibly historic.
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate. Mainly cast iron gutters and downpipes.
Main walls	Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected. Walls are of substantial solid stone/rubble construction, partly rendered and partly painted externally.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. Windows have been replaced with uPVC framed sealed unit double glazing with matching external doors.
External decorations	Visually inspected. Painted masonry and cast iron plumbing.
Conservatories / porches	None.

Communal areas	None.
Garages and permanent outbuildings	Visually inspected. The subjects comprise a former farmhouse and there are a number of outbuildings surrounding. These include an adjoining cluster of storage sheds and a main cattle court, each of stone and slate construction. Beyond these but adjoining, there is a further vehicle store and shed storage complex which is also of stone/masonry construction with slate clad roofs. Detached from the house, there is a former barn/store with side annex and separate non-heritable framed and sheeted garden store. There is also a shed and store adjoining the kitchen area of the house with the internal attic room above.
Outside areas and boundaries	Visually inspected. The property is accessed via a shared private lane. There is a central courtyard/parking area which is largely unsurfaced. There are some garden areas immediately surrounding the property beyond which there are woodland belts and also additional paddock land mainly to the North West. We are advised the grounds extend to approximately 2 acres but have not been measured.
Ceilings	Visually inspected from floor level. Mainly lath plaster lined.
Internal walls	Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. Mixed solid hard plaster and lath plaster linings.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Flooring is mostly of suspended timber at ground floor level with some solid flooring in places. Upper floors are of suspended timber.

Single Survey

Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. Skirting and facings are timber, internal doors are mixed style including timber panel and hollow panel units, partly glazed and there are two staircases leading to upper floor accommodation, each of timber construction. There are limited kitchen fittings within the kitchen and utility area.
Chimney breasts and fireplaces	Visually inspected. No testing of the flues or fittings was carried out. There are open fireplaces in both main ground floor public rooms and the upper floor bedrooms.
Internal decorations	Visually inspected. Painted plaster and joinery.
Cellars	None.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Electricity is from the mains grid with the meter and fuse box located in the entrance hall.
Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Gas appears to be from a private LPG supply with a storage tank located adjacent to the entrance driveway.

Single Survey

Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances. Cold water is assumed to be from the public main. The cold water rising main was not fully inspectable however, plumber fittings were of copper and PVC where seen. Sanitary arrangements comprise three piece white suites in each of the bath and shower rooms. The wc at the ground floor shower room appears to be a macerator type.
Heating and hot water	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances. The property has a system of LPG fired central heating via radiators. The gas boiler is a wall mounted unit located in the kitchen which also appears to provide hot water.
Drainage	Drainage covers etc. were not lifted. Neither drains nor drainage systems were tested. Foul drainage is assumed to be to a septic tank or similar although unconfirmed.
Fire, smoke and burglar alarms	Visually inspected. No tests whatsoever were carried out to the system or appliances. All Scottish homes require a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also needs to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon-fuelled appliance such as a boiler, open fire or wood burner, a carbon monoxide detector is also required. We have not assessed or tested any existing equipment and it is the purchasers responsibility to confirm that the property will comply with these standards following a change of ownership.

Any additional limits to inspection	For flats / maisonettes Only the subject flat and internal communal areas giving access to the flat were inspected. If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation. The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance. There is widespread climbing vegetation covering large areas of front and side elevation, chimneys, rainwater goods and large areas of roof. This severely restricted our inspection of the external building fabric and any purchasers will require to have the external condition re-assessed following exposure work. An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor. Windows and external doors were not all fully opened or tested. No access was available to any sub-floor areas. We were not able to fully enter the roof void area due to a thick layer of insulation. No access was available beneath all kitchen or sanitary fittings. The grounds pertaining to the subject property were viewed from several vantage points although not all areas or boundaries were closely inspected. Some areas of outbuilding were locked or unsafe and not fully entered, including the garden store adjoining the kitchen projection of the main house and upper floor areas.
--	---

Sectional Diagram showing elements of a typical house



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

Single Survey

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

 Structural movement	
Repair category	1
Notes	The building appears to have suffered slight settlement in places noted by uneven building lines, however there was no evidence of recent or continuing structural movement. We would however point out the restrictions to our inspection caused by external climbing vegetation. It would appear that a number of large mature trees have been removed, a short distance from the house itself, in recent weeks. It is assumed this was carried out by professional tree surgeons and the risk of an altered water table due to the removal of trees has been fully assessed. Any supporting reports or documentation in this respect should be obtained. In the absence of these, the ground conditions surrounding the house should be closely monitored for the foreseeable future and any significant changes may require drainage arrangements to be put in place.

 Dampness, rot and infestation	
Repair category	3
Notes	Above average damp readings were obtained to several areas of internal wall and ceiling lining at both lower and upper levels. Traces of wood bore infestation were noted to roof timbers and localised areas of timber decay were noted to flooring. A reputable timber/damp specialist contractor should carry out a full and thorough inspection of the entire property prior to purchase and provide written estimates for all necessary remedial works.

 Chimney stacks	
Repair category	2
Notes	Chimneys were not fully inspectable due to climbing vegetation but are likely to require some maintenance/repair.

Single Survey



Roofing including roof space

Repair category	2
Notes	Roof coverings appear to be of an age and style where at least a degree of regular ongoing maintenance will be required in future. Our inspection of the roof was greatly restricted by extensive climbing vegetation and further advice from a reputable roofing contractor is recommended. Some previous water ingress was noted both within the property and roof void area and repairs should be anticipated.



Rainwater fittings

Repair category	3
Notes	Some damaged and uneven areas of gutter were noted and several sections of rainwater goods were entirely obscured by climbing vegetation. A full overhaul or replacement should be anticipated.



Main walls

Repair category	2
Notes	Localised areas of cracked/weathered masonry will require future repair. Extensive and mature climbing vegetation has covered large areas of the front and gable elevations of the property. This will require to be professionally removed or kept in check and repairs to exposed areas may be required.



Windows, external doors and joinery

Repair category	1
Notes	Windows were not all fully opened or tested, and it should be appreciated that some defects are only evident during certain weather conditions. Within the limitations of our inspection, no significant defects were noted.



External decorations

Repair category	1
Notes	Paint finished and decorated external surfaces will require redecoration on a regular basis.

Single Survey



Conservatories/porches

Repair category	N/A
Notes	N/A



Communal areas

Repair category	N/A
Notes	N/A



Garages and permanent outbuildings

Repair category	3
Notes	Outbuildings were in a generally derelict condition and now due for a full overhaul or removal. Where outbuildings are to be retained, the advice of an experienced building contractor or structural engineer should be obtained, particularly where structural supports have been removed or buildings are dilapidated.



Outside areas and boundaries

Repair category	2
Notes	As stated above, a number of mature trees have recently been removed and ground conditions should be monitored in future for any changes in drainage behaviour. Mature trees and vegetation will require further future professional maintenance. The central courtyard/access lane would benefit from resurfacing. External ground levels should be assessed where adjoining the house, as part of timber/damp investigations. Some repairs are required to boundaries and fences, where seen. Other areas of boundary may be undefined due to title splits and the extent of the property should be confirmed to the satisfaction of any purchaser and is assumed to be around 2 acres or more.



Ceilings

Repair category	2
Notes	Several areas of cracked and damp ceiling plaster will require future repair.

Single Survey



Internal walls

Repair category	2
Notes	Cracked and damp areas will require repair and some widespread re-plastering may be necessary.



Floors including sub-floors

Repair category	2
Notes	Floors are affected by damp and decay as described above and repairs will be required. The level of sub floor ventilation should be confirmed as adequate.



Internal joinery and kitchen fittings

Repair category	2
Notes	There are inadequate kitchen fittings at present. Existing internal joinery is generally dated and due for replacement/upgrading.



Chimney breasts and fireplaces

Repair category	2
Notes	All chimney flues should be fully checked and swept prior to reuse.



Internal decorations

Repair category	2
Notes	Full redecoration required.



Cellars

Repair category	N/A
Notes	N/A

Single Survey



Electricity

Repair category	2
Notes	The electrical installation is on mixed lines and should be checked by a registered electrician and upgraded as necessary. The property may require to be fully re-wired.



Gas

Repair category	2
Notes	There will be a private maintenance liability in respect of the LPG supply. The supply and appliances should be fully checked prior to reuse, by a registered contractor.



Water, plumbing and bathroom fittings

Repair category	2
Notes	Aspects of the sanitary fittings and plumbing appear to be of an older style and should be checked and upgraded as necessary by a reputable contractor. Previous plumbing repairs were visible.



Heating and hot water

Repair category	1
Notes	The central heating system appears to be in general modern lines however, a full check and service by a registered contractor should be carried out prior to reuse.



Drainage

Repair category	2
Notes	Foul drainage is assumed to be to a septic tank although unconfirmed. SEPA registration should be confirmed.

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	3
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	3
Main walls	2
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	N/A
Communal areas	N/A
Garages and permanent outbuildings	3
Outside areas and boundaries	2
Ceilings	2
Internal walls	2
Floors including sub-floors	2
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	2
Internal decorations	2
Cellars	N/A
Electricity	2
Gas	2
Water, plumbing and bathroom fittings	2
Heating and hot water	1
Drainage	2

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground and first			
2. Are there three steps or fewer to a main entrance door of the property?	Yes	☒	No	☐
3. Is there a lift to the main entrance door of the property?	Yes	☐	No	☒
4. Are all door openings greater than 750mm?	Yes	☐	No	☒
5. Is there a toilet on the same level as the living room and kitchen?	Yes	☒	No	☐
6. Is there a toilet on the same level as a bedroom?	Yes	☒	No	☐
7. Are all rooms on the same level with no internal steps or stairs?	Yes	☐	No	☒
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes	☒	No	☐

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

We understand the grounds pertaining to the property include the steading and gardens immediately surrounding the house as well as paddock land immediately to the west and north west of the property. The 2 detached outbuildings to the north east of the house are understood to be excluded. This should be confirmed with the Title Deeds.

The access lane to the property appears to be private and shared and this should be confirmed.

The property may have private drainage and SEPA registration should be confirmed.

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialist's or contractor's advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

Estimated reinstatement cost for insurance purposes

For Reinstatement Cost Assessment purposes, it is recommended that the subjects be insured for a sum of not less than £1,500,000 (One Million, Five Hundred Thousand Pounds).

This figure is the estimate of the cost of rebuilding the premises and bears no direct relationship to current market value. The insurance figure includes an element for the outbuildings which is indicative only at this stage and should be assessed under separate heading by a Building Surveyor or equivalent.

Valuation and market comments

Having considered matters, taking account of our general observations on site, we are of the opinion that the Market Value of the subjects in their present condition and with the benefit of vacant possession may be fairly stated in the sum of £325,000 (Three Hundred and Twenty Five Thousand Pounds).

Signed	<i>Graeme Stewart</i> Electronically signed :- 30/09/2025 19:01
Report author	Graeme Stewart
Company name	J & E Shepherd Chartered Surveyors

Single Survey

Address	22 Miller Road Ayr KA7 2AY
Date of report	29/09/2025

Mortgage Valuation Report



Property Address

Address 1 Holding, Mainholm, Ayr, KA6 5HD
Seller's Name Mr A Peacock
Date of Inspection 29/09/2025

Property Details

Property Type ☒ House ☐ Bungalow ☐ Purpose built maisonette ☐ Converted maisonette
☐ Purpose built flat ☐ Converted flat ☐ Tenement flat ☐ Flat over non-residential use
☐ Other (specify in General Remarks)

Property Style ☒ Detached ☐ Semi detached ☐ Mid terrace ☐ End terrace
☐ Back to back ☐ High rise block ☐ Low rise block ☐ Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e. g. local authority, military, police? ☐ Yes ☒ No

Flats/Maisonettes only Floor(s) on which located No. of floors in block Lift provided? ☐ Yes ☐ No
No. of units in block

Approximate Year of Construction

Tenure

☒ Absolute Ownership ☐ Other

Accommodation

Number of Rooms Living room(s) Bedroom(s) Kitchen(s)
 Bathroom(s) WC(s) Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings) m² (Internal) m² (External)
Residential Element (greater than 40%) ☒ Yes ☐ No

Garage / Parking / Outbuildings

☒ Single garage ☐ Double garage ☐ Parking space ☐ No garage / garage space / parking space

Available on site? ☒ Yes ☐ No

Permanent outbuildings:

Range of traditional style steading outbuildings mainly of stone and slate construction.

Mortgage Valuation Report

Construction

Walls ☐ Brick ☒ Stone ☐ Concrete ☐ Timber frame ☐ Other (specify in General Remarks)
Roof ☐ Tile ☒ Slate ☐ Asphalt ☐ Felt ☐ Other (specify in General Remarks)

Special Risks

Has the property suffered structural movement? ☒ Yes ☐ No

If Yes, is this recent or progressive? ☐ Yes ☒ No

Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity? ☐ Yes ☒ No

If Yes to any of the above, provide details in General Remarks.

Service Connections

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks

Drainage ☐ Mains ☒ Private ☐ None Water ☒ Mains ☐ Private ☐ None
Electricity ☒ Mains ☐ Private ☐ None Gas ☐ Mains ☒ Private ☐ None
Central Heating ☒ Yes ☐ Partial ☐ None

Brief description of Central Heating and any non mains services:

LPG fired central heating via radiators.

Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

☐ Rights of way ☒ Shared drives / access ☐ Garage or other amenities on separate site ☐ Shared service connections
☐ Ill-defined boundaries ☒ Agricultural land included with property ☐ Other (specify in General Remarks)

Location

☐ Residential suburb ☐ Residential within town / city ☐ Mixed residential / commercial ☐ Shared service connections
☐ Commuter village ☐ Remote village ☒ Isolated rural property ☐ Other (specify in General Remarks)

Planning Issues

Has the property been extended / converted / altered? ☐ Yes ☒ No

If Yes provide details in General Remarks.

Roads

☐ Made up road ☐ Unmade road ☐ Partly completed new road ☐ Pedestrian access only ☐ Adopted ☒ Unadopted

Mortgage Valuation Report

General Remarks

The subjects comprise a former farmhouse located a short distance from the town of Ayr where main amenities are available.

At the time of inspection, the property was found to be in a neglected condition requiring to be extensively refurbished including widespread elements of repair and maintenance. Estimates for all described works should be obtained prior to purchase.

The property has a private/shared access road.

SEPA registration should be confirmed for the private drainage arrangements which were unidentified at the time of inspection.

Essential Repairs

None.

Estimated cost of essential repairs

Retention recommended?

☐ Yes ☒ No

Retention amount

Comment on Mortgageability

The subjects may not form suitable security for mortgage purposes due to the current neglected condition and any purchaser will require to fully satisfy themselves with regard to the availability of mortgage finance, prior to conclusion of missives.

Valuation

Market value in present condition

£

Market value on completion of essential repairs

£

Insurance reinstatement value

£

(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)

Is a reinspection necessary?

☐ Yes ☒ No

Mortgage Valuation Report

Declaration

Signed	<i>Graeme Stewart</i> Electronically signed :- 30/09/2025 19:01
Surveyor's name	Graeme Stewart
Professional qualifications	DipSurv, MRICS
Company name	J & E Shepherd Chartered Surveyors
Address	22 Miller Road, Ayr, KA7 2AY
Telephone	01292 267987
Email Address	ayr@shepherd.co.uk
Date of Inspection	29/09/2025



Energy Performance Certificate



Energy Performance Certificate (EPC)

Scotland

Dwellings

MAINHOLM FARM, AYR, KA6 5HD

Dwelling type: Detached house
Date of assessment: 29 September 2025
Date of certificate: 30 September 2025
Total floor area: 212 m²
Primary Energy Indicator: 288 kWh/m²/year


Reference number: 0120-2001-7210-2725-3081
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, LPG

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£15,669	See your recommendations report for more information
Over 3 years you could save*	£4,476	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

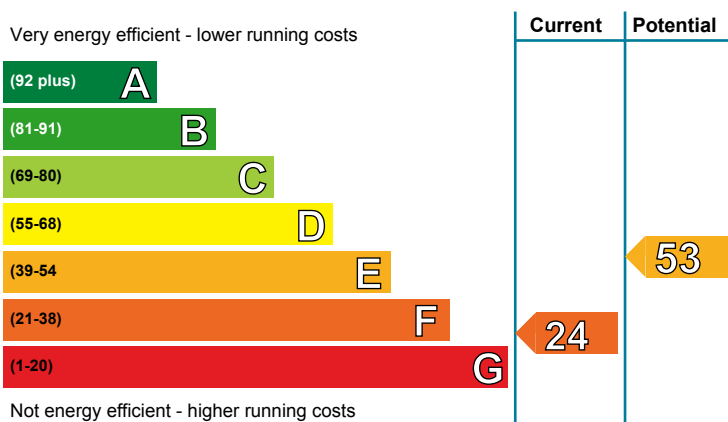


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band F (24)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

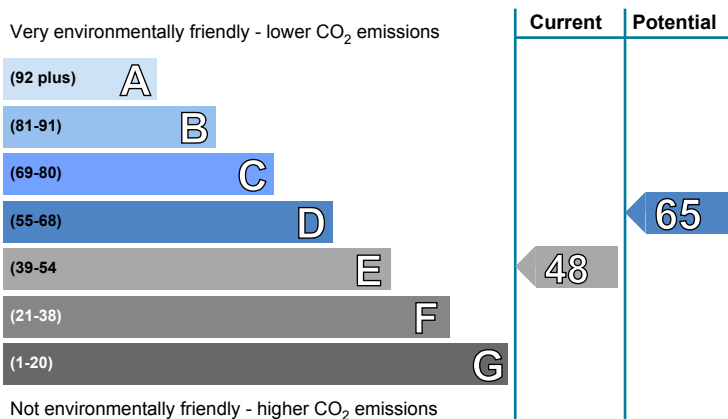

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (48)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal wall insulation	£7,500 - £11,000	£3159.00
2 Floor insulation (suspended floor)	£5,000 - £10,000	£1095.00
3 Low energy lighting	£240 - £280	£222.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Pitched, 250 mm loft insulation	★★★★☆	★★★★☆
Floor	Suspended, no insulation (assumed)	—	—
Windows	Fully double glazed	★★★☆☆	★★★☆☆
Main heating	Boiler and radiators, LPG	★★☆☆☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	Room heaters, dual fuel (mineral and wood)	—	—
Hot water	From main system	★★☆☆☆	★★★★☆
Lighting	Below average lighting efficiency	★★☆☆☆	★★☆☆☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 52 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 11 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 3.7 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.


Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£13,881 over 3 years	£9,687 over 3 years	
Hot water	£1,149 over 3 years	£1,149 over 3 years	
Lighting	£639 over 3 years	£357 over 3 years	
Totals	£15,669	£11,193	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Internal wall insulation	£7,500 - £11,000	£1053		
2 Floor insulation (suspended floor)	£5,000 - £10,000	£365		
3 Low energy lighting for all fixed outlets	£240 - £280	£74		
4 Solar photovoltaic panels, 2.5 kWp	£8,000 - £10,000	£263		
5 Wind turbine	£5,000 - £20,000	£712		

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Internal wall insulation

Internal wall insulation involves adding a layer of insulation to the inside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

3 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (<http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting>).

4 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

5 Wind turbine

A wind turbine provides electricity from wind energy. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Wind turbines are not suitable for all properties. The system's effectiveness depends on local wind speeds and the presence of nearby obstructions, and a site survey should be undertaken by an accredited installer. Planning permission might be required and building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for a wind turbine, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	37,940.69	N/A	N/A	N/A
Water heating (kWh per year)	2,505.47			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Graeme Stewart
Assessor membership number:	EES/012602
Company name/trading name:	J & E Shepherd
Address:	13 Albert Square Dundee DD1 1XA
Phone number:	01382 200454
Email address:	dundee@shepherd.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT





Property Questionnaire



property questionnaire

Property address	1 Holding Mainholm Ayr KA6 5HD
Seller(s)	Mr A Peacock
Completion date of property questionnaire	28/09/2025

property questionnaire

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership	
	How long have you owned the property?	1 month
2.	Council tax	
	Which Council Tax band is your property in?	F
3.	Parking	
	What are the arrangements for parking at your property? (Please tick all that apply) • Garage Yes • Allocated parking space No • Driveway Yes • Shared parking No • On street No • Resident permit No • Metered Parking No • Other (please specify): 	
4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	No

property questionnaire

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	No
6.	Alterations/additions/extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? <u>If you have answered yes</u>, please describe below the changes which you have made:	No
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? <u>If you have answered yes</u>, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property? <u>If you have answered yes</u>, please answer the three questions below:	No
	(i) Were the replacements the same shape and type as the ones you replaced?	
	(ii) Did this work involve any changes to the window or door openings?	
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed): Please give any guarantees which you received for this work to your solicitor or estate agent.	
7.	Central heating	
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom). <u>If you have answered yes or partial</u> – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). LPG	Partial central heating

property questionnaire

	<u>If you have answered yes</u>, please answer the three questions below:		
	i) When was your central heating system or partial central heating system installed? 2021		
	(ii) Do you have a maintenance contract for the central heating system? <u>If you have answered yes</u>, please give details of the company with which you have a maintenance contract:		No
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).		
8.	Energy Performance Certificate		
	Does your property have an Energy Performance Certificate which is less than 10 years old?		No
9.	Issues that may have affected your property		
a.	Has there been any storm, flood, fire or other structural damage to the property while you have owned it? <u>If you have answered yes</u>, is the damage the subject of any outstanding insurance claim?		No
b.	Are you aware of the existence of asbestos in your property? <u>If you have answered yes</u>, please give details:		No
10.	Services		
a.	Please tick which services are connected to your property and give details of the supplier:		
	Services	Connected	Supplier
	Gas or liquid petroleum gas	Yes	Calor
	Water mains or private water supply	Yes	Scottish Water
	Electricity	Yes	SSE
	Mains drainage	No	
	Telephone	Yes	BT

property questionnaire

	Cable TV or satellite	No	
	Broadband	No	
b.	Is there a septic tank system at your property? <u>If you have answered yes, please answer the two questions below:</u>	Yes	
	(i) Do you have appropriate consents for the discharge from your septic tank?	Yes	
	(ii) Do you have a maintenance contract for your septic tank? <u>If have answered yes, details of the company with which you have a maintenance contract:</u>	No	
11.	Responsibilities for shared or common areas		
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? <u>If you have answered yes, please give details:</u>	Don't know	
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? <u>If you have answered yes, please give details:</u>	Not Applicable	
c.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	No	
d.	Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries? <u>If you have answered yes, please give details:</u>	No	
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? <u>If you have answered yes, please give details:</u>	No	
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.) <u>If you have answered yes, please give details:</u>	No	

property questionnaire

12.	Charges associated with the property	
a.	Is there a factor or property manager for your property? <u>If you have answered yes</u>, please provide the name and address, and give details of any deposit held and approximate charges:	No
b.	Is there a common buildings insurance policy? <u>If you have answered yes</u>, is the cost of the insurance included in monthly/annual factor's charges?	No
c.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
13.	Specialist work	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? <u>If you have answered yes</u>, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	No
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? <u>If you have answered yes</u>, please give details:	No
c.	<u>If you have answered yes</u> to 13(a) or (b), do you have any guarantees relating to this work? <u>If you have answered yes</u>, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself <u>please write below who has these documents</u> and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	
14.	Guarantees	
a.	Are there any guarantees or warranties for any of the following?	
	(i) Electrical work	No
	(ii) Roofing	No
	(iii) Central heating	Don't know
	(iv) National House Building Council (NHBC)	No

property questionnaire

	(v) Damp course	No
	(vi) Any other work installations? (for example, cavity wall installation, underpinning, indemnity policy)	No
b.	<u>If you have answered 'yes' or 'with title deeds'</u> , please give details of the work or installations to which the guarantee(s) relate(s):	
c.	Are there any outstanding claims under any of the guarantees listed above? <u>If you have answered yes</u> , please give details:	No
15.	Boundaries	
	So far as you are aware, has any boundary of your property been moved in the last 10 years? <u>If you have answered yes</u> , please give details:	No
16.	Notices that affect your property	
	In the past three years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	No
b.	that affects your property in some other way?	No
c.	that requires you to do any maintenance, repairs or improvements to your property?	No
	<u>If you have answered yes to any of a–c above</u> , please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief

Name(s): Alistair MacMillan Peacock

Date: 28/09/2025



Home Report
Valuation Report
Executory Valuation
Tax Valuations
Separation Valuation
Private Sale Valuation
New Build & Plot Valuation
Insurance Reinstatement Valuation
Portfolio Valuation
Rental Valuation
Drive By & Desktop Valuation
Energy Performance Certificate (EPC)
Level Two Survey & Valuation Report
Level Two Condition Report
Expert Witness Report



Commercial Valuation
Commercial Agency
Acquisitions Consultancy
Commercial Lease Advisory
Rent Reviews
Asset Management
Development Appraisals & Consultancy
Auctions
Property Management
Professional Services
Licensed Trade & Leisure
Expert Witness Report
Rating
Property Investment
Public Sector



Quantity Surveying
Building Surveying
Project Management
Dispute Resolution Support Services
Principal Designer
Clerk of Works
Commercial EPC
Health & Safety Management
Employer's Agent
Energy Consultancy
Housing Partnerships
Housing Consultancy
Development Monitoring
Mediation Services

Aberdeen
△△△ 01224 202800

Ayr
△△ 01292 267987

Bearsden
△△ 0141 611 1500

Belfast
△ 02890 912975

Birmingham
△ 0121 270 2266

Coatbridge
△△ 01236 436561

Cumbernauld
△△ 01236 780000

Dalkeith
△△ 0131 663 2780

Dumbarton
△△ 01389 731682

Dumfries
△△△ 01387 264333

Dundee
△△ 01382 200454
△ 01382 220699

Dunfermline
△△ 01383 722337
△ 01383 731841

East Kilbride
△△ 01355 229317

Edinburgh
△△ 0131 2251234
△ 0131 557 9300

Elgin
△△ 01343 553939

Falkirk
△△ 01324 635 999

Fraserburgh
△△ 01346 517456

Galashiels
△△ 01896 750150

Glasgow
△△△ 0141 331 2807

Glasgow South
△△ 0141 649 8020

Glasgow West End
△△ 0141 353 2080

Greenock
△△ 01475 730717

Hamilton
△△ 01698 891400

Inverness
△△△ 01463 712239

Kilmarnock
△△ 01563 520318

Kirkcaldy
△△ 01592 205442

Lanark
△△ 01555 663058

Leeds
△ 0113 322 5069

Livingston
△△ 01506 416777

London
△△ 02033 761 236

Montrose
△△ 01674 676768

Musselburgh
△△ 0131 653 3456

Oban
△△ 01631 707 800

Paisley
△△ 0141 889 8334

Perth
△△ 01738 638188
△ 01738 631631

Peterhead
△△ 01779 470766

St Andrews
△△ 01334 477773
△ 01334 476469

Saltcoats
△△ 01294 464228

Stirling
△△ 01786 450438
△ 01786 474476



**Independent Surveyors for Fungal Decay, Woodworm
Dampness and Basement Waterproofing**

30 John Finnie Street
Kilmarnock
KA1 1DD

Tel 01563 529716
info@rowallansurveys.co.uk
www.rowallansurveys.co.uk

SURVEY REPORT

Customer: Alistair Peacock

Property: 1 Mainholm Farm
Mainholm
Ayr
KA6 5HD

Surveyor: Michael Caldow

Survey Date: 09/10/2025

Ref No: 11597

Report Date: 09/10/2025

Property Description: Attached Farmhouse

May we take this opportunity to thank you for choosing Rowallan Timber and Damp Surveys to carry out this inspection. We confirm you have asked us to inspect the accessible timbers for fungal decay, infestation by wood boring insect and accessible areas for dampness.

Our objective in preparing this report for you is to ensure that you have full transparency of the problems identified, are aware of the costs involved and to provide you with the solutions to rectify these problems with the minimum of disruption.

So that you can be confident in our diagnosis, our surveyors are fully qualified to CSRT/ CSSW level.

Our inspection was restricted to the areas designated below and was of a non-disruptive nature. Should there be any other areas of concern to you that we have not commented on or if you would like a more detailed examination involving exposure works, we would be pleased to undertake this for you on receipt of further instruction (written permission will require to be obtained from the property owner). Parts of the property which cannot be accessed will not be reported upon and this will be stated in the report, however, should the surveyor suspect that a defect may exist, he may recommend that a further inspection is required.

All directions given in our report were taken from the outside of the property facing the front elevation wall.

We have assumed that remedial works will be undertaken in conjunction with a more substantial scheme of alteration/ refurbishment and our specification has been prepared accordingly.

Main Roof Void

OBSERVATIONS

Inspection was severely restricted due to insulation materials, dust and debris.

Some of the timbers are water stained. Moisture penetration via roof coverings, flashings, etc can result in the moisture content of timbers being excessive, in that, it would permit the germination of spores of wood destroying fungi. We therefore recommend that you arrange for the roof coverings to be inspected and repaired as required under separate contract. If during the course of this work you require further inspection, please do not hesitate to contact us.

Vegetation growth is also causing moisture ingress and extensive vegetation growth to the roof and face of the building should be removed by others.

Evidence of infestation by common furniture beetle (*Anobium punctatum*) was noted. Often referred to as woodworm, this is the most common wood-boring insect. It can be found in structural timbers where they lay their eggs on or in the timbers and the larvae feed upon and bore through the wood leaving a network of tunnels, thus damaging and weakening the structure.

The infestation noted during our inspection was slight to moderate and treatment with insecticide will be sufficient to eradicate the problem.

RECOMMENDATIONS

Works by Specialist Contractor:

Protect electrical junction boxes and open water tanks as appropriate.

Carefully remove, set aside and re-instate insulation material as the work progresses.

Clean down as deemed necessary all exposed roof timbers.

Apply insecticide to all exposed and accessible surfaces of roof timbers.

Rear Left Roof Void, Rear Lean-to Roof and Porch Roof

OBSERVATIONS

No access was available to inspect roof timbers, however, we suspect similar woodworm issues.

RECOMMENDATIONS

Works by Specialist Contractor:

Form access as required to roof voids (no allowance for reinstatement).

Protect electrical junction boxes and open water tanks as appropriate.

Carefully remove, set aside and re-instate insulation material as the work progresses.

Clean down as deemed necessary all exposed roof timbers.

Apply insecticide to all exposed and accessible surfaces of roof timbers.



Rear Roof over Byre (above mid-floor room only)

OBSERVATIONS

Significant moisture ingress and moderate woodworm infestation was noted where ceiling have been removed. Rafter ends remain built in to beamfill.

RECOMMENDATIONS

Strip out and remove remainder of lath and plaster ceiling linings (no allowance for reinstatement).

Remove beamfill to expose rafter ends and wallplate. Inspect exposed timbers and, if sound, treat with fungicide/preservative. Otherwise arrange to provide supplementary report on condition.

Clean down as deemed necessary all exposed roof timbers.

Apply insecticide to all exposed and accessible surfaces of roof timbers.

Works required by others:

Reinstatement of all ceiling linings.

First Floor Level

OBSERVATIONS

Evidence of moisture penetration was noted to various areas and we would refer to our previous comments regarding roof maintenance.

Following a reasonable drying out period, remedial work can be assessed and undertaken to plaster and wall/ ceiling linings. This work would be the responsibility of others.

Evidence of infestation by common furniture beetle (*Anobium punctatum*) was noted.

The infestation noted during our inspection was slight to moderate and treatment with insecticide will be sufficient to eradicate the problem.

Water staining was noted to surface of Bathroom floor.

RECOMMENDATIONS

Works by Specialist Contractor:

Carefully strip out and remove floorboard to Bathroom.

Inspect exposed mid-floor timbers and, if sound, treat with fungicide/insecticide. Otherwise arrange to provide supplementary report on condition.

Fit new pre-treated floor boarding to Bathroom

Lift sufficient floorboards to remaining areas and apply insecticide to all exposed accessible surfaces of floor timbers.

Relay existing floorboards, renewing any damaged sections in pre-treated timber.

Apply insecticidal fluid to all exposed accessible surfaces of the staircase. Include for drilling risers and back-spraying concealed timbers to the underside of the staircase.



Mid-floor Over Byre

OBSERVATIONS

Extensive water ingress has caused damage to wallplaster and wet rot to floor.

RECOMMENDATIONS

Works by Specialist Contractor:

Completely remove mid-floor structure including flooring joists, etc.

Renew joists in pre-treated timber ensuring that all surfaces coming in contact with masonry are isolated with a physical damp proof membrane.

Make good pockets in masonry and pack-up wallplate void in slate as required.

Fit new pre-treated floor boarding to the disturbed floor area.

Apply insecticidal fluid to all exposed accessible surfaces of the staircase.

Include for drilling risers and back-spraying concealed timbers to the underside of the staircase.

Works required by others:

Removal of all damaged wallplaster and subsequent renewal (we would anticipate dry-lining walls to be the most appropriate option).

Ground Floor Level

OBSERVATIONS

Evidence of moisture penetration was noted to several areas and we would refer to our previous comments regarding roof maintenance and vegetation removal.

Ingress was prevalent to chimney on right-hand gable wall and chimney wall in Kitchen. We would recommend that damp plaster is stripped from these areas and walls dry-lined by others during refurbishment.

Concrete floors are in poor condition in some places and advice should be sought from a builder regarding replacement as required.

A limited sub-floor inspection was possible to the left-hand timber floor. The solum, although shallow and unsealed, was not noted to be excessively damp. It should be ensured that sub-floor ventilation is kept clear and maintained. An isolated area of wet rot was noted adjacent to the door to Hallway.

The right-hand timber floor appears to have previously been replaced. No sub-floor inspection was possible.

Evidence of infestation by common furniture beetle (*Anobium punctatum*) was noted. The infestation noted during our inspection was slight scattered and treatment with insecticide will be sufficient to eradicate the problem. It would be prudent to inspect concealed timbers bearing against external walls.

At the time of our survey visual and instrumental inspection indicated the presence of rising damp to both sides of internal walls running front to back along the Hallway

At the time of inspection, evidence of condensation was noted. For your guidance and assistance, we have enclosed a copy of our Condensation Information Sheet giving general advice.



RECOMMENDATIONS

Works by Specialist Contractor:

Carefully lift floorboards along front and rear elevations. Inspect exposed joist ends and wallplate and, if sound, treat with fungicide/preservative. Otherwise arrange to provide supplementary report on condition.

Allow for isolated joist repairs at doorway to adjacent concrete floor in Hallway.

Lift sufficient floorboards and apply insecticide to all exposed accessible surfaces of floor timbers.

Relay existing floorboards, renewing any damaged sections in pre-treated timber.

We have included a Budget Cost for damp-proofing works to these areas subject to proposals for layout, finish, etc following alteration/ refurbishment scheme. The Budget Cost includes for stripping plaster approx 1.0m high both sides of Hallway walls, chemical damp-proof course, ventilated membrane and replastering.

GENERAL NOTES

Replacement timbers will be to standard stock items, sections and mouldings, unless otherwise specified.

Our cost assessment covers only those items specifically stated in the report to be undertaken by the Specialist Contractor. All other repairs and/or ancillary works are to be the responsibility of others, under separate contract.

No allowance has been made in our cost assessment for the removal and subsequent re-instatement of any electrical, plumbing or other services unless otherwise stated.

At the time of the inspection, it was not possible to ascertain the construction of the masonry or the nature of the mortar joints. Our cost assessment is therefore based on the masonry being level, in sound condition and bonded with mortar. If, during the course of the work specified, extra work is found to be necessary due to the poor condition of the masonry you will be notified.

It will be seen our specification includes for the removal of existing plaster. In removing plaster, it is not unusual for dust to find its way to the remotest parts of the property. Whilst the Specialist Contractor will take precautions to minimise this nuisance wherever practicable within the immediate area of the works, we respectfully suggest that you should also take some precautions to protect furniture and the like elsewhere in the property. No responsibility is likely to be accepted by the Specialist Contractor for cleaning or for any damage that may be caused by dust.

Our inspection is based upon a close, but not intimate, examination of the areas specified. Inevitably, there will be concealed timbers that could not be inspected fully, or at all, without opening up. We have, as far as possible, inspected accessible exposed surfaces available to us. Our recommendations are, therefore, subject to the qualification that further necessary works may be required once the fabric of the building or a particular element is exposed, this applies particularly to dry rot. Should you require a full exploratory examination, we would be pleased to quote. If you proceed on the present basis, we shall advise you of any further infestation or fungal decay discovered during the execution of the works and advise/assess accordingly.

You should be aware that we have reported upon problems evident to us at the time of our visit, we are not commenting in any general sense on the risk of fungal decay or any other defect not evident at this time or that may develop in the future.

Where we have drawn your attention to other defects, these should be regarded as helpful suggestions and not a full complete assessment of any problems that may exist. External weathered timbers (eg, windows, fascias, etc) and outbuildings are not covered by the scope of our survey.



About Rowallan Timber and Damp Surveys

We are a local, independent company providing professional advice and remedial solutions in relation to timber and damp problems in buildings.

Our reliability, professionalism and integrity have been proven by our many repeat customers and referrers. A small selection of our testimonials can be viewed on our website www.rowallansurveys.co.uk.

We would like to thank you once again for choosing us to carry out this survey for you. Our customer's opinions and satisfaction are very important to us and we believe in offering an exceptional service. We will, for that reason, follow up with a brief online survey from a specialist customer research company and would be delighted if you could provide us with your feedback. In the meantime, if you would like to comment on any aspect of our service, please feel free to call our office or drop us an email at info@rowallansurveys.co.uk.

Cost Assessment

We advise that a competitive cost to undertake **Works by Specialist Contractor** as specified in this survey report would be:

As specified	£ 12,800
Budget Cost – damp-proofing	£ 6,500
VAT @ 20%	£ 3,860
Total	£ 23,160

Whilst we do not undertake remedial works directly, we can arrange for the works specified to be undertaken by one of our **Approved Specialist Contractors**. Although any contract will be between the customer and the Approved Specialist Contractor, you can be confident that work will be undertaken in accordance with our specification by skilled and experienced technicians complying with stringent industry standards in terms of workmanship and health and safety. Works will be carried out with the minimum of disruption and within the cost assessed by ourselves (subject to a reasonable period for acceptance and fluctuations in material costs).

Please contact ourselves should you wish work to be undertaken by an Approved Specialist Contractor and we will provide them all the necessary information for them to contact you directly and arrange mutually convenient work dates.

If works are undertaken by one of our **Approved Specialist Contractors**, upon final payment of the contract, a 10 year Guarantee will be issued offering you peace of mind by protecting your property for the future.

The surveyor who has been dealing with this property is Michael Caldow and can be contacted on telephone number 01563 529716 or mobile 07976 251978 or by e:mail at mc@rowallansurveys.co.uk.

M Caldow

Michael Caldow BSc CSRT CSSW





