

YOUR ONESURVEY
HOME REPORT

ADDRESS

The House and Flat
The Barracks
Auchenmalg,
Glenluce, Newton Stewart
DG8 0JX

PREPARED FOR

Elizabeth Martine

INSPECTION CARRIED OUT BY:



ALLIED
SURVEYORS
SCOTLAND

SELLING AGENT:

Galbraith

HOME REPORT GENERATED BY:

oneSURVEY | 
HOME REPORT

Document Index

Document	Status	Prepared By	Prepared On
Index of Documents			
<u>Single Survey</u>	Final	Castle Douglas - Allied Surveyors Scotland Plc	10/07/2023
<u>Mortgage Certificate</u>	Final	Castle Douglas - Allied Surveyors Scotland Plc	10/07/2023
<u>Property Questionnaire</u>	Final	Mrs. Elizabeth Martine	05/07/2023
<u>EPC</u>	Final	Castle Douglas - Allied Surveyors Scotland Plc	10/10/2023
Additional Documents			

Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is **essential** that you visit www.onesurvey.org (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. **Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.**

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

P A R T 1 .

SINGLE SURVEY

A report on the condition of the property, with categories being rated from 1 to 3.



Single Survey

Survey report on:

Customer	Mrs. Elizabeth Martine
-----------------	------------------------

Selling address	The House and Flat The Barracks Auchenmalg, Glenluce, Newton Stewart DG8 0JX
------------------------	--

Date of Inspection	05/07/2023
---------------------------	------------

Prepared by	John Kempself, BSc (Hons) MRICS Castle Douglas - Allied Surveyors Scotland Plc
--------------------	---

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. 2

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

² Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the “Surveyors” are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the “Surveyors” means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller’s permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor’s opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an

arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- *There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- *There are no particularly troublesome or unusual legal restrictions;
- *There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

“Re-instatement cost” is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The House - The subjects comprise a semi-detached two story dwelling, with rear two story extension and side single story extension,(with attached annex). The Flat - The subjects comprise a semi detached bungalow/annex.
Accommodation	<p>The accommodation comprises:</p> <p>The House</p> <p>Ground floor: front entrance porch, entrance hall, lounge, dining room, kitchen, inner hallway, bedroom, (with en-suite shower room), Utility/store.</p> <p>First floor: landing, three bedrooms, (master bedroom with en-suite bathroom), shower room.</p> <p>The Flat</p> <p>Ground floor: entrance vestibule, hallway, lounge, kitchen, bathroom, two bedrooms, sitting room.</p>
Gross internal floor area (m2)	The House - The gross internal floor area is approximately 212 m ² . The Flat - The gross internal floor area is approximately 104 m ² .
Neighbourhood and location	The property is located in a rural location, on an elevated site, overlooking Auchenmalg/Luce Bay, approximately 5 miles south of Glenluce, where limited local amenities are available. There is a local restaurant/bar approximately half a mile to the south, the dwelling is also nearby a local

	<p>beach. The coastal village of Port William is approximately 9 miles to the south east. More substantial facilities and amenities are available in Stranraer, approximately 14 miles to the north-west.</p>
Age	<p>The House - Original building circa 1880, rear and side extensions circa 1985. The Flat - Circa 1985.</p>
Weather	<p>Dry with sunny intervals.</p>
Chimney stacks	<p>Visually inspected with the aid of binoculars where required.</p> <p>The House.</p> <p>There are two chimney stacks, either side of the original two-storey dwelling, of brick construction, externally rendered, with concrete copings and clay chimney pots.</p> <p>The chimney stacks have lead flashings.</p> <p>The Flat.</p> <p>There is one chimney stack, of brick construction, externally rendered, with concrete coping and clay chimney pot.</p> <p>The chimney stack has lead flashings.</p>
Roofing including roof space	<p>Sloping roofs were visually inspected with the aid of binoculars where required.</p> <p>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. Flat roofs have a limited life and depending on their age and quality of workmanship can fail at any time.</p> <p>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p> <p>The House.</p> <p>The main roofs to the property are of pitched design, timber framed and tiled.</p> <p>Within the roof voids, the roof structure is of traditional timber frame construction, with timber sarking.</p> <p>The roofs have felt under the tiles.</p>

	<p>The loft voids are partially floored.</p> <p>The roofs are insulated to depth of approximately 150 mm of insulation laid between the ceiling joists.</p> <p>The Flat.</p> <p>The main roof to the property is of pitched design, timber framed and tiled.</p> <p>The roof has felt under the tiles.</p> <p>Within the roof void, the roof structure is of traditional timber frame construction, with timber sarking.</p> <p>The roof is insulated to a depth of approximately 200 mm of insulation laid between the ceiling joists.</p> <p>The loft void is partially floored.</p>
<p>Rainwater fittings</p>	<p>Visually inspected with the aid of binoculars where required.</p> <p>The rainwater fittings are pvc.</p>
<p>Main walls</p>	<p>Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected.</p> <p>The House.</p> <p>The main walls of the original dwelling are all solid stone construction 600 mm thick, externally rendered/pointed and painted and internally lined with lath and plaster/plasterboard.</p> <p>The rear two story extension and side single story extension are of traditional cavity brick/block construction, 300 mm thick, externally rendered and internally plastered on the hard.</p> <p>The Flat.</p> <p>The main walls are of traditional cavity brick/block construction, 300 mm thick, externally rendered and internally plastered on the hard.</p>
<p>Windows, external</p>	<p>Internal and external doors were opened and closed where</p>

<p>doors and joinery</p>	<p>keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open.</p> <p>The House.</p> <p>Windows are predominantly pvc framed, double glazed, pivot, casement, top hopper and tilt and turn style.</p> <p>There are pvc framed, double glazed, patio doors off from the ground floor dining room.</p> <p>The ground floor side lounge windows, (adjacent to the fireplace), have timber framed, single glazed, pivot style windows.</p> <p>The Flat.</p> <p>Windows are pvc framed, double glazed, tilt and turn style.</p> <p>There are pvc framed, double glazed, patio doors all from the sitting room, (former garage).</p> <p>The external front door is timber.</p>
<p>External decorations</p>	<p>Visually inspected.</p> <p>The external elevations are painted.</p> <p>Fascias are pvc lined.</p>
<p>Conservatories / porches</p>	<p>Visually inspected.</p> <p>The House.</p> <p>There is a front entrance porch.</p> <p>Construction comprises: concrete tiled floor, brick-base walls, timber framed single glazed windows and door, with timber framed double pitched, tiled roof.</p> <p>The Flat.</p> <p>None.</p>
<p>Communal areas</p>	<p>Circulation areas visually inspected.</p> <p>There are no communal use areas in the dwellings.</p>

<p>Garages and permanent outbuildings</p>	<p>Visually inspected.</p> <p>There is a detached covered swimming pool to the rear of the dwelling, which has fell into disrepair and is dilapidated.</p> <p>There is no garage, although adequate turning/parking area to the front of the dwellings.</p> <p>There is a timber summerhouse and workshop to the front of the dwellings.</p>
<p>Outside areas and boundaries</p>	<p>Visually inspected.</p> <p>The dwelling occupies a good sized elevated plot, extending to approximately 0.86 of an acre.</p> <p>The grounds are predominantly laid in grass, with a tarmac seating area to the side, off from the patio doors at the dining room and planted borders/shrubs.</p> <p>There are also mature trees to the rear.</p> <p>Boundaries are defined by drystone walls and post and wire fences.</p>
<p>Ceilings</p>	<p>Visually inspected from floor level.</p> <p>Ceilings are of lath and plaster/plasterboard construction.</p>
<p>Internal walls</p>	<p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p> <p>Internal walls are lined with lath and plaster/plasterboard and brick/block, plastered on the hard.</p>
<p>Floors including sub floors</p>	<p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p> <p>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</p> <p>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</p> <p>Floors are of suspended timber/solid concrete.</p>

<p>Internal joinery and kitchen fittings</p>	<p>Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances.</p> <p>The House.</p> <p>Skirtings and architraves are of softwood timber, which have been painted.</p> <p>Internal doors are timber panelled and timber framed with glazed panels.</p> <p>Kitchen fittings comprise fitted oak timber, base and wall units, with fitted worktops and stainless steel sink unit.</p> <p>The Flat.</p> <p>Skirtings and architraves are of softwood timber, which have been painted.</p> <p>Internal doors are timber flush panel/veneer and timber framed with glazed panels.</p> <p>Kitchen fittings comprise slatted base and wall units, with fitted worktops and stainless steel sink unit.</p>
<p>Chimney breasts and fireplaces</p>	<p>Visually inspected. No testing of the flues or fittings was carried out.</p> <p>The House.</p> <p>There is a fireplace on the ground floor lounge, with stone fireplace surround and hearth and solid fuel fire in a grate.</p> <p>There is also a stone fireplace and hearth in the dining room. This is a feature only and is not a useable fire.</p> <p>The Flat.</p> <p>There is a fireplace in the lounge, with facing brick fireplace surround and tiled hearth.</p> <p>The fireplace has a solid fuel fire, with grate.</p>
<p>Internal decorations</p>	<p>Visually inspected.</p> <p>Internal walls are wallpapered, plastered and painted and tiled.</p>


	Ceilings are plastered and painted.
Cellars	<p>Visually inspected where there was safe and purpose-built access.</p> <p>There are no cellars.</p>
Electricity	<p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</p> <p>The House.</p> <p>Mains electricity is connected. The electric smart meter and consumer units, which are fitted with circuit breakers, are located in a cupboard at higher level in the first floor hallway.</p> <p>There are also electric meters and consumer units, which are fitted with circuit breakers and fuses, located in a cupboard in the ground floor hallway.</p> <p>Wiring, where visible, is pvc sheathed and insulated and there are 13 amp square pin sockets.</p> <p>The Flat.</p> <p>Mains electricity is connected. The electric meters and consumer units, which are fitted with circuit breakers and fuses, are located in a cupboard in the ground floor hallway.</p> <p>Mains water is connected. Water pipes, where visible, are copper and pvc.</p>
Gas	<p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</p> <p>No mains gas is available.</p>
Water, plumbing and bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.

	<p>No tests whatsoever were carried out to the system or appliances.</p> <p>The House.</p> <p>Mains water is connected. Water pipes, where visible, are copper and pvc.</p> <p>There is a pvc cold water tank with lid, located in the loft void, above the front first floor bedroom.</p> <p>Sanitary fitments comprise:</p> <p>Ground floor en-suite: wc, wash hand basin with pedestal, shower cubicle with electric shower.</p> <p>First floor bathroom: wc, wash hand basin with pedestal, bath.</p> <p>First floor shower room: wc, wash hand basin with pedestal, shower cubicle with an electric shower.</p> <p>First floor en-suite bathroom: wc, wash hand basin with pedestal, corner bath.</p> <p>The Flat.</p> <p>An external tap is located at the rear elevation.</p> <p>Bathroom sanitary fitments comprise: wc, wash hand basin with pedestal, bath, electric shower over the bath.</p> <p>Sanitary fitments are in a white suite.</p>
<p>Heating and hot water</p>	<p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances.</p> <p>The House.</p> <p>The dwelling has electric night storage and panel heaters.</p> <p>The hot water is provided by an electric immersion heater, fitted to a hot water cylinder, which is located in the loft void.</p> <p>The Flat.</p> <p>The dwelling has electric night storage heaters.</p>

	<p>There is a back boiler behind the solid fuel fire, which supplies heat to radiators, in the sitting room/lounge, corridor and both bedrooms.</p> <p>The hot water is provided by an electric immersion heater, fitted to a hot water cylinder, which is located in the loft void.</p>
Drainage	<p>Drainage covers etc were not lifted. Neither drains nor drainage systems were tested.</p> <p>Drainage is connected to a private septic tank.</p>
Fire, smoke and burglar alarms	<p>Visually inspected. No tests whatsoever were carried out to the system or appliances.</p> <p>The new Fire and Smoke Alarm Standard came in to force in February 2022. This new standard requires a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also needs to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon-fuelled appliance such as a boiler, open fire or wood burner a carbon monoxide detector is also required. The purchaser should satisfy themselves in this regard.</p> <p>None.</p>
Any additional limits to inspection	<p>An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.</p> <p>Asbestos based materials were commonly used in the construction industry up until the year 2000. There is therefore the opportunity for asbestos based materials to be part of any residential property built prior to that date.</p> <p>Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.</p> <p>The property was occupied, fully furnished and all floors not</p>

	<p>covered. Floor coverings restricted my inspection of flooring.</p> <p>Personal effects in cupboards and fitted wardrobes were not moved and restricted my inspection.</p>
--	--

Sectional Diagram showing elements of a typical house

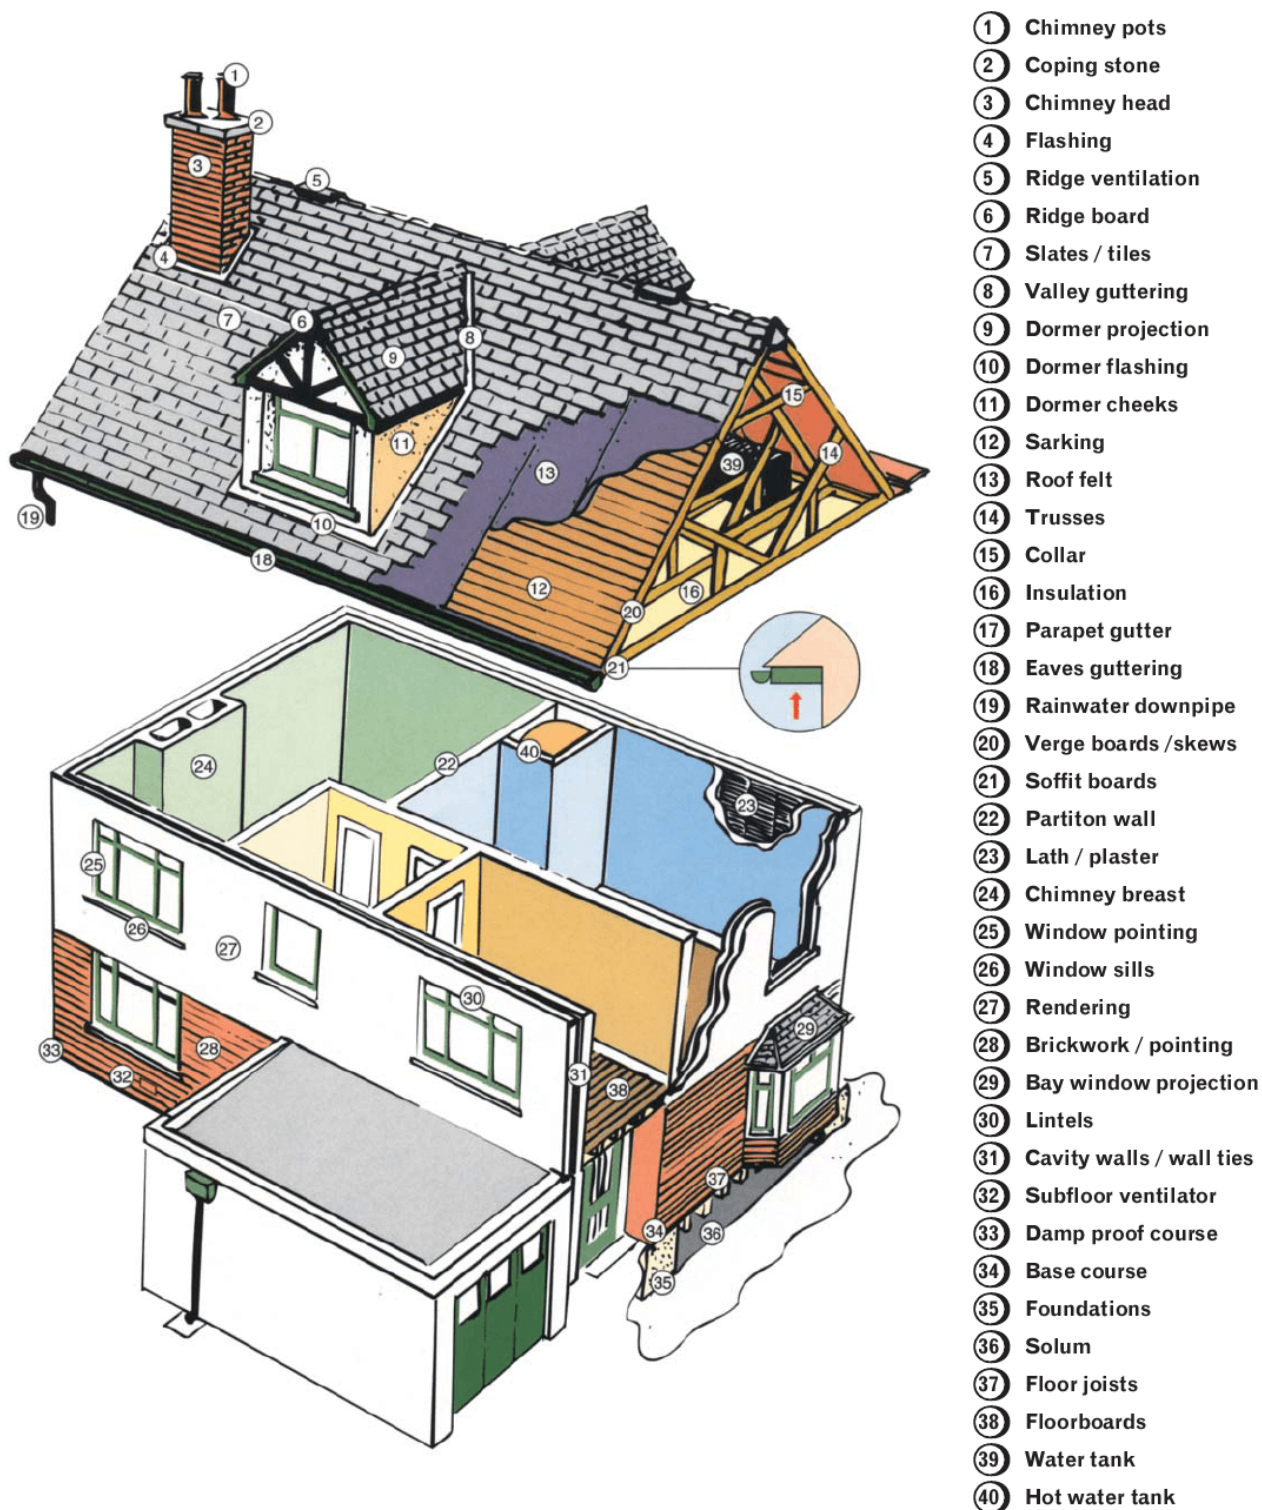


- ① Chimney pots
- ② Coping stone
- ③ Chimney head
- ④ Flashing
- ⑤ Ridge ventilation
- ⑥ Ridge board
- ⑦ Slates / tiles
- ⑧ Valley guttering
- ⑨ Dormer projection
- ⑩ Dormer flashing
- ⑪ Dormer cheeks
- ⑫ Sarking
- ⑬ Roof felt
- ⑭ Trusses
- ⑮ Collar
- ⑯ Insulation
- ⑰ Parapet gutter
- ⑱ Eaves guttering
- ⑲ Rainwater downpipe
- ⑳ Verge boards /skews
- ㉑ Soffit boards
- ㉒ Partiton wall
- ㉓ Lath / plaster
- ㉔ Chimney breast
- ㉕ Window pointing
- ㉖ Window sills
- ㉗ Rendering
- ㉘ Brickwork / pointing
- ㉙ Bay window projection
- ㉚ Lintels
- ㉛ Cavity walls / wall ties
- ㉜ Subfloor ventilator
- ㉝ Damp proof course
- ㉞ Base course
- ㉟ Foundations
- ㊱ Solum
- ㊲ Floor joists
- ㊳ Floorboards
- ㊴ Water tank
- ㊵ Hot water tank


Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.


2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category:	
Notes:	No obvious evidence of significant movement noted within the limitations of my inspection.

Dampness, rot and infestation	
Repair category:	
Notes:	The ceiling of the lounge in the flat has partially collapsed, due to a leak at the hot water cylinder above. The cylinder requires to be repaired/replaced and the plasterboard lining of the ceiling and insulation above reinstated.

Chimney stacks	
Repair category:	
Notes:	The House. Hairline cracks were noted at the external render of the chimney stacks. The Flat. No significant defects evident.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Roofing including roof space	
Repair category:	2
Notes:	<p>There are valley gutters. These can be problematic and maintenance should be undertaken regularly.</p> <p>Concrete tiles are typically guaranteed for 30 years but have a reasonable life expectation around 50/60 years according to the BRE. Life expectancy will often depend on weathering and damage from the prevailing weather. You should instruct a reputable roofing contractor to advise on life expectancy and repair/replacement costs.</p>

Rainwater fittings	
Repair category:	2
Notes:	<p>Vegetation/debris was noted at rainwater gullies and valley gutters at first floor level.</p> <p>These should be cleaned out and maintained during routine maintenance.</p>

Main walls	
Repair category:	2
Notes:	<p>The rendering of the outer walls has cracked/spalled in areas at various elevations. A competent local plasterer should be employed to inspect, and carry out necessary repairs.</p>

Windows, external doors and joinery

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.


Repair category:	2
Notes:	<p>The window units are of an older type. The seals to older double glazed units often fail resulting in condensation between the panes of glass.</p> <p>The House.</p> <p>There is a missing handle at the top hopper of the window in the first floor master bedroom.</p>


External decorations	
Repair category:	2
Notes:	Outside external paintwork has deteriorated and redecoration is now required.


Conservatories / porches	
Repair category:	2
Notes:	<p>The House.</p> <p>The front entrance porch is of a basic construction. Regular maintenance will be required.</p>


Communal areas	
Repair category:	
Notes:	N/A.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Garages and permanent outbuildings	
Repair category:	
Notes:	The rear swimming pool building and pool are dilapidated and require a major overhaul, if they are to be brought back to use. Repair of this may be beyond economical repair.

Outside areas and boundaries	
Repair category:	
Notes:	Garden grounds and boundaries will require regular ongoing maintenance.

Ceilings	
Repair category:	
Notes:	The ceiling of the lounge in the flat has partially collapsed, due to a leak at the hot water cylinder above. The plasterboard lining of the ceiling and insulation above requires to be repaired/reinstated. There is plaster cracking to various ceilings.

Internal walls	
Repair category:	
	No significant defects evident.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Notes:	
--------	--

Floors including sub-floors	
Repair category:	1
Notes:	No significant defects evident.

Internal joinery and kitchen fittings	
Repair category:	1
Notes:	No significant defects evident. Glazed inserts to internal doors may not be of appropriate toughened glass.

Chimney breasts and fireplaces	
Repair category:	1
Notes:	Flues should ideally be swept and tested on an annual basis.

Internal decorations	
Repair category:	2
Notes:	Decorative finishes are worn and marked. Redecoration is required.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.


Cellars	
Repair category:	
Notes:	N/A.


Electricity	
Repair category:	2
Notes:	<p>It is recommended that all electrical installations be changed every five years or on change of ownership to keep up-to-date with frequent changes in safety regulations. Further advice will be available from a qualified NICEIC/SELECT registered contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully complies with IEE regulations.</p> <p>There is no evidence of recent testing of the electrical system. A competent electrical contractor should be instructed to test the system and carry out any necessary repairs/upgrading.</p> <p>The electrical installation is dated with fuses at the consumer units.</p>


Gas	
Repair category:	
Notes:	N/A.

Water, plumbing and bathroom fittings	
Repair category:	

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

	
Notes:	Sanitary fittings are dated, although functional.

Heating and hot water	
Repair category:	
Notes:	<p>The House.</p> <p>The hot water system is of an older style. A plumbing contractor can advise further.</p> <p>The Flat.</p> <p>The hot water system is of an older style. A plumbing contractor can advise further.</p> <p>The back boiler is of an older style.</p>

Drainage	
Repair category:	
Notes:	The owner has not been able to provide any information about the septic tank maintenance and it is assumed that the tank is registered with SEPA. Regular inspection and maintenance should be anticipated.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information

Structural movement	1
Dampness, rot and infestation	3
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	2
External decorations	2
Conservatories / porches	2
Communal areas	
Garages and permanent outbuildings	2
Outside areas and boundaries	1
Ceilings	3
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	2
Cellars	
Electricity	2
Gas	
Water, plumbing and bathroom fittings	2
Heating and hot water	2
Drainage	1

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	Ground Floor and First Floor.
2. Are there three steps or fewer to a main entrance door of the property?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
3. Is there a lift to the main entrance door of the property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
4. Are all door openings greater than 750mm?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
5. Is there a toilet on the same level as the living room and kitchen?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
6. Is there a toilet on the same level as a bedroom?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
7. Are all rooms on the same level with no internal steps or stairs?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer	
<p>Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.</p> <p>The property has been altered and extended, in excess of 20 years ago. It is assumed that all necessary local authority and other consents have been obtained for alterations and the appropriate documentation, including building warrants and completion certificates issued.</p> <p>Drainage is to a septic tank. It is assumed that the tank is registered with SEPA. The position regarding age, location, condition and maintenance history should be clarified.</p> <p>Access to the property is by an unmade shared road. The completing conveyancer should verify rights of access and liability in respect of future maintenance.</p> <p>The House &The Flat</p> <p>The estimated reinstatement cost is £810,000. It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by building cost information service (BCIS).</p> <p>The market value of the property as described in this report is £380,000.</p> <p>This figure assumes vacant possession and that the property is unaffected by any adverse planning permissions, onerous burdens, title restrictions or servitude rights.</p>	
Estimated re-instatement cost (£) for insurance purposes	
<p>The House & The Flat - £810,000. Eight Hundred and Ten Thousand Pounds.</p>	
Valuation (£) and market comments	
<p>The House & The Flat - £380,000. Three Hundred and Eighty Thousand Pounds.</p>	
Report author:	John Kempself, BSc (Hons) MRICS

Company name:	Castle Douglas - Allied Surveyors Scotland Plc
Address:	35 Buccleuch Street Dumfries DG1 2AB
Signed:	Electronically Signed: 236378-4E64BF6A-717B
Date of report:	10/07/2023

P A R T 2 .

MORTGAGE VALUATION REPORT

Includes a market valuation of the property.





Mortgage Valuation Report

Property:	The House and Flat The Barracks Auchenmalg, Glenluce, Newton Stewart DG8 0JX	Client: Mrs. Elizabeth Martine Tenure: Absolute Ownership.
Date of Inspection:	05/07/2023	Reference: JK/02/23/83.

This report has been prepared as part of your instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising your lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation – Global Standards 2017 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of the reports contents. Neither the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor.

1.0 LOCATION

The property is located in a rural location, on an elevated site, overlooking Auchenmalg/Luce Bay, approximately 5 miles south of Glenluce, where limited local amenities are available. There is a local restaurant/bar approximately half a mile to the south, the dwelling is also nearby a local beach. The coastal village of Port William is approximately 9 miles to the south east. More substantial facilities and amenities are available in Stranraer, approximately 14 miles to the north-west.

2.0 DESCRIPTION

2.1 Age:

The House - Original building circa 1880, rear and side extensions circa 1985.
The Flat - Circa 1985.

The House.

The subjects comprise a semi-detached two story dwelling, with rear two story extension and side single story extension,(with attached annex).

The Flat.

The subjects comprise a semi detached bungalow/annex.

3.0 CONSTRUCTION

The House.

Roof: Pitched and Tiled.

Main Walls: Solid Stone/Cavity Brick/Block.

Floors: Suspended Timber/Solid Concrete.

The Flat.

Roof: Pitched and Slated.

Main Walls: Cavity Brick/Block.

Floors: Suspended Timber/Solid Concrete.

4.0 ACCOMMODATION

The House.

The accommodation comprises:

Ground floor: front entrance porch, entrance hall, lounge, dining room, kitchen, inner hallway, bedroom, (with en-suite shower room), Utility/store.

First floor: landing, three bedrooms, (master bedroom with en-suite bathroom), shower room.

The Flat.

The accommodation comprises:

Ground floor: entrance vestibule, hallway, lounge, kitchen, bathroom, two bedrooms, sitting room.

5.0 SERVICES (No tests have been applied to any of the services)

Water:	Mains.	Electricity:	Mains.	Gas:	None.	Drainage:	To Private Septic tank.
---------------	--------	---------------------	--------	-------------	-------	------------------	-------------------------

Central Heating: The House - Electric Night Storage and Panel Heaters. The Flat - Electric Night Storage and Panel Heaters., (back boiler heats radiators in the sitting room/lounge, corridor and both bedrooms).

6.0 OUTBUILDINGS

Garage: None, although parking/turning space.

Others: Detached covered swimming pool building, (dilapidated), timber summerhouse and timber workshop in the front garden.

7.0 GENERAL CONDITION - *A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.*

The properties are of traditional construction and materials and requires some works of repair, maintenance and refurbishment. They form suitable security for mortgage purposes.

8.0 ESSENTIAL REPAIR WORK (as a condition of any mortgage or, to preserve the condition of the property)

The Flat.

The ceiling of the lounge in the flat has partially collapsed, due to a leak at the hot water cylinder above.

The cylinder requires to be repaired/replaced and the plasterboard lining of the ceiling and insulation above reinstated.

8.1 Retention recommended: £2000.

9.0 ROADS & FOOTPATHS

Access to the property is by an unmade shared road. The completing conveyancer should verify rights of access and liability in respect of future maintenance.

10.0	BUILDINGS INSURANCE (£):	The House & The Flat - £810,000.	GROSS EXTERNAL FLOOR AREA	The House - Approximately 258 m ² . The Flat - Approximately 118 m ² .	Square metres
------	--------------------------	----------------------------------	---------------------------	--	---------------

This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.

11.0 GENERAL REMARKS

Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.

The House & Flat.

The property has been altered and extended, in excess of 20 years ago. It is assumed that all necessary local authority and other consents have been obtained for alterations and the appropriate documentation, including building warrants and completion certificates issued.

Drainage is to a septic tank. It is assumed that the tank is registered with SEPA. The position regarding age, location, condition and maintenance history should be clarified.

Access to the property is by an unmade shared road. The completing conveyancer should verify rights of access and liability in respect of future maintenance.

The estimated reinstatement cost is £810,000. It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by building cost information service (BCIS).

The market value of the property as described in this report is £380,000.

This figure assumes vacant possession and that the property is unaffected by any adverse planning permissions, onerous burdens, title restrictions or servitude rights.

The properties are located in a rural location, on an elevated site, overlooking Auchenmalg/Luce Bay, and benefit from panoramic views to the front.

Works of repair and maintenance are required, although the properties offer good sized accommodation, close to local beaches and just a short drive to local amenities.

12.0 VALUATION *On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests.*

12.1	Market Value in present condition (£):	The House & The Flat - £380,000.	Three Hundred and Eighty Thousand Pounds.	
12.2	Market Value on completion of essential works (£):	The House & The Flat - £382,000.	Three Hundred and Eighty Two Thousand Pounds.	
12.3	Suitable security for normal mortgage purposes?	Yes		
12.4	Date of Valuation:	10/07/2023		
Signature:		Electronically Signed: 236378-4E64BF6A-717B		
Surveyor:	John Kempzell	BSc (Hons) MRICS	Date:	10/07/2023
Castle Douglas - Allied Surveyors Scotland Plc				
Office:	35 Buccleuch Street Dumfries DG1 2AB		Tel: 01387 254 425 Fax: email: castle.douglas@alliedsurveyorsscotland.com	

P A R T 3 .

ENERGY REPORT

A report on the energy efficiency of the property.



energy report

energy report on:

Property address	The House and Flat The Barracks Auchenmalg, Glenluce, Newton Stewart DG8 0JX
-------------------------	--

Customer	Mrs. Elizabeth Martine
-----------------	------------------------

Customer address	The House and Flat The Barracks Auchenmalg, Glenluce, Newton Stewart DG8 0JX
-------------------------	--

Prepared by	John Kempzell, BSc (Hons) MRICS Castle Douglas - Allied Surveyors Scotland Plc
--------------------	---

The House, The Barracks, Auchenalg, DG8 0JX


Dwelling type:	Semi-detached house	Reference number:	6817-5823-4630-2015-2202
Date of assessment:	05 July 2023	Type of assessment:	RdSAP, existing dwelling
Date of certificate:	10 October 2023	Approved Organisation:	Elmhurst
Total floor area:	207 m ²	Main heating and fuel:	Electric storage heaters
Primary Energy Indicator:	581 kWh/m ² /year		

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£18,438	See your recommendations report for more information
Over 3 years you could save*	£8,502	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

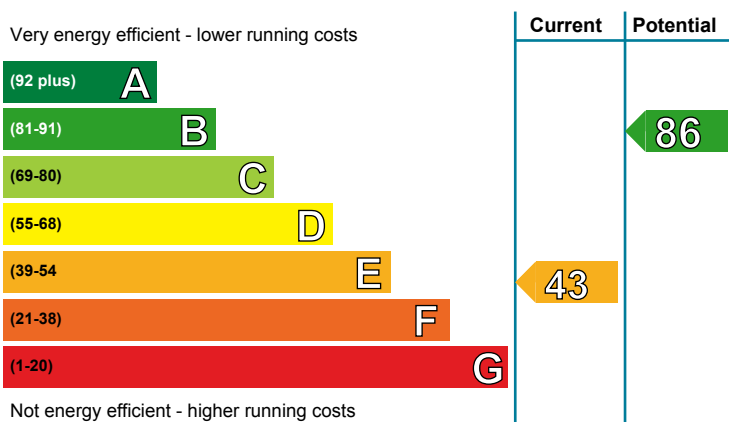


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band E (43)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

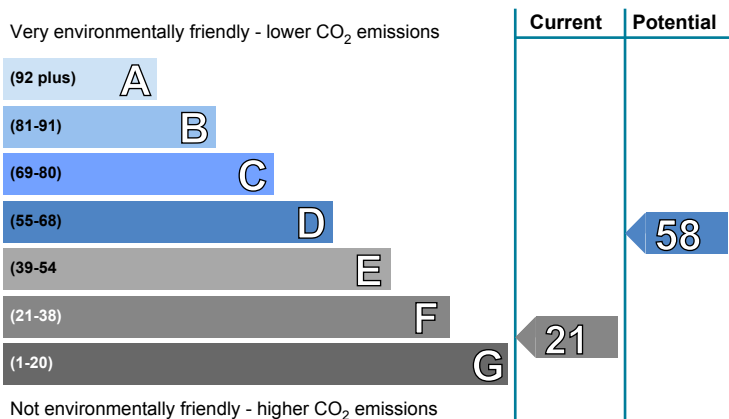

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band F (21)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal or external wall insulation	£4,000 - £14,000	£2454.00
2 Floor insulation (suspended floor)	£800 - £1,200	£1629.00
3 Low energy lighting	£105	£486.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Granite or whinstone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Cavity wall, as built, insulated (assumed)	★★★★☆	★★★★☆
Roof	Pitched, 150 mm loft insulation	★★★★☆	★★★★☆
	Pitched, 200 mm loft insulation	★★★★☆	★★★★☆
Floor	Suspended, no insulation (assumed)	—	—
Windows	Fully double glazed	★★★★☆	★★★★☆
Main heating	Electric storage heaters	★★★★☆	★☆☆☆☆
Main heating controls	Manual charge control	★★☆☆☆	★★☆☆☆
Secondary heating	Room heaters, dual fuel (mineral and wood)	—	—
Hot water	Electric immersion, off-peak	★★★★☆	★★☆☆☆
Lighting	Low energy lighting in 30% of fixed outlets	★★★★☆	★★★★☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 102 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 21 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 12.0 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.




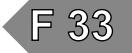

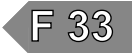








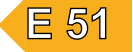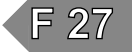

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£15,645 over 3 years	£8,334 over 3 years	
Hot water	£1,338 over 3 years	£744 over 3 years	
Lighting	£1,455 over 3 years	£858 over 3 years	
Totals	£18,438	£9,936	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Internal or external wall insulation	£4,000 - £14,000	£818		
2 Floor insulation (suspended floor)	£800 - £1,200	£543		
3 Low energy lighting for all fixed outlets	£105	£162		
4 High heat retention storage heaters	£2,400 - £3,600	£925		
5 Solar water heating	£4,000 - £6,000	£183		
6 Replacement glazing units	£1,000 - £1,400	£205		
7 Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£715		
8 Wind turbine	£15,000 - £25,000	£1540		

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Biomass boiler (Exempted Appliance if in Smoke Control Area)
- Air or ground source heat pump

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

3 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (<http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting>).

4 High heat retention storage heaters

Modern storage heaters have better insulation and are easier to control than the older type in this property. Ask for a quotation for new, high heat retention heaters with automatic charge and output controls. Installations should be in accordance with the current regulations covering electrical wiring. Ask the heating engineer to explain the options, which might also include switching to other forms of electric heating.

5 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

6 Replacement glazing units

Replacing existing double-glazed units with new high-performance units. Building regulations require that replacement glazing is to a standard no worse than previous; a building warrant is not required. Planning permission might be required for such work if a building is listed or within a conservation area so it is best to check with your local authority.

7 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

8 Wind turbine

A wind turbine provides electricity from wind energy. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Wind turbines are not suitable for all properties. The system's effectiveness depends on local wind speeds and the presence of nearby obstructions, and a site survey should be undertaken by an accredited installer. Planning permission might be required and building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for a wind turbine, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	35,500	(308)	N/A	(5,579)
Water heating (kWh per year)	2,345			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. John Kempzell
Assessor membership number:	EES/018212
Company name/trading name:	Allied Surveyors Scotland Plc
Address:	35 Buccleuch Street Dumfries DG1 2AB
Phone number:	01387 254 424
Email address:	dumfries@alliedsurveyorsscotland.com
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



P A R T 4 .

PROPERTY QUESTIONNAIRE

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.



Property Questionnaire

Property Address

The House and Flat
The Barracks
Glenluce, Newton Stewart
DG8 0JX

Seller(s)

Elizabeth Martine

Completion date of property questionnaire

05/07/2023

Note for sellers

1.	Length of ownership
	How long have you owned the property? 53 years
2.	Council tax
	Which Council Tax band is your property in? (Please circle) []A []B []C []D []E []F [x]G []H
3.	Parking
	What are the arrangements for parking at your property? (Please tick all that apply)
	Garage [x]
	Allocated parking space []
	Driveway [x]
	Shared parking []
	On street []
	Resident permit []
	Metered parking []
	Other (please specify):

4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	[]YES []NO [x]Don't know
5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	[]YES [x]NO
6.	Alterations/additions/extensions	
a	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	[x]YES []NO
	If you have answered yes, please describe below the changes which you have made: <i>Bought as a ruin, The Barracks was restored as a two bedroom house with an internal garage. An extension was added to the two story part of the house to add a large drawing room downstairs and bedroom and bathroom, upstairs. External covered swimming pool installed at the back of the house. The integrated garage then converted into bathroom with ensuite and 2 bed single story granny flat attached to single storey side of the property to include another integrated garage. Porch built at front door of main house. 2ns integrated garage then converted in to further bedroom.</i>	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	[x]YES []NO
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them: <i>These documents will be somewhere at The Barracks.</i>	
b	Have you had replacement windows, doors, patio doors or double glazing installed in your property	[x]YES []NO
	If you have answered yes, please answer the three questions below:	

	(i) Were the replacements the same shape and type as the ones you replaced?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
	(ii) Did this work involve any changes to the window or door openings?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed): <i>Single glazed windows replaced with double glazing at various intervals during the ownership of the property. Internal garage doors (two) have been changed - one bricked up and window created, other replaced with patio doors.</i> Please give any guarantees which you received for this work to your solicitor or estate agent.	
7.	Central heating	
a	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Partial
	If you have answered yes or partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).	
	If you have answered yes, please answer the three questions below:	
	(i) When was your central heating system or partial central heating system installed?	
	(ii) Do you have a maintenance contract for the central heating system?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, please give details of the company with which you have a maintenance contract	
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
9.	Issues that may have affected your property	
	Has there been any storm, flood, fire or other structural	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

a	damage to your property while you have owned it?																									
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	[]YES [x]NO																								
b	Are you aware of the existence of asbestos in your property?	[]YES [x]NO []Don't know																								
	If you have answered yes, please give details:																									
10.	Services																									
a	Please tick which services are connected to your property and give details of the supplier:																									
	<table border="1"> <thead> <tr> <th>Services</th> <th>Connected</th> <th>Supplier</th> </tr> </thead> <tbody> <tr> <td>Gas or liquid petroleum gas</td> <td>N</td> <td></td> </tr> <tr> <td>Water mains or private water supply</td> <td>Y</td> <td>I have no idea!</td> </tr> <tr> <td>Electricity</td> <td>Y</td> <td>House E.on Next, Flat EDF</td> </tr> <tr> <td>Mains drainage</td> <td>N</td> <td></td> </tr> <tr> <td>Telephone</td> <td>Y</td> <td>Utility Warehouse</td> </tr> <tr> <td>Cable TV or satellite</td> <td>N</td> <td></td> </tr> <tr> <td>Broadband</td> <td>Y</td> <td>Utility Warehouse</td> </tr> </tbody> </table>	Services	Connected	Supplier	Gas or liquid petroleum gas	N		Water mains or private water supply	Y	I have no idea!	Electricity	Y	House E.on Next, Flat EDF	Mains drainage	N		Telephone	Y	Utility Warehouse	Cable TV or satellite	N		Broadband	Y	Utility Warehouse	
Services	Connected	Supplier																								
Gas or liquid petroleum gas	N																									
Water mains or private water supply	Y	I have no idea!																								
Electricity	Y	House E.on Next, Flat EDF																								
Mains drainage	N																									
Telephone	Y	Utility Warehouse																								
Cable TV or satellite	N																									
Broadband	Y	Utility Warehouse																								
b	Is there a septic tank system at your property?	[x]YES []NO																								
	If you have answered yes, please answer the two questions below:																									
	(i) Do you have appropriate consents for the discharge from your septic tank?	[]YES []NO [x]Don't know																								
	(ii) Do you have a maintenance contract for your septic tank?	[]YES [x]NO																								
	If you have answered yes, please give details of the company with which you have a maintenance contract:																									
11.	Responsibilities for shared or common areas																									
a	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details:	[x]YES []NO []Don't know																								

	<i>We have right of access over a dirt track road to the house.</i>	
b	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:	[]YES []NO [x]N/A
c	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	[]YES [x]NO
d	Do you have the right to walk over any of your neighbours' property- for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details: <i>Right of access over the access drive with bins left at road end. In the title deeds we also have right of access to a spring well in the field at the back of the house (this has never been exercised.)</i>	[x]YES []NO
e	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:	[]YES [x]NO
f	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.) If you have answered yes, please give details:	[]YES [x]NO
12.	Charges associated with your property	
a	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	[]YES [x]NO
b	Is there a common buildings insurance policy?	[]YES [x]NO []Don't know
	If you have answered yes, is the cost of the insurance included in your monthly/annual factors charges?	
c	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund. <i>Not applicable.</i>	
13.	Specialist works	
a	As far as you are aware, has treatment of dry rot, wet rot,	[]YES [x]NO

	damp or any other specialist work ever been carried out to your property?	
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	
b	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	[]YES [x]NO
	If you have answered yes, please give details:	
c	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	[]YES []NO
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	

14.	Guarantees	
a	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	[]NO []YES [x]Don't know []With title deeds []Lost
(ii)	Roofing	[]NO []YES [x]Don't know []With title deeds []Lost
(iii)	Central heating	[]NO []YES [x]Don't know []With title deeds []Lost
(iv)	National House Building Council(NHBC)	[]NO []YES [x]Don't know []With title deeds []Lost
(v)	Damp course	[]NO []YES [x]Don't know []With title deeds []Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	[]NO []YES [x]Don't know []With title deeds []Lost
b	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):	
c	Are there any outstanding claims under any of the	[]YES [x]NO

	guarantees listed above?	
	If you have answered yes, please give details:	

15.	Boundaries	
	So far as you are aware, has any boundary of your property been moved in the last 10 years?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
	If you have answered yes, please give details:	
16.	Notices that affect your property	
In the past three years have you ever received a notice:		
a	advising that the owner of a neighbouring property has made a planning application?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
b	that affects your property in some other way?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
c	that requires you to do any maintenance, repairs or improvements to your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s) I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.	
Signature(s):	Elizabeth Martine
Capacity:	<input checked="" type="checkbox"/> Owner <input type="checkbox"/> Legally Appointed Agent for Owner
Date:	05/07/2023

THE FLAT, THE BARRACKS, GLENLUCE, NEWTON STEWART, DG8 0JX


Dwelling type:	Semi-detached bungalow	Reference number:	0058-1062-8233-9487-7220
Date of assessment:	05 July 2023	Type of assessment:	RdSAP, existing dwelling
Date of certificate:	04 October 2023	Approved Organisation:	Elmhurst
Total floor area:	104 m ²	Main heating and fuel:	Electric storage heaters
Primary Energy Indicator:	617 kWh/m ² /year		

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£9,789	See your recommendations report for more information
Over 3 years you could save*	£3,615	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

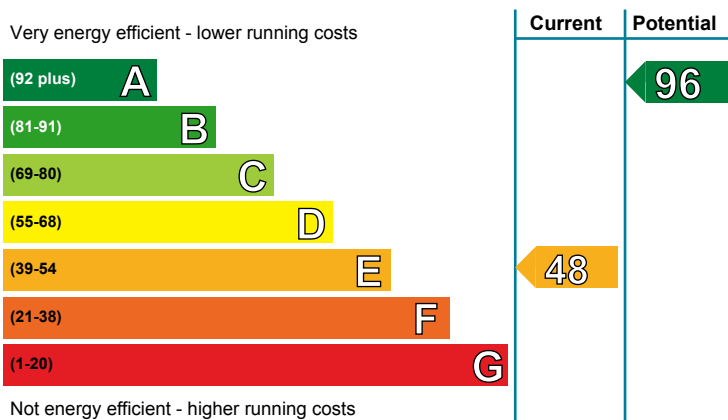


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band E (48)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

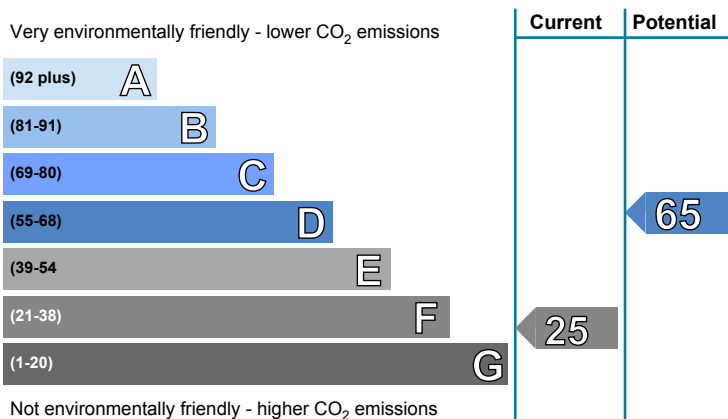

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band F (25)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Floor insulation (suspended floor)	£800 - £1,200	£1182.00
2 Floor insulation (solid floor)	£4,000 - £6,000	£309.00
3 High heat retention storage heaters	£1,600 - £2,400	£1593.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, as built, insulated (assumed)	★★★★☆	★★★★☆
Roof	Pitched, 200 mm loft insulation	★★★★☆	★★★★☆
Floor	Suspended, no insulation (assumed) Solid, no insulation (assumed)	— —	— —
Windows	Fully double glazed	★★★☆☆	★★★☆☆
Main heating	Electric storage heaters	★★★☆☆	★☆☆☆☆
Main heating controls	Manual charge control	★★☆☆☆	★★☆☆☆
Secondary heating	Room heaters, dual fuel (mineral and wood)	—	—
Hot water	Electric immersion, off-peak	★★★☆☆	★★☆☆☆
Lighting	Low energy lighting in all fixed outlets	★★★★★	★★★★★

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 109 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 11 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 6.6 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.


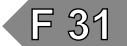

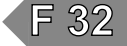





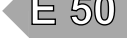


Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£7,953 over 3 years	£4,908 over 3 years	
Hot water	£1,260 over 3 years	£690 over 3 years	
Lighting	£576 over 3 years	£576 over 3 years	
Totals	£9,789	£6,174	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Floor insulation (suspended floor)	£800 - £1,200	£394		
2 Floor insulation (solid floor)	£4,000 - £6,000	£103		
3 High heat retention storage heaters	£1,600 - £2,400	£531		
4 Solar water heating	£4,000 - £6,000	£176		
5 Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£715		
6 Wind turbine	£15,000 - £25,000	£1540		

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Biomass boiler (Exempted Appliance if in Smoke Control Area)
- Air or ground source heat pump

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

2 Floor insulation (solid floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulating solid floors can present challenges; insulation laid on top of existing solid floors may impact on existing doors and finishes whilst lifting of a solid floor to insert insulation below will require consideration of the potential effect on both structural stability and damp proofing. It is advised to seek advice from a Chartered Structural Engineer or a registered Architect about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work and may also require a building warrant so it is best to check with your local authority building standards department.

3 High heat retention storage heaters

Modern storage heaters have better insulation and are easier to control than the older type in this property. Ask for a quotation for new, high heat retention heaters with automatic charge and output controls. Installations should be in accordance with the current regulations covering electrical wiring. Ask the heating engineer to explain the options, which might also include switching to other forms of electric heating.

4 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

5 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

6 Wind turbine

A wind turbine provides electricity from wind energy. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Wind turbines are not suitable for all properties. The system's effectiveness depends on local wind speeds and the presence of nearby obstructions, and a site survey should be undertaken by an accredited installer. Planning permission might be required and building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for a wind turbine, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	18,044	N/A	N/A	N/A
Water heating (kWh per year)	2,251			

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. John Kempzell
Assessor membership number:	EES/018212
Company name/trading name:	Allied Surveyors Scotland Plc
Address:	35 Buccleuch Street Dumfries DG1 2AB
Phone number:	01387 254 424
Email address:	dumfries@alliedsurveyorsscotland.com
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT

