

Home Report

One triangle, all angles covered

RESIDENTIAL / COMMERCIAL / PROPERTY & CONSTRUCTION



Contents

- 1. Single Survey
- 2. Energy Performance Certificate







Scottish Single Survey



survey report on:

Whistlebrae Steading Banchory Devenick ABERDEEN AB12 5YJ
Sally McAllan
Whistlebrae Steading Banchory Devenick ABERDEEN AB12 5YJ
Shepherd Chartered Surveyors
01/06/2022



www.shepherd.co.uk

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report is transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

Χ

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.5 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.6 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.7 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.8 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance
 to the Purchaser towards the purchase of the Property and in whose favour a standard security
 will be granted over the Property;
- the "Market Value" is the estimated amount for which a property should exchange on the date of
 valuation between a willing buyer and a willing seller in an arm's-length transaction after proper
 marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1. <u>Category 3:</u> Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3. Category 1: No immediate action or repair is needed.

WARNING:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	Detached House (converted former steading.)
Accommodation	Ground Floor: Entrance Porch, Hallway, Living Room, Dining Area, Kitchen, Utility Room, Bedroom with en-suite shower room, Bedroom (with en-suite WC), Two Further Bedrooms and Bathroom. First Floor: Landing and Bedroom.
Gross internal floor area (m²)	205 sq.m or thereby.
Neighbourhood and location	The property is located approximately 5 miles south-west of Aberdeen within a rural location and reached by a shared unmade private roadway. The Aberdeen WPR link road lies a short distance from the property. Adequate facilities and amenities may be found within reasonable distance.
Age	Converted 1997.
Weather	Dry and bright.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate. The chimney stacks are of pointed granite stone with metal flashings and clay chimney pots.

Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate. Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor
	deems it safe and reasonable to do so. The roof is of a pitched timber design clad with slates nailed to timber sarking with a tiled ridge and metal side slips. A limited inspection of part of the roof void was carried out.
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.
	The gutters and downpipes are formed in plastic.
Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The main walls are of pointed granite stonework.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	The windows are of a timber casement double glazed design. There is a wooden panelled part glazed front and rear entrance door. There is a timber casement double glazed French door from the dining area.
External decorations	Visually inspected.
	Painted external joinery.

	VII. III
Conservatories / porches	Visually inspected.
	There is an entrance porch which is mainly timber and glazed on a concrete block plinth with a pitched and slated roof and oak external features.
Communal areas	None.
Garages and permanent outbuildings	None.
r	
Outside areas and boundaries	Visually inspected.
	The subjects occupy a good sized site understood to extend to approximately two-thirds of an acre. There are stone chip parking areas to the front with stone chip and paved areas to the rear and a large area laid in grass to the side of the property. The site is bounded by timber fencing, dry stone walls and post and wire fencing.
Cailings	Viewally in an acted from floor level
Ceilings	Visually inspected from floor level.
	The ceilings within the living rooms and kitchen area are of a vaulted timber design with oak roof structure lined in timber panelling. The remaining ceilings are lined in plasterboard.
Internal walls	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	The internal walls are mainly lined in plasterboard.
Floors including sub floors	Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.
	Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.
	Floors are of solid concrete construction at ground floor level and a suspended timber design to the upper floor level.

Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	The kitchen fittings comprise a range of base and wall units incorporating a stainless steel sink unit, range cooker, fitted dishwasher and fridge. The internal doors are mainly of a timber panel design with part glazed timber doors to the vestibule and living room.
Chimney breasts and fireplaces	Visually inspected.
	vicually inoposited.
	No testing of the flues or fittings was carried out.
	There is a stone and brick feature chimney breast in the living room with a log basket fire flued to the chimney.
Internal decorations	Visually in an act of
Internal decorations	Visually inspected.
	The walls and ceilings are mainly finished in emulsion finish with timber and oak finishes to the living room, dining room and kitchen areas. The joinery finishes are mainly varnished or natural
Cellars	None.
	Trong.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	A mains supply of electricity is connected. The wiring installation is of PVC sheathed cabling with a circuit breaker style consumer unit. The meter is located externally and the consumer unit is located in the hall cupboard.
Gas	No ounnly
Gas	No supply.

Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	A mains supply of water is connected. The plumbing installation is formed in copper and uPVC pipework. The sanitary fittings comprise a three piece white shower suite with mixer shower in the en-suite shower room, a five piece white bathroom suite with separate shower cabinet and bidet in the main bathroom and a two piece white suite in the ensuite toilet.
Heating and hot water	Visual inspection of the accessible pipework, water
	tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	An oil fired central heating system supplying radiators from a "Worcester Danesmoor 26/32" floor mounted boiler located in the utility room. There is a plastic oil tank within the rear garden. There is an insulated pressurised hot water tank in the roof space.
Γ	I
Drainage	Drainage covers etc. were not lifted.
	Neither drains nor drainage systems were tested.
	Drainage is to a septic tank and soak away.
Fire, smoke and burglar alarms	Visually inspected.
	No tests whatsoever were carried out to the system or appliances.
	There are heat and smoke alarms installled.
	We are advised that fire detection equipment within the property fully complies with Scottish Government standards effective from February 2022 and this should be confirmed by the purchaser.

There is a burglar alarm system.

Any additional limits to inspection

For flats / maisonettes

Only the subject flat and internal communal areas giving access to the flat were inspected.


If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.

The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.

A limited inspection of the roof void areas was possible from the accessible hatches.

Due to fitted carpets and floor coverings no detailed inspection of floors was possible and accordingly no comment can be made on their condition.

Sectional Diagram showing elements of a typical house

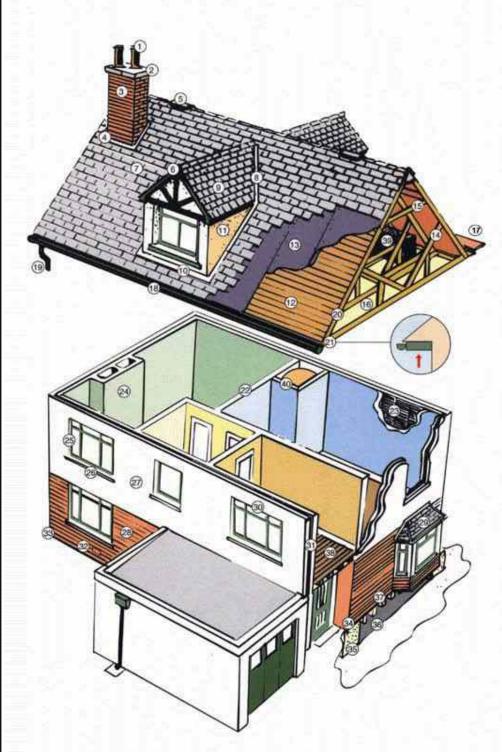

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- 2) Coping stone
- 3 Chimney head
- (4) Flashing
- 5) Ridge ventilation
- 6) Ridge board
- 7 Slates / tiles
- 8 Valley guttering
- 9 Dormer projection
- 10) Dormer flashing
- 11) Dormer cheeks
- (12) Sarking
- 13) Roof felt
- 14) Trusses
- 15) Collar
- 16) Insulation
- 17) Parapet gutter
- 18) Eaves guttering
- (19) Rainwater downpipe
- 20) Verge boards /skews
- 21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- (24) Chimney breast
- (25) Window pointing
- 26) Window sills
- 27) Rendering
- 28) Brickwork / pointing
- 29 Bay window projection
- (30) Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- (33) Damp proof course
- (34) Base course
- (35) Foundations
- 36) Solum
- Floor joists
- 38) Floorboards
- 39) Water tank
- (40) Hot water tank

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
	Repairs or replacement requiring future attention, but estimates are still advised.	•

Structural movement	
Repair category	1
Notes	There was no evidence of significant structural movement within the limitations of our inspection.

Dampness, rot and infestation	
Repair category	1
Notes	Damp meter readings were taken where considered appropriate within the property and moisture levels were found to be within an acceptable range.

Chimney stacks	
Repair category	1
Notes	Chimney stacks appear to be in a fair state of repair within the limitations of our inspection but can be vulnerable to defect and should be regularly maintained.

Roofing including roof space	
Repair category	1
Notes	No significant defects were noted at the time of inspection. Roofing contractors recommend that roof coverings are inspected regularly in order to ensure they remain watertight. Slated roofs require ongoing regular maintenannee.

Rainwater fittings	
Repair category	1
Notes	Within the limitations of our inspection rainwater goods were seen to be free from significant defect. We would highlight that it was not raining at the time of our inspection and we would recommend that all rainwater fittings be inspected during heavy rainfall in order to ensure they are free from defect.

Main walls	
Repair category	1
Notes	Within the limitations of our inspection, no significant defects were noted, however normal levels of maintenance are recommended.

Windows, external doors and joinery	
Repair category	2
Notes	Windows were not all fully opened or tested, and it should be appreciated that some defects are only evident during certain weather conditions. Within the limitations of our inspection, no significant defects were noted.
	Windows are of an age and style where a degree of ongoing maintenance should be anticipated to sealed units and opening mechanisms.
	There are a number of misted or failed double glazing seals. Slight splitting was noted to the timber sill to the kitchen window frame.

External decorations	
Repair category	1
Notes	Paint finished and decorated external surfaces will require redecoration on a regular basis.
	Some weathered sections of external paintwork were noted.

Conservatories/porches	
Repair category	1
Notes	Not applicable.

Communal areas	
Repair category	N/A
Notes	Not applicable.

Garages and permanent outbuildings	
Repair category	N/A
Notes	Not applicable.

Outside areas and boundaries	
Repair category	1
Notes	Boundary walls and fences should be regularly checked and maintained as necessary.

Ceilings	
Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted.

Internal walls	
Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted.

Floors including sub-floors	
Repair category	1
Notes	Due to fitted carpets and floor coverings no detailed inspection of floors was possible and accordingly no comment can be made on their condition.

Internal joinery and kitchen fittings	
Repair category	1
Notes	It is assumed that any glazed doors incorporate safety glass.
	Within the limitations of our inspection no significant defects were noted.

Chimney breasts and fireplaces	
Repair category	1
Notes	All flue linings should be checked, repaired if necessary and swept prior to fires/appliances being reused.

Internal decorations	
Repair category	1
Notes	The property is in good decorative order.

Cellars	
Repair category	N/A
Notes	Not applicable.

Electricity	
Repair category	1
Notes	The Institution of Engineering Technology recommends that inspections and testings are undertaken at least every five years and on a change of occupancy. It should be appreciated that only the most recently constructed or re-wired properties will have installations which fully comply with IET regulations. The owner advised that an EIC report was obtained on 27th October 2021.

Gas	
Repair category	N/A
Notes	Not applicable.

Water, plumbing and bathroom fittings		
Repair category	1	
Notes	No tests have been undertaken of the system, however within the limitations of our inspection, no significant defects were noted. No inspection has been possible to enclosed timbers beneath wet appliances and no comment has been made on the condition of unseen areas. Watertight seals will require to be regularly checked and replaced, to prevent water damage to adjoining areas.	
	Sanitary fittings appear serviceable however surround seals, tiling and finishes should be checked and maintained watertight. We were unable to view concealed areas below sanitary fittings and cannot confirm they are free from damp or other defects.	
	There is evidence of past spillage around the shower cabinet in the main bathroom and this should be checked and sealed as necessary.	

Heating and hot water		
Repair category	1	
Notes	It is assumed that the central heating system has been properly installed, updated and maintained to meet with all current regulations and standards with particular regard to fluing and ventilation requirements. Service records should be obtained and checked. In the absence of service documentation further advice should be obtained from a qualified heating engineer to ascertain the condition, efficiency, and life expectancy of the system.	
	In the absence of any recent service history documentation being available it would be prudent to have the installation checked and tested immediately upon taking occupation of the property however the valuation figure provided in the meantime presumes this to be in full safe working order.	
	Staining was noted around the base of the hot water tank in the roof space and around the manifold for the heating system in the hall cupboard. These areas were dry at the time of inspection and the owner advised that these were from previous leaks which had now been repaired.	

Drainage	
Repair category	1
Notes	There are understood to be private drainage arrangements to a septic tank and soak away. The maintenance liability, rights of access and SEPA consents should be confirmed.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	1
Roofing including roof space	1
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	2
External decorations	1
Conservatories/porches	1
Communal areas	N/A
Garages and permanent outbuildings	N/A
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	N/A
Electricity	1
Gas	N/A
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Wherea lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on? Ground and Fin		and Fire	st	
2. Are there three steps or fewer to a main entrance door of the property?	Yes	X	No	
3. Is there a lift to the main entrance door of the property?	Yes		No	X
4. Are all door openings greater than 750mm?	Yes	X	No	
5. Is there a toilet on the same level as the living room and kitchen?	Yes	X	No	
6. Is there a toilet on the same level as a bedroom?	Yes	X	No	
7. Are all rooms on the same level with no internal steps or stairs?	Yes		No	X
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes	X	No	

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialist's or contractor's advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

It is assumed that all alterations, additions and/or extensions to the property have received all necessary Town Planning (Planning Permission) and Building Authority (Building Warrants and Completion Certificate) approvals and that documentation for such is available. The property was converted around 1997.

The property has a shared unmade access road serving three houses. All rights and liabilities in this respect should be confirmed.

There are understood to be private drainage arrangements to a septic tank and soak away. The maintenance liability, rights of access and SEPA consents should be confirmed.

Estimated reinstatement cost for insurance purposes

For Reinstatement Cost Assessment purposes, it is recommended that the subjects be insured for a sum of not less than £820,000 (EIGHT HUNDRED AND TWENTY THOUSAND POUNDS)

This figure is the estimate of the cost of rebuilding the premises and bears no direct relationship to current market value.

Valuation and market comments

Having considered matters, taking account of our general observations on site, we are of the opinion that the Market Value of the subjects in their present condition and with the benefit of vacant possession may be fairly stated in the sum of £475,000 (FOUR HUNDRED AND SEVENTY FIVE THOUSAND POUNDS).

Signed	Christopher Petrie Electronically signed :- 07/06/2022 16:09
Report author	Christopher Petrie
Company name	J & E Shepherd Chartered Surveyors

Address	35 Queen's Road Aberdeen AB15 4ZN
Date of report	01/06/2022



www.shepherd.co.uk

Property Address	
Address Seller's Name Date of Inspection	Whistlebrae Steading, Banchory Devenick, ABERDEEN, AB12 5YJ Sally McAllan 01/06/2022
Property Details	
Property Type X House Purpose built flat	Bungalow Purpose built maisonette Converted maisonette Converted flat Tenement flat Flat over non-residential use Other (specify in General Remarks)
Property Style X Detached Back to back	Semi detached Mid terrace End terrace High rise block Low rise block Other (specify in General Remarks)
Does the surveyor believe that the military, police?	property was built for the public sector, e. g. local authority, Yes X No
Flats/Maisonettes only Floor(s) on wh	No. of floors in block Lift provided? Yes No
Approximate Year of Construction	1997
Tenure	
X Absolute Ownership	Other
Accommodation	
Number of Rooms 2 Living room 2 Bathroom(Gross Floor Area (excluding gather) Residential Element (greater the	s) 1 WC(s) 1 Other (Specify in General remarks) arages and outbuildings) 205 m² (Internal) 246 m² (External)
Garage / Parking / Outbuildings	
Single garage Double ga	arage X Parking space No garage / garage space / parking space
Available on site? X Yes	No
Permanent outbuildings:	
None	

Construction
Walls Brick X Stone Concrete Timber frame Other (specify in General Remarks) Roof Title X Slate Asphalt Felt Other (specify in General Remarks)
TOOI Title _/_ Olate /3prialt Telt Out (specify in deficial Nethalians)
Special Risks
Has the property suffered structural movement? Yes X No
If Yes, is this recent or progressive?
Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity?
If Yes to any of the above, provide details in General Remarks.
Service Connections
Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks
Drainage Mains X Private None Water X Mains Private None
Electricity X Mains Private None Gas Mains Private X None Central Heating X Yes Partial None
Brief description of Central Heating:
Oil fired underfloor system.
Site
Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.
Rights of way Shared drives / access Garage or other amenities on separate site Shared service connections Ill-defined boundaries Agricultural land included with property Other (specify in General Remarks)
Location
Residential suburb Residential within town / city Mixed residential / commercial Shared service connections Shared service connections I solated rural property X Other (specify in General Remarks)
Planning Issues
Has the property been extended / converted / altered? X Yes No If Yes provide details in General Remarks.
Roads
Made up road X Unmade road Partly completed new road Pedestrian access only Adopted Unadopted

General Remarks

The property is located approximately 5 miles south-west of Aberdeen within a rural location and reached by a shared unmade private roadway. The Aberdeen WPR link road lies a short distance from the property. Adequate facilities and amenities may be found within reasonable distance.

It is assumed that all alterations, additions and/or extensions to the property have received all necessary Town Planning (Planning Permission) and Building Authority (Building Warrants and Completion Certificate) approvals and that documentation for such is available. The property was converted around 1997.

The property has a shared unmade access road serving three houses. All rights and liabilities in this respect should be confirmed.

There are understood to be private drainage arrangements to a septic tank and soak away. The maintenance liability, rights of access and SEPA consents should be confirmed.

Other Accommodation: The property benefits from a utility room.	uction.	
Other recommendation. The property benefits from a unity footh.		
Essential Repairs		
None.		
Estimated cost of essential repairs £ 0 Retention recommended? Yes X No Amount	ot £ 0	
Comment on Mortgageability		
The property forms suitable security for mortgage purposes subject to the specific lending criteria of any mortgage provi	vider.	
Valuation		
Market value in present condition	£ 475,000	
Market value on completion of essential repairs	£	
Insurance reinstatement value	£ 820,000	
(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VA	<i>,</i> — —	l No
Is a reinspection necessary?	Yes X	No

Declaration

Signed Christopher Petrie

Electronically signed :- 07/06/2022 16:09

Surveyor's name Christopher Petrie

Professional qualifications MRICS

Company name J & E Shepherd Chartered Surveyors Address 35 Queen's Road, Aberdeen, AB15 4ZN

Telephone 01224 202800

Email Address aberdeen@shepherd.co.uk

Date of Inspection 01/06/2022



Energy Performance Certificate



Energy Performance Certificate (EPC)

Dwellings

Scotland

WHISTLEBRAE STEADING, BANCHORY DEVENICK, ABERDEEN, AB12 5YJ

Dwelling type:Detached houseDate of assessment:01 June 2022Date of certificate:01 June 2022Total floor area:205 m²

Primary Energy Indicator: 209 kWh/m²/year

Reference number: 5712-2226-3200-0409-4202 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: Elmhurst


Main heating and fuel: Boiler and radiators, oil

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£5,097	See your recommendations
Over 3 years you could save*	£972	report for more information

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

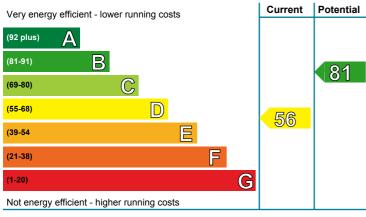


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (56)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

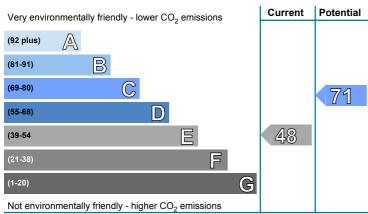

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (48)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Floor insulation (solid floor)	£4,000 - £6,000	£222.00
2 Low energy lighting	£135	£315.00
3 Condensing boiler	£2,200 - £3,000	£309.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Granite or whinstone, as built, insulated (assumed)	****	★★★☆
Roof	Pitched, 150 mm loft insulation Pitched, insulated (assumed) Roof room(s), insulated	**** **** ***	**** **** ***
Floor	Solid, limited insulation (assumed)	_	_
Windows	Fully double glazed	***	★★★☆☆
Main heating	Boiler and radiators, oil	***	★★★☆☆
Main heating controls	Time and temperature zone control	****	****
Secondary heating	None	_	_
Hot water	From main system	***	★★★☆☆
Lighting	Low energy lighting in 7% of fixed outlets	****	****

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 54 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 11 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 4.5 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home					
	Current energy costs	Potential energy costs	Potential future savings		
Heating	£3,933 over 3 years	£3,507 over 3 years			
Hot water	C422 over 2 veers	£240 over 2 veers			

		,	i stommirature sarmige
Heating	£3,933 over 3 years	£3,507 over 3 years	
Hot water	£432 over 3 years	£240 over 3 years	You could
Lighting	£732 over 3 years	£378 over 3 years	save £972
Total	s £5,097	£4,125	over 3 years


These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

December ded moses was		Indiantive and	Typical saving	Rating after improvement	
Re	commended measures	Indicative cost per year		Energy	Environment
1	Floor insulation (solid floor)	£4,000 - £6,000	£74	D 58	E 50
2	Low energy lighting for all fixed outlets	£135	£105	D 60	E 51
3	Replace boiler with new condensing boiler	£2,200 - £3,000	£103	D 63	E 54
4	Solar water heating	£4,000 - £6,000	£42	D 64	D 56
5	Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£329	C 70	D 61
6	Wind turbine	£15,000 - £25,000	£695	B 81	C 71

Choosing the right improvement package

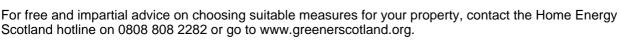



About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Floor insulation (solid floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulating solid floors can present challenges; insulation laid on top of existing solid floors may impact on existing doors and finishes whilst lifting of a solid floor to insert insulation below will require consideration of the potential effect on both structural stability and damp proofing. It is advised to seek advice from a Chartered Structural Engineer or a registered Architect about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work and may also require a building warrant so it is best to check with your local authority building standards department.

2 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting).

3 Condensing boiler

A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat this property. This improvement is most appropriate when the existing central heating boiler needs repair or replacement, however there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

4 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

5 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

6 Wind turbine

A wind turbine provides electricity from wind energy. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Wind turbines are not suitable for all properties. The system's effectiveness depends on local wind speeds and the presence of nearby obstructions, and a site survey should be undertaken by an accredited installer. Planning permission might be required and building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for a wind turbine, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	26,924	(372)	N/A	N/A
Water heating (kWh per year)	2,910			

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Christopher Petrie

Assessor membership number: EES/012882
Company name/trading name: J & E Shepherd
Address: 13 Albert Square

Dundee DD1 1XA

Phone number: 01382 200454

Email address: dundee@shepherd.co.uk

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

WHISTLEBRAE STEADING, BANCHORY DEVENICK, ABERDEEN, AB12 5YJ 01 June 2022 RRN: 5712-2226-3200-0409-4202 Recommendations Report

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT









PHERD property questionnaire

Property address	Whistlebrae Steading
	Banchory-Devenick
	Aberdeen
	AB125YJ
Seller(s)	Mr Neil McAllan
	Mrs Sally Louise McAllan
Completion date of property questionnaire	08/06/22

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership
	How long have you owned the property? 08/06/2226 years, since 1996
2.	Council tax
	Which Council Tax band is your property in? (Please tick one) ☐ A ☐ B ☐ C ☐ D ☐ E ☐ F ☒ G ☐ H
3.	Parking
	What are the arrangements for parking at your property? (Please tick all that apply)
	• Garage
	Allocated parking space
	• Driveway 🖂
	Shared parking
	• On street
	Resident permit
	Metered parking
	Other (please specify):
4.	Conservation area
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)? ☐ No ☐ Don't know

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	☐ Yes ☑ No
6.	Alterations/additions/extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	☐ Yes ☑ No
	If you have answered yes, please describe below the changes which you have made:	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	☐ Yes ⊠ No
If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.		
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property?	⊠ Yes
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	
(ii) Did this work involve any changes to the window or door openings?		☐ Yes ☑ No
	(iii) Please describe the changes made to the windows doors, or patic approximate dates when the work was completed):	doors (with
Please give any guarantees which you received for this work to your solicitor or agent.		solicitor or estate

7.	Central heating	
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom). If you have answered yes or partial — what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).	
	If you have answered yes, please answer the three questions below: (i) When was your central heating system or partial central heating.	ina system
	installed? Oil Fired Heating Dystem Installed in 1997 when the steading was co	- /
	(ii) Do you have a maintenance contract for the central heating system? If you have answered yes, please give details of the company with which you have a maintenance contract:	☐ Yes ☑ No
	(iii) When was your maintenance agreement last renewed? (Pleas month and year).	e provide the
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	⊠ Yes □ No
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it? If you have answered yes, is the damage the subject of any outstanding insurance claim?	☐ Yes ☑ No ☐ Yes ☑ No
b.	Are you aware of the existence of asbestos in your property? If you have answered yes, please give details:	☐ Yes ☑ No

10.	Services				
a. Pl	Please tick which services are connected to your property and give details of the supplier:				
	Services	Connected	Supplier		
	Gas or liquid petroleum gas	no			
	Water mains or private water supply	mains	part of cou	ncil tax	
	Electricity	yes	BULB		
	Mains drainage	no			
	Telephone	no			
	Cable TV or satellite	no			
	Broadband	no			
·					
b.	Is there a septic tank system at your property? If you have answered yes, please answer the two questions below: (i) Do you have appropriate consents for the discharge from your septic tank? (ii) Do you have a maintenance contract for your septic tank? If you have answered yes, please give details of the company with which you have a maintenance contract:			⊠ Yes □ No	
				✓ Yes☐ No☐ Don't Know	
				☐ Yes ⊠ No	

11.	Responsibilities for shared or common areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details:	☐ Yes ☑ No ☐ Don't Know
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:	☐ Yes ☑ No ☐ Not applicable
c.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	☐ Yes ☑ No
d.	Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details:	☐ Yes ☑ No
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:	☐ Yes ☑ No
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.) If you have answered yes, please give details:	☐ Yes ☑ No
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	☐ Yes ☑ No

b. c.	Is there a common buildings insurance policy? If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges? Please give details of any other charges you have to pay on a regular upkeep of common areas or repair works, for example to a residents maintenance or stair fund.	
13.	Specialist works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	☐ Yes ☑ No
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? If you have answered yes, please give details:	☐ Yes ⊠ No
C.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work? If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	☐ Yes ☑ No

14.	Guarantees					
a.	Are there any guarantees or warranties for any of the following:					
		No	Yes	Don't know	With title deeds	Lost
(i)	Electrical work	\boxtimes				
(ii)	Roofing	\boxtimes				
(iii)	Central heating	\boxtimes				
(iv)	National House Building Council (NHBC)	\boxtimes				
(v)	Damp course	\boxtimes				
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	\boxtimes				
b.	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):					
C.	Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details:				☐ Yes ☑ No	
15.	Boundaries					
	So far as you are aware, has any boundary of your property been moved in the last 10 years? If you have answered yes, please give details:			☐ Yes ☑ No ☐ Don't know		

16.	Notices that affect your property				
	In the past three years have you ever received a notice:				
а.	advising that the owner of a neighbouring property has made a planning application?	☐ Yes ☑ No			
b.	that affects your property in some other way?	☐ Yes ☑ No			
c.	that requires you to do any maintenance, repairs or improvements to your property?	☐ Yes ☑ No			
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.				
Declaration by the seller(s)/or other authorised body or person(s) I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.					
Signa	uture(s) :				
Date:	08/06/22				

Residential

Home Report

Mortgage & Re-Mortgage Valuation Home & Flat Buyer Report

Energy Performance Certificate (EPC)

Private Sale Valuation

Inheritance Tax Valuation

Capital Gains Tax Valuation

Separation Valuation

Driveby Valuation

Desktop Valuation

New Build, Development & Plot Valuation

Extension & Alteration Valuation

Portfolio Valuation

Rental Valuation

Expert Witness Report

Council Tax Appeal

Bespoke Condition Report

Commercial

Commercial Valuation

Commercial Agency

Acquisitions & Disposals

Commercial Lease Advisory

Rent Reviews

Asset Management

Project Consultancy

Development Appraisals

Elgin ▲ 01343 553939

△ 01324 635 999

Fraserburgh △ 01346 517456

△ 01896 750150

△ ▲ 0141 331 2807

Glasgow South

△ 0141 649 8020

Galashiels

Glasgow

Falkirk

Commercial Property Auctions

Property Management

Professional Services

Licensed Trade / Leisure

Glasgow West End

△ 0141 353 2080

Greenock △ 01475 730717

Hamilton △ 01698 897548

Inverness

△ ▲ 01463 712239

Kilmarnock

△ 01563 520318

Kirkcaldy △ 01592 205442

Livingston△ 01506 416777

Property &

Quantity Surveying

Building Surveying

Principal Designer

Clerk of Works

Commercial EPC

Fire Engineering

Employer's Agent

Housing Services

Energy Department

Mediation Services

Development Monitoring

Project Management

Construction

Health & Safety Management

Dispute Resolution Support Services

Montrose △ 01674 676768

Motherwell △ 01698 252229

Musselburgh

△ 0131 653 3456

Oban △ 01631 707 800

Paisley
△ 0141 889 8334

Perth

△ 01738 638188

▲ 01738 631631

Peterhead ▲ 01779 470766

St Andrews

△ 01334 477773

▲ 01334 476469

Saltcoats △ 01294 464228

Stirling △ 01786 450438 ▲ 01786 474476

Aberdeen▲ ▲ 01224 202800

△ 01292 267987

Coatbridge △ 01236 436561 Cumbernauld

△ 01236 780000

Dalkeith △ 0131 663 2780

Dumbarton △ 01389 731682

SHEPHERD

Dumfries▲ ▲ 01387 264333

Dundee

△ 01382 200454 ▲ 01382 220699

Dunfermline

▲ 01383 731841

East Kilbride

△ 01355 248535

Edinburgh

△ 0131 2251234

▲ 0131 557 9300

ShepherD



